

0052943

# **Waste Tank Summary Report for Month Ending February 29, 2000**

**RECEIVED**  
APR 21 2000  
**EDMC**

Prepared for the U.S. Department of Energy  
Assistant Secretary for Environmental Management

**CH2MHILL**  
*Hanford Group, Inc.*

Richland, Washington

Contractor for the U.S. Department of Energy  
Office of River Protection under Contract DE-AC06-99RL14047

Approved for Public Release; Further Dissemination Unlimited

#### **LEGAL DISCLAIMER**

This report was prepared as an account of work sponsored by an agency of the United States Government. Neither the United States Government nor any agency thereof, nor any of their employees, nor any of their contractors, subcontractors or their employees, makes any warranty, express or implied, or assumes any legal liability or responsibility for the accuracy, completeness, or any third party's use or the results of such use of any information, apparatus, product, or process disclosed, or represents that its use would not infringe privately owned rights. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof or its contractors or subcontractors. The views and opinions of authors expressed herein do not necessarily state or reflect those of the United States Government or any agency thereof.

This report has been reproduced from the best available copy.  
Available in paper copy and microfiche.

Available electronically at  
<http://www.doe.gov/bridge>. Available for a  
processing fee to the U.S. Department of Energy and its  
contractors, in paper, from:  
U.S. Department of Energy  
Office of Scientific and Technical Information  
P.O. Box 62  
Oak Ridge, TN 37831-0062  
phone: 865-576-8401  
fax: 865-576-5728  
email: [reports@adonis.osti.gov](mailto:reports@adonis.osti.gov)(423) 576-8401

Available for sale to the public, in paper, from:  
U.S. Department of Commerce  
National Technical Information Service  
5285 Port Royal Road  
Springfield, VA 22161  
Phone: 800-553-6847  
fax: 703-605-6900  
email: [orders@ntis.fedworld.gov](mailto:orders@ntis.fedworld.gov)  
online ordering:  
<http://www.ntis.gov/ordering.htm>

Printed in the United States of America

# **Waste Tank Summary Report for Month Ending February 29, 2000**

**B. M. Hanlon**  
CH2M HILL Hanford Group, Inc.

Date Published  
April 2000

Prepared for the U.S. Department of Energy  
Assistant Secretary for Environmental Management

**CH2MHILL**  
*Hanford Group, Inc.*

P. O. Box 1500  
Richland, Washington

Contractor for the U.S. Department of Energy  
Office of River Protection under Contract DE-AC06-99RL14047

Approved for Public Release; Further Dissemination Unlimited

## RELEASE AUTHORIZATION

**Document Number:** HNF-EP-0182-142

**Document Title:** WASTE TANK SUMMARY REPORT FOR MONTH ENDING FEBRUARY 29, 2000

**This document, reviewed in accordance with DOE Order 241.1, "Scientific and Technical Information Management," and 241.1-1, "Guide to the Management of Scientific and Technical Information," does not contain classified or sensitive unclassified information and is:**

**APPROVED FOR PUBLIC RELEASE**

  
Mark A. Williams

Lockheed Martin Services, Inc.  
Document Control/Information Clearance

4/6/00

Reviewed for Applied Technology, Business Sensitive, Classified, Copyrighted, Export Controlled, Patent, Personal/Private, Proprietary, Protected CRADA, Trademark, Unclassified Controlled Nuclear Information.

Trademark Disclaimer. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof or its contractors or subcontractors. The views and opinions of authors expressed herein do not necessarily state or reflect those of the United States Government or any agency thereof. This report has been reproduced from the best available copy.

Printed in the United States of America.

## RELEASE AUTHORIZATION

APPROVALS

Prepared by:

B. M. Hanlon  
B. M. Hanlon

3/22/00  
Date

Responsible  
Manager:

C. DeFigh-Price for  
C. DeFigh-Price, Manager  
Process Engineering

3/29/00  
Date

**This page intentionally left blank.**

## WASTE TANK SUMMARY REPORT

B. M. Hanlon

### ABSTRACT

*This report is the official inventory for radioactive waste stored in underground tanks in the 200 Areas at the Hanford Site. Data that depict the status of stored radioactive waste and tank vessel integrity are contained within the report. This report provides data on each of the existing 177 large underground waste storage tanks and 63 smaller miscellaneous underground storage tanks and special surveillance facilities, and supplemental information regarding tank surveillance anomalies and ongoing investigations. This report is intended to meet the requirement of U. S. Department of Energy-Richland Operations Office Order 435.1 (DOE-RL, July 1999, Radioactive Waste Management, U. S. Department of Energy-Richland Operations Office, Richland, Washington) requiring the reporting of waste inventories and space utilization for Hanford Tank Farm tanks.*

**This page intentionally left blank.**

HNF-EP-0182-143  
CONTENTS

Page

SUMMARY .....	1
I. WASTE TANK STATUS .....	1
II. WASTE TANK INVESTIGATIONS .....	1
III. SURVEILLANCE AND WASTE TANK STATUS HIGHLIGHTS .....	2

Appendixes:

A. WASTE TANK SURVEILLANCE MONITORING TABLES .....	A-1
--	-----

Tables:

1 Temperature Monitoring in Watch List Tanks .....	A-2
2 Temperature Monitoring in Non-Watch List Tanks .....	A-3
3 Additions/Deletions to Watch List Tanks by Year .....	A-4
4 Single-Shell Tank Monitoring Compliance Status .....	A-6
5 Double-Shell Tanks Monitoring Compliance Status .....	A-7
6 ENRAF Surface Level Gauge Installation and Data Input Methods .....	A-13
7 Tank Monitoring and Control System (TMACS) Monitoring Status .....	A-15

B. DOUBLE-SHELL TANK WASTE TYPE AND SPACE ALLOCATION .....	B-1
--	-----

Tables:

1 Double-Shell Tank Waste Type and Space Allocation .....	B-2
2 Double-Shell Tank Waste Inventory .....	B-3

Figures:

1 Total Double-Shell Tank Total Inventory .....	B-5
---	-----

C. TANK AND EQUIPMENT CODE AND STATUS DEFINITIONS .....	C-1
---	-----

1 Tank and Equipment Code/Status Definitions .....	C-2
--	-----

D. TANK FARM CONFIGURATION, STATUS AND FACILITY CHARTS .....	D-1
--	-----

Figures:

1 High-Level Waste Tank Configuration .....	D-2
2 Double-Shell Tank Instrumentation Configuration .....	D-3
3 Single-Shell Tank Instrumentation Configuration .....	D-4

E. MONTHLY SUMMARY .....	E-1
--------------------------	-----

Tables:

1 Monthly Summary .....	E-2
2 Tank Use Summary .....	E-3
3 Pumping Record, and Liquid Status and Pumpable Liquid Remaining In Tanks .....	E-4
4 Inventory Summary by Tank Farm .....	E-5
5 Inventory and Status by Tank - Double-Shell Tanks .....	E-6
6 Inventory and Status by Tank - Single-Shell Tanks .....	E-8

F. PERFORMANCE SUMMARY .....	F-1
------------------------------	-----

Table:

1 Summary of Waste Transactions in the Double-Shell Tanks .....	F-2
2 Comparison of Projected Versus Actual Waste Volumes for Hanford Facilities .....	F-3

**G. MISCELLANEOUS UNDERGROUND STORAGE TANKS AND SPECIAL SURVEILLANCE FACILITIES . . . . . G-1****Tables:**

- 1 Misc. Underground Storage Tanks and Special Surveillance Facilities (Active) . G-2  
 2 East Area Inactive Underground Storage Tanks and Special Surveillance Facilities (Inactive) . . . . . G-3  
 3 West Area Inactive Underground Storage Tanks and Special Surveillance Facilities (Inactive) . . . . . G-4

**H. LEAK VOLUME ESTIMATES . . . . . H-1****Table:**

- 1 Single-Shell Tank Leak Volume Estimates . . . . . H-2

**I. SINGLE-SHELL TANKS INTERIM STABILIZATION, AND CONTROLLED, CLEAN AND STABLE STATUS . . . . . I-1****Tables:**

- 1 Single-Shell Tanks Interim Stabilization Status . . . . . I-2  
 2 Single-Shell Tank Interim Stabilization Milestones . . . . . I-4  
 3 Single-Shell Tanks Stabilization Status Summary . . . . . I-6

METRIC CONVERSION CHART		
1 inch	=	2.54 centimeters
1 foot	=	30.48 centimeters
1 gallon	=	3.80 liters
1 ton	=	0.90 metric tons
$^{\circ}\text{F} = \left( \frac{9}{5} ^{\circ}\text{C} \right) + 32$		
1 Btu/h = 2.930711 E-01 watts (International Table)		

## WASTE TANK SUMMARY REPORT FOR MONTH ENDING FEBRUARY 29, 2000

**Note:** Changes from the previous month are in bold print.

### I. WASTE TANK STATUS

Category	Quantity	Date of Last Change
Double-Shell Tanks <sup>b</sup>	28 double-shell	10/86
Single-Shell Tanks	149 single-shell	1966
Assumed Leaker Tanks	67 single-shell	07/93
Sound Tanks	28 double-shell 82 single-shell	1986 07/93
Interim Stabilized Tanks <sup>a</sup>	121 single-shell	01/00
Not Interim Stabilized <sup>c</sup>	28 single-shell	01/00
Intrusion Prevention Completed	108 single-shell	09/96
Controlled, Clean, and Stable <sup>f</sup>	36 single-shell	09/96
Watch List Tanks <sup>d</sup>	21 single-shell 6 double-shell	12/99 <sup>e</sup> 06/93
Total	27 tanks	

<sup>a</sup> Of the 121 tanks classified as Interim Stabilized, 64 are listed as Assumed Leakers. (See Table I-1)

<sup>b</sup> Six double-shell tanks are currently included on the Hydrogen Watch List and are thus prohibited from receiving waste in accordance with "Safety Measures for Waste Tanks at Hanford Nuclear Reservation," Section 3137 of the *National Defense Authorization Act for Fiscal Year 1991*, November 5, 1990, Public Law 101-510.

<sup>c</sup> Three of these tanks are Assumed Leakers (BY-105, BY-106, SX-104). (See Table H-1)

<sup>d</sup> See Section A tables for more information on Watch List Tanks.

<sup>e</sup> Dates for the Watch List tanks are "officially added to or removed from the Watch List" dates. Eighteen tanks were removed from the Organics Watch List in December 1998; two tanks still remain on this watch list. In December 1999, tank C-106 was officially removed from the High Heat Load Watch List.

<sup>f</sup> The TY tank farm was officially declared Controlled, Clean, and Stable (CCS) in March 1996. The TX tank farm and BX tank farms were declared CCS in September 1996.

### II. WASTE TANK INVESTIGATIONS

This section includes all single- or double-shell tanks or catch tanks which are showing surface level or interstitial liquid level (ILL) decreases, or drywell radiation level increases in excess of established criteria.

#### A. Assumed Leakers or Assumed Re-leakers: (See Appendix C for definition of "Re-leaker")

This section includes all single- or double-shell tanks or catch tanks for which an off-normal or unusual occurrence report has been issued, or for which a waste tank investigation is in progress, for assumed leaks or re-leaks.

Tanks/catch tanks will remain on this list until either a) completion of Interim Stabilization, b) the updated occurrence report indicates that the tank/catch tank is not an assumed leaker, or c) the investigation is completed.

There are no formal leak investigations in progress. There are no tanks for which an off-normal or unusual occurrence report has been issued for assumed leaks or re-leaks.

**B. Tanks with increases indicating possible intrusions:**

This section includes all single-shell tanks and related receiver tanks for which the surveillance data show that the surface level or ILL has met or exceeded the increase criteria, or are still being investigated.

**Candidate Intrusion List:** Increase criteria in the following tanks indicate possible intrusions.

Tank 241-B-202  
Tank 241-BX-101  
Tank 241-BX-103  
Tank 241-BY-103

The surveillance data was last reviewed on the tanks listed as having probable liquid intrusions: Memo 74B20-99-045, dated November 22, 1999.

**Catch Tank 241-AX-152:** The liquid level in this catch tank was steady around 66.75 inches from the startup of Project W-030, Tank Farm Ventilation System, in March 1998 until late August 1998. The level then began to decrease. The October 1998 reading of 65 inches is 1.75 inches below the summer average. This is an active catch tank, routinely pumped, and deviations from baseline are not applicable per OSD-00031. The decrease represents a significant change in trend and it is apparent that tank conditions changed around the end of August 1998.

**Resolution Status:** Discrepancy Report #98-853 was issued on November 4, 1998. One possible cause under investigation is a change in flow path, causing an increase in evaporation. The tank was pumped down to 2.25 inches on November 13, 1998. Since that time the level has decreased to 0.00 inches. The Discrepancy Report will remain open and catch tank AX-152 will remain on the alert list until an engineering investigation is complete. Preparation of Work Package ES-99-00133 to perform an airflow rate assessment in the tank is continuing. There are still issues to be resolved before the preparation of this Work Package can be completed.

### III. SURVEILLANCE AND WASTE TANK STATUS HIGHLIGHTS

**1. Single-Shell Tanks Saltwell Jet Pumping (See Table E-6 footnotes for further information)**

**Tank 241-S-102** - Pumping continued until November 17, 1999, when pump problems forced a shutdown. The pump was replaced and pumping resumed on February 19, 2000. In February 2000, a total of 3.3 Kgallons was pumped; a total of 46.1 Kgallons has been pumped from this tank since pumping started in March 1999.

**Tank 241-S-103** - Pumping was discontinued on January 5, 2000, to allow the waste levels to stabilize, so waste porosities and final waste volumes can then be calculated to determine whether this tank meets Interim Stabilization criteria.

**Tank 241-S-106** - Pumping was discontinued on January 3, 2000, to allow the waste levels to stabilize, so waste porosities and final waste volumes can then be calculated to determine whether this tank meets Interim Stabilization criteria.

**Tank 241-SX-104** - Pumping was interrupted on July 27, 1999, by a leaking saltwell pump. This tank is being evaluated for stabilization based on equipment failure. A total of 231.3 Kgallons has been pumped from this tank since pumping started in the late 1980s.

**Tank 241-SX-106**- Pumping was discontinued on January 5, 2000, to allow the waste levels to stabilize, so waste porosities and final waste volumes can then be calculated to determine whether this tank meets Interim Stabilization criteria.

**Tank 241-U-102** - Pumping commenced January 20, 2000. In February 2000, a total of 10.3 Kgal was pumped from this tank; a total of 15.9 Kgal has been pumped from this tank since start of pumping in January, 2000.

**Tank 241-U-103** - Pumping commenced September 26, 1999. In February 2000, a total of 10.1Kgal was pumped; a total of 86.0 Kgal has been pumped from this tank since start of pumping in September 1999.

**Tank 241-U-105** - Pumping commenced December 10, 1999. In February 2000, a total of 12.4 Kgal was pumped; a total of 64.0 Kgal has been pumped from this tank since start of pumping in December 1999.

## **2. Double-Shell Tank 241-SY-101 Waste Level Increase**

Tank 241-SY-101 exhibited gas release events due to generation and retention of flammable gas. A mixer pump was installed in the tank in July 1993, which circulates liquid wastes. This prevents gas bubbles from building up at the bottom, and results in venting of small steady gas releases. Since early 1997, the surface level has been rising in spite of regular mixer pump operations.

**Resolution Status:** On February 11, 1998, the PRC recommended that the DOE-RL declare an Unreviewed Safety Question (USQ) over the continued level growth observed in this tank. The contractor has established a multi-disciplinary team to solve the level growth issues in SY-101. The prime near-term focus is to transfer approximately 100,000 gallons out of SY-101.

Approximately 90,000 gallons of waste were transferred from SY-101 to SY-102 on December 18 and 19, 1999. This waste was diluted with an equal amount of water during the transfer. Subsequent to the transfer, approximately 60,000 gallons of water was back diluted into SY-101.

The second of three waste transfers was completed January 27, 2000, two months ahead of schedule. More than 240,000 gallons of waste were transferred from SY-101 to SY-102. In conjunction with the transfer, another 198,000 gallons of dilution water were added to SY-102 to reduce the concentration of gas-generating and gas-retaining chemicals.

Also, 78,000 gallons of back dilution water were added to the top of the waste in SY-101 to dissolve the crust. Gas releases following this top dilution resulted in the retained gas volumes being significantly decreased.

In February 2000, 160,000 gallons of back dilution water were pumped to the bottom of SY-101 to dissolve most of the remaining solids in the tank and to prevent the future reformation of a crust.

The third transfer of SY-101 waste to SY-102 was initiated on February 29, 2000. It is expected that approximately 285,000 gallons will be transferred, and will be completed early in March 2000.

## **3. RL-PHMC-TANKFARM-1999-0063. Occurrence Report. "An Unreviewed Safety Question Was Discovered." Unusual Occurrence. Latest update: November 4, 1999.**

The completion times identified in LCO 3.1.3, Transfer Leak Detection Systems, action statement A.2.2.1, "Verify there is no detectable leakage at the leak detection location using an alternate monitoring device," could allow operation outside the analyzed Authorization Basis. This action statement allows the use of alternate leak detection devices with a surveillance frequency not supported by the Authorization Basis.

Standing Order #TWO-99-34 was issued to prohibit implementation of this action statement until this issue is resolved.

The Plant Review Committee directed performance of an Unreviewed Safety Question Determination.

On October 11, 1999, this event was upgraded to "Unusual Occurrence."

November 4, 1999: The following information was transferred from UOR -1999-0055 to this report:

On August 3, 1999, the Plant Review Committee (PRC) concluded that a Potential Inadequacy in Authorization Basis (PIAB) exists with respect to the inadequacy of the applicability statement of Limiting Conditions to Operation (LCOs) 3.3.3 and 3.3.3. Process area applicability of transfer system covers that are "PHYSICALLY CONNECTED to an ACTIVE WASTE transfer pump not under administrative lock" may be inadequate for 242-A Evaporator emergency dump configurations.

A final report will be submitted on or before April 1, 2000.

**4. RL-LMHC-TANKFARM-1999-0023. Occurrence Report. "Additional Information Regarding Crust Growth in 241-SY-101." Off-Normal. Notification: April 9, 1999. Latest Update : December 12, 1999.**

This update report is being submitted to include new information regarding this event.

On December 18, 1999, approximately 90,000 gallons of nuclear waste was transferred from tank SY-101 to SY-102 in the first of three planned transfers. The next stage of this transfer is scheduled to occur early in the year 2000.

In conjunction with the transfers, water is added to the waste to reduce the concentration of gas generation and gas-retaining chemicals to reduce gas buildup in SY-101 and associated receiving tanks.

This report is being extended pending completion and evaluation of the next two planned transfer stages. An Update or Final report will be submitted no later than April 27, 2000.

The second of the three waste transfers was completed on January 27, 2000.

The third and final phase of transfers was initiated on February 29, 2000.

**5. RP-LMHC-TANKFARM-1999-0010. Occurrence Report. "311-ER Vapor Sample Indicated High Lower Flammability Limit Reading." Off-Normal. Notification November 2, 1999.**

On November 1, 1999, 241-ER-311 Catch Tank was vapor sampled during planned Characterization Operations sampling. The results of the sampling with a Combustible Gas Meter (CGM) revealed a reading of >25% Lower Flammability Limit (LFL) reading. A second reading was obtained using a different instrument; again the reading was >25% LFL. Both readings were off scale (HIGH). Samples were captured and sent to the lab for analysis.

All work was terminated on or near tank ER-311. Restricted access to the fenced area that surrounds this tank was initiated by controlling the entrance key and posting the gate, pending further investigation and subsequent resolution.

The Plant Review Committee met on November 9, 1999, to review sample data and status of field activities. A portable exhaustor has been installed to remove the argon used to dilute/displace flammable concentrations of hydrogen.

Operational restrictions remain on ER-311 and adjacent facilities (ER-311 pump pit, ER-151 and ER-152 diversion boxes).

**6. RP-LMHC-TANKFARM-1999-0019. "Leak Detector in the 241-SY-02A Pit Activated During Saltwell Transfer." Off Normal. Notification: December 2, 1999.**

On December 1, 1999, while saltwell transfers from S-103, S-106 and SX-106 were in progress, a leak detector in the SY-02A pit was activated. All saltwell transfers were automatically shut down upon leak detection activation. A subsequent flush from S-103 reactivated the leak detector, confirming a potential leak in the pit.

The leak detection alarm at SY-102 pump was classified as an off-normal occurrence.

All active transfers to the SY-02A pit were immediately stopped. Administrative locks were applied to the transfer pumps per LCO. Leak in pit was confirmed.

**7. RP-CHG-TANKFARM-2000-0002. "Release of Radioactive Material at 241-S-103 During Saltwell Pumping." Unusual Occurrence. Update: February 16, 2000**

At approximately 0230 hours on January 6, 2000, while operating the S-103 saltwell, liquid was discovered leaking from an electrical junction box on the pump pit. The saltwell was immediately shut down, administrative lock applied and placed in short term shutdown. The saltwell operators evacuated the area and notified the West Tank Farm Shift Manager. The affected area was immediately isolated inside the tank farm. Health Physics Technicians (HPTs) were dispatched and began surveying personnel out of the tank farm. Precautionary roadblocks were set up to isolate the affected area surrounding the tank farm until the release could be investigated. HPTs surveyed the affected release area and determined it to be a High Radiation Area and the area was roped off. Contamination occurred on the personal clothing of three operators with only readings below reportable levels.

Further investigation by the Environmental Compliance Officer revealed that the two-to-five gallon spill contained Cesium-137 at a level which exceeded the CERCLA Reportable Quantity for this material. As a result, this event is being recategorized from an Off-Normal to an Unusual Occurrence.

Recovery actions were initiated to decontaminate the leak area by removing the contaminated soil and placing it in barrels staged at the facility.

Evaluations were initiated to estimate the release and determine the exact leak location.

This report is extended to facilitate further clarification of potential PAAA issues and suggested corrective actions. Further evaluation or final submission will take place no later than March 30, 2000.

**8. RP-CHG-TANKFARM-2000-0007. "Suspected Failure of the 241-U-109 to U-C Valve Pit Transfer Line." Unusual Occurrence. Update: March 1, 2000**

While performing a pressure test of the transfer line from tank 241-U-109 to the U-C valve Pit, the line pressure suddenly dropped from approximately 190 psig to 20 psig. To perform the pressure test, 80 gallons of clean water had been added to the line. This section of transfer line had been previously used and is radioactively contaminated.

After the pressure test failed, a visual investigation was performed of the interconnected pits to determine the source of the failure. This investigation did not reveal any liquid in the pits. At this time, it is assumed that the transfer line failed, causing the clean water in the line to leak into the soil.

This event was categorized as an Unusual Occurrence.

On January 27, 2000, a change to work package WS-99-131 was approved by the environmental, operations, and engineering organizations to perform a verification of integrity of transfer line SN-104. Also on January 27, 60 gallons of water was added to SN-104 to verify that the connections and fittings for the test apparatus were tight. The system would not build up to pressure higher than 10 psi while the 60 gallons were added. All connections were checked and did not leak. This invalidated the integrity of the line and it is considered failed.

A pressure test of the transfer line was performed to verify the integrity of the piping system. A sudden loss of pressure was experienced, although no equipment failure was identified or suspected, and no visual indication of water release was observed. The cause of the failure is expected to be the result of galvanic corrosion associated with the direct buried waste transfer line system. There were no indications in the past to show that the transfer line was failing or would fail.

This occurrence report will be cancelled.

**2. RP-CHG-TANKFARM-2000-0016, "Loss of 241-SY-102 Primary Tank Leak Detection System (USO)." Unusual Occurrence, Notification: February 16, 2000**

On February 16, 2000, the SY-102 annulus conductivity probe instrumentation indicated an alarm condition. The annulus continuous alarm monitor (CAM) had been previously taken out of service for maintenance. These conditions caused the Primary Tank Leak Detection System to be inoperable. Limiting Condition for Operation (LCO) states that one of the two primary tank leak detection systems shall be operable.

Immediate efforts were made to replace the annulus stack CAM to restore annulus ventilation. Attempts to reset the annulus conductivity probe were not successful.

**10. RP-CHG-TANKFARM-2000-0017, Abnormal Radiation Detected at Pit OSC at Tank 241-U-105." Off-Normal, Notification: February 25, 2000**

Abnormal radiation levels were detected at Pit OSC at Tank U-105 during a normal routine survey. No alarming leak detectors were discovered.

On February 23, 2000, a video shoot was taken of the pits while water flushing was performed. This validated that there was a small leak off the pit jumper manifold in the U-A valve pit. This leak was contained within the U-A valve pit and the OSC sluice pit.

U-Farm saltwell transfers were shut down as a precautionary measure. After pumping was stopped and the lines flushed, dose rates on contact with the shielding were 45 mr/hr. Dosimeter information from employees in the vicinity during this time is being evaluated.

**APPENDIX A**

**WASTE TANK SURVEILLANCE MONITORING TABLES**

TABLE A-1. TEMPERATURE MONITORING IN WATCH LIST TANKS (Sheet 1 of 2)

February 29, 2000

These tanks have been identified as Watch List Tanks in accordance with Public Law 101-510, Section 3137, "Safety Measures for Waste Tanks at Hanford Nuclear Reservation," (1990), because they "... may have a serious potential for release of high-level waste due to uncontrolled increases in temperature or pressure."

All Watch List tanks are reviewed for increasing temperature trends. Temperatures in these tanks are monitored by the Tank Monitor And Control System (TMACS), unless indicated otherwise.

Temperatures are taken in the waste unless in-waste thermocouples are out of service. Temperatures below are the highest temperatures recorded in these tanks during this month.

Temperatures in Degrees F.

SINGLE-SHELL TANKS					
Hydrogen (Flammable Gas)			Organics		
<u>Tank No.</u>	<u>Temp.</u>	<u>Officially Added to Watch List</u>	<u>Tank No.</u>	<u>Temp.</u>	<u>Officially Added to Watch List</u>
A-101	147	1/91	C-102	83	5/94
AX-101	128	1/91	C-103	113	1/91
AX-103	108	1/91	2 Tanks		
S-102	101	1/91			
S-111	89	1/91			
S-112	83	1/91			
SX-101	132	1/91			
SX-102	141	1/91			
SX-103	159	1/91			
SX-104	139	1/91			
SX-105	164	1/91			
SX-106	100	1/91			
SX-109 (1)	136	1/91			
T-110 (3)	85	1/91			
U-103	86	1/91			
U-105	89	1/91			
U-107	78	12/93			
U-108	87	1/92			
U-109	84	1/91			
10 Tanks					
DOUBLE-SHELL TANKS					
AN-103	106	1/91	21 Single-Shell tanks 8 Double-Shell tanks 27 Tanks on Watch Lists		
AN-104	107	1/91			
AN-105	101	1/91			
AW-101	99	6/93			
SY-101	124	1/91			
SY-103	94	1/91			
5 Tanks					

All tanks were removed from the Ferrocyanide Watch List and 18 tanks from the Organics Watch List. Tank C-106 was removed from the High Heat Load Watch List on December 16, 1999. See Table A-3.

**TABLE A-1. TEMPERATURE MONITORING IN WATCH LIST TANKS**  
(sheet 2 of 2)

**Notes:****Unreviewed Safety Question (USQ):**

When a USQ is declared, special controls are required, and work in the tanks is limited. There are currently no USQs on single-shell tanks. There is a USQ on double-shell tank SY-101 for liquid level increase.

**Hydrogen/Flammable Gas:**

These tanks are suspected of having a significant potential for hydrogen/flammable gas generation, entrapment, and episodic release. The USQ associated with these tanks was closed in September 1998. Twenty-five tanks (19 SST and 6 DST) remain on the Hydrogen Watch List.

**Organic Salts:**

These tanks contain concentrations of organic salts  $\geq 3$  weight% of total organic carbon (TOC)(equivalent to 10 wt% sodium acetate). The USQ associated with these tanks was closed in October 1998, and 18 organic complexant tanks were removed from the Organic Watch List in December 1998. Two organic solvent tanks (C-102 and C-103) remain on the Organic Watch List.

**High Heat:**

These tanks contain heat generating strontium-rich sludge and require drainable liquid to be maintained in the tank to promote cooling. There are currently no tanks on the High Heat Load Watch List.

**Active ventilation:**

There are 15 single-shell tanks on active ventilation (seven are on the Watch List as indicated by an asterisk):

C-105	SX-107
C-106 (2)	SX-108
SX-101 *	SX-109 * (1)
SX-102 *	SX-110
SX-103 *	SX-111
SX-104 *	SX-112
SX-105 *	SX-114
SX-106 *	

**Footnotes:**

- (1) Tank SX-109 is on the Hydrogen Watch List as it has the potential for flammable gas accumulation only because other SX tanks vent through it.
- (2) Tank C-106 was removed from the High Heat Load Watch List on December 16, 1999.  
A process test is being done to get an estimate of the amount of heat load remaining in the waste.
- (3) TMACS is O/S due to power outage since August 1999, which caused damage to acromags in T, TX and TY farms. Readings taken manually.

## TABLE A-2 TEMPERATURE MONITORING IN NON-WATCH LIST TANKS

February 29, 2000

SINGLE-SHELL TANKS WITH HIGH HEAT LOADS (>26,000 Btu/hr)

Nine tanks have high heat loads for which temperature surveillance requirements are established by HNF-SD-WM-TSR-006, Rev 1, *Tank Waste Remediation System Technical Safety Requirements*, December 1999.

In an analysis, WHC-SD-WM-SARR-010, Rev 1, *Heat Removal Characteristics of Waste Storage Tanks*, Kummerer, 1995, it was estimated that nine tanks have heat sources >26,000 Btu/hr, which is the new parameter for determining high heat load tanks. See also document HNF-SD-WM-BIO-001, Rev 1, *Tank Waste Remediation System Basis for Interim Operation*, Noorani, 1998.

Temperatures in these tanks did not exceed TSR requirements for this month, and are monitored by the Tank Monitor and Control System (TMACS), unless indicated otherwise. All high heat load tanks are on active ventilation.

<u>Tank No.</u>	<u>Temperature (F.)</u>
C-106 (1)	60 (Riser #8)
SX-103	159
SX-107	164
SX-108	181
SX-109 (2)	136
SX-110	161
SX-111	182
SX-112	146
SX-114	175

**8 Tanks**

- Notes:
- (1) C-106 was removed from the High Heat Load Watch List on December 16, 1999. A process test is being done to get an estimate of the amount of heat load remaining in the waste.
  - (2) SX-109 is on the Hydrogen Watch List as it has the potential for flammable gas accumulation only because the other SX tanks vent through it.

SINGLE-SHELL TANKS WITH LOW HEAT LOADS (<26,000 Btu/hr)

There are 114 low heat load non-watch list tanks. Temperatures in tanks connected to TMACS are monitored by TMACS; temperatures in those tanks not yet connected to TMACS are manually taken semiannually in January and July. Temperatures obtained semiannually have been within historical ranges for the applicable tank.

No temperatures have been obtained for several years in the tanks listed below. Most of these tanks have no thermocouple tree.

<u>Tank No.</u>	<u>Tank No.</u>
BX-104	TX-101
BY-102	TX-110
BY-109	TX-114
C-204	TX-116
SX-115	TX-117
T-102	U-104
T-105	

**TABLE A-3. ADDITIONS/DELETIONS TO WATCH LISTS BY YEAR**  
February 29, 2000

Added/Deleted dates may differ from dates that tanks were officially added to the Watch Lists. (See Table A-1).

	Ferrocyanide	Hydrogen	Organics	High Heat	SST	DST	Total
					47	0	47
Added 2/81 (revision to Original List)	1 T-107				1		1
Added 8/82		1 AW-101				1	1
					48	0	48
Added 3/83 Deleted 7/83	-4 (BX-110) (BX-111) (BY-101) (T-101)		1 U-111		1 -4		
Added 12/83		1 (U-107)			0		
	50	25	5		48	0	73
Added 2/84 Added 5/84			1 T-111 10 A-101 AX-102 C-102 S-111 SX-103 TY-104 U-103 U-106 U-203 U-204		1 4		
Deleted 11/84	-2 (BX-102) (BX-106)				-2		
	48	25	20	1	46	0	74
Deleted 6/86	-4 (C-108) (C-109) (C-111) (C-112)				-4		
Deleted 9/86	-14 (BY-103) (BY-104) (BY-106) (BY-107) (BY-108) (BY-110) (BY-111) (BY-112) (T-107) (TX-118) (TY-101) (TY-103) (TY-104)				-12		
Deleted 12/88			-18 (A-101) (AX-102) (B-103) (S-102) (S-111) (SX-103) (SX-106) (T-111) (TX-106) (TX-118) (TY-104) (U-103) (U-106) (U-106) (U-107) (U-111) (U-203) (U-204)		-10		
	34	25	2		36	0	61
Deleted 12/99				-1 (C-108)	-1		
					21	0	27

(1) Eighteen of the 20 tanks were removed from the Organics Watch List in December 1998; eight of the tanks removed from the Organics List are also on the Hydrogen Watch List; therefore, the total tanks added/deleted depends upon whether a tank is also on another list.

TABLE A-4. SINGLE-SHELL TANKS MONITORING COMPLIANCE STATUS

149 TANKS (Sheet 1 of 6)

February 29, 2000

The following table indicates whether Single-Shell tank monitoring was in compliance with the requirements as specified in the applicable documents as of the last day of the applicable month:

## NOTE:

All Watch List and High Heat tank temperature monitoring is in compliance. (4)

All Dome Elevation Survey monitoring is in compliance, with exception (see footnote 11).

All Psychrometrics monitoring is in compliance (2).

Drywell monitoring no longer required (5).

In-tank photos/videos are taken "as needed"

## LEGEND:

██████████	= in compliance with all applicable documentation
N/C	= noncompliance with applicable documentation
O/S	= Out of Service
Neutron	= LOW readings taken by Neutron probe
POP	= Plant Operating Procedure, TO-040-850
MT/FIC/ENRAF	= Surface level measurement devices
OSD	= Operating Spec. Doc., OST-T-151-00013, 00030, 00031
N/A	= Not applicable (not monitored, or no monitoring schedule)
None	= Applicable equipment not installed
FSAR/TSR	= Final Safety Analysis Report/Technical Safety Requirements

Tank Number	Tank Category		Temperature Readings (4)	Primary Leak Detection Source (5)	Surface Level Readings (1) (OSD)			LOW Readings (OSD)(5,7) Neutron
	Watch List	High Heat			MT	FIC	ENRAF	
A-101	██████████	██████████	██████████	LOW	None	None	None	None
A-102	██████████	██████████	██████████	None	None	None	None	None
A-103	██████████	██████████	██████████	LOW	None	None	None	None
A-104	██████████	██████████	██████████	None	None	None	None	None
A-105	██████████	██████████	██████████	None	None	None	None	None
A-106	██████████	██████████	██████████	None	None	None	None	None
AX-101	██████████	██████████	██████████	LOW	None	None	None	None
AX-102	██████████	██████████	██████████	None	None	None	None	None
AX-103	██████████	██████████	██████████	None	None	None	None	None
AX-104	██████████	██████████	██████████	None	None	None	None	None
B-101	██████████	██████████	██████████	None	None	None	None	None
B-102	██████████	██████████	██████████	ENRAF	None	None	None	None
B-103	██████████	██████████	██████████	None	None	None	None	O/S
B-104	██████████	██████████	██████████	LOW	None	None	None	None
B-105	██████████	██████████	██████████	LOW	None	None	None	None
B-106	██████████	██████████	██████████	FIC	None	None	None	None
B-107	██████████	██████████	██████████	None	None	None	None	None
B-108	██████████	██████████	██████████	None	None	None	None	None
B-109	██████████	██████████	██████████	None	None	None	None	None
B-110	██████████	██████████	██████████	LOW	None	None	None	O/S, N/A
B-111	██████████	██████████	██████████	LOW	None	None	None	None
B-112	██████████	██████████	██████████	ENRAF	None	None	None	None
B-201	██████████	██████████	██████████	MT	None	None	None	None
B-202	██████████	██████████	██████████	MT	None	None	None	None
B-203	██████████	██████████	██████████	MT	None	None	None	None
B-204	██████████	██████████	██████████	MT	None	None	None	None
BX-101	██████████	██████████	██████████	ENRAF	None	None	None	None
BX-102	██████████	██████████	██████████	None	None	None	None	None
BX-103	██████████	██████████	██████████	ENRAF	None	None	None	None
BX-104	██████████	██████████	██████████	ENRAF	None	None	None	None
BX-105	██████████	██████████	██████████	None	None	None	None	None
BX-106	██████████	██████████	██████████	ENRAF	None	None	None	None
BX-107	██████████	██████████	██████████	ENRAF	None	None	None	None

**TABLE A-5. SINGLE-SHELL TANKS MONITORING COMPLIANCE STATUS**  
**149 TANKS (Sheet 2 of 6)**

Tank Number	Tank Category		Temperature Readings (4)	Primary Leak Detection Source (5)	Surface Level Readings (1) (OSD)			LOW Readings (OSD)(5,7) Neutron
	Watch List	High Heat			MT	FIC	ENRAF	
BX-108				None				
BX-109				None				
BX-110				None				
BX-111				LOW				
BX-112				ENRAF				
BY-101				LOW				
BY-102				LOW				
BY-103				LOW				
BY-104				LOW				
BY-105				LOW				
BY-106				LOW				
BY-107				LOW				
BY-108				None				
BY-109				LOW				
BY-110				LOW				
BY-111				LOW				
BY-112				LOW				
C-101				None				
C-102				None				
C-103				ENRAF				
C-104				None				
C-105				None				
C-106 (3)				ENRAF				
C-107				ENRAF				
C-108				None				
C-109				None				
C-110				MT				
C-111				None				
C-112				None				
C-201				None				
C-202				None				
C-203				None				
C-204				None				
S-101				ENRAF				
S-102				ENRAF				
S-103				ENRAF				
S-104				LOW				
S-105				LOW				
S-106				ENRAF				
S-107				ENRAF				
S-108				LOW				
S-109				LOW				
S-110				LOW				
S-111				ENRAF				
S-112				LOW				
SX-101				LOW				
SX-102				LOW				
SX-103				LOW				
SX-104				LOW				
SX-105				LOW				
SX-106				ENRAF				
SX-107				None				
SX-108				None				

**TABLE A-5. SINGLE-SHELL TANKS MONITORING COMPLIANCE STATUS**  
**149 TANKS (Sheet 3 of 6)**

Tank Number	Tank Category		Temperature Readings (4)	Primary Leak Detection Source (5)	Surface Level Readings (1) (OSD)			LOW Readings (OSD)(5,7) Neutron
	Watch List	High Heat			MT	FIC	ENRAF	
SX-109				None				
SX-110				None				
SX-111				None				
SX-112				None				
SX-113				None				
SX-114				None				
SX-115				None				
T-101				None				
T-102				ENRAF				
T-103				None				
T-104				LOW				
T-105				None				
T-106				None				
T-107				ENRAF				
T-108				ENRAF				
T-109				None				
T-110				LOW				
T-111				LOW				
T-112				ENRAF				
T-201				MT				
T-202				MT				
T-203				None				
T-204				MT				
TX-101				ENRAF				
TX-102				LOW				
TX-103				None				
TX-104				None				
TX-105				None				
TX-106				LOW				
TX-107				None				
TX-108				None				
TX-109				LOW				
TX-110				LOW				
TX-111				LOW				
TX-112				LOW				
TX-113				LOW				
TX-114				LOW				
TX-115				LOW				
TX-116				None				
TX-117				LOW				
TX-118				LOW				
TY-101				None				
TY-102				ENRAF				
TY-103				LOW				
TY-104				ENRAF				
TY-105				None				
TY-106				None				
U-101				MT				
U-102				LOW				
U-103				ENRAF				
U-104				None				
U-105				ENRAF				
U-106				ENRAF				

**TABLE A-5. SINGLE-SHELL TANKS MONITORING COMPLIANCE STATUS**  
**149 TANKS (Sheet 4 of 6)**

Tank Number	Tank Category		Temperature Readings (4)	Primary Leak Detection Source (5)	Surface Level Readings (1) (OSD)			LOW Readings (OSD)(5,7) Neutron
	Watch List	High Heat			MT	FIC	ENRAF	
U-107				ENRAF				
U-108				LOW				
U-109				ENRAF				
U-110				None				
U-111				LOW				
U-112				None				
U-201				MT				
U-202				MT				
U-203				None				
U-204				ENRAF				
<b>Catch Tanks and Special Surveillance Facilities</b>								
A-302-A								
A-302-B								
ER-311								
AX-152								
AZ-151								
AZ-154								
BX-TK/SMP								
A-244 TK/SMP								
AR-204								
A-417								
A-350								
CR-003								
Vent Sta.								
244-B TK/SMP								
S-302								
S-304								
TX-244 TK/SMP								
TX-302-B								
TX-302-C								
U-301-B								
UX-302-A								
S-141								
S-142								
<b>Totals:</b>	<b>21</b>	<b>9</b>	<b>N/C: 0</b>		<b>N/C: 0</b>	<b>N/C: 0</b>	<b>N/C: 0</b>	<b>N/C: 0</b>
<b>149 tanks</b>	<b>Watch List Tanks (4)</b>	<b>High Heat Tanks (4)</b>						

**TABLE A-4. SINGLE-SHELL TANKS MONITORING COMPLIANCE STATUS -149 TANKS**  
(Sheet 5 of 6)

## Footnotes:

1. All SSTs have either manual tape, FIC, or ENRAF surface level measuring devices. Some also have zip cords.

ENRAF gauges are being installed to replace FICs (or sometimes manual tapes). The ENRAF gauges are being connected to TMACS, but many are currently being read manually from the field. See Table A-6 for list of ENRAF installations.

2. High heat tanks have active exhausters; psychrometrics can be taken in the high heat tanks. Psychrometric readings are taken on an "as needed" basis with the exception of tanks C-105 and C-106. Document OSD-T-151-00013 requires psychrometric readings to be taken in C-105 and C-106 on a monthly frequency when the ventilation system is running. Psychrometric readings previously taken monthly in SX-farm will now be taken annually.
3. Tank C-106 was removed from the High Heat Load Watch List on December 16, 1999.
4. Temperature readings may be regulated by OSD, POP, or FSAR (FSAR only regulates high heat load tanks). Temperatures cannot be obtained in 13 low heat load tanks (see Table A-2). The OSD does not require readings or repair of out-of-service thermocouples for the low heat load ( $\leq 26,000$  Btu/h) tanks. However, the POP requires that attempts are to be made semiannually in January and July to obtain readings for these tanks.

Temperatures in some tanks cannot be taken in the waste because the waste level is lower than the lowest thermocouple in these tanks.

Temperatures for many tanks are monitored continuously by TMACS; see Table A-7, TMACS Monitoring Status.

5. Document OSD-T-151-00031, "Operating Specifications for Tank Farm Leak Detection," REV C-0, January 13, 1999, requires that single-shell tanks with the surface level measurement device contacting liquid, partial liquid, or floating crust surface, will be monitored for leak detection on a daily basis. Tanks with a solid surface will be monitored for leak detection on a weekly basis by taking neutron scan data from a Liquid Observation Well (LOW), if an LOW is present. Tanks with a solid surface but without LOWs will not be monitored for leak detection if the tank has been interim stabilized, until an LOW is installed.

This OSD revision does not require drywell surveys to be taken. The OSD specifies what leak detection methods are to be used for each tank, and the requirements if the readings are not taken on the required frequency or if equipment is out of service.

6. Leak detection for the catch tanks is performed by monitoring for the buildup of liquid in the secondary containment (for most tanks with secondary containment) or for decrease in the liquid level for those tanks without secondary containment or secondary containment monitoring.

Catch tank 240-S-302 is monitored for intrusions only, and is not subject to leak detection monitoring requirements until liquid is present above the intrusion level.

Weight Factor is the surface level measuring device currently used in A-417, A-350, 244-A Tank/Sump, and 244-S Tank/Sump. Weight factor is now the measuring device in 244-BX Tank DRT, as the manual tape is stuck in the riser. DCRT CR-003 is inactive and measured in gallons.

**TABLE A-4. SINGLE-SHELL TANKS MONITORING COMPLIANCE STATUS - 149 TANKS**  
(Sheet 6 of 6)

7. Document SD-WM-TI-605, REV. 0, dated January 1994, describes the rationale for Liquid Observation Well (LOW) installation priority. This priority is based on tank leak status, tank surface condition, and tank stabilization status. Also included is a listing of tanks with the waste level being below two feet which have no priority assigned because no effort will be made to install LOWs in the near future. LOW probes are unable to accurately monitor interstitial liquid levels less than two feet high.

Tanks which will not receive LOWs:

A-102	BX-101	C-201	T-106
A-104	BX-103	C-202	T-108
A-105	BX-105	C-203	T-109
AX-102	BX-106	C-204	TX-107
AX-104	BX-108	SX-110	TY-102
B-102	C-108	SX-113	TY-104
B-103	C-109	SX-115	TY-106
B-112	C-111	T-102	U-101
		T-103	U-112

Total - 34 Tanks

8. Tank TX-105 - the LOW was in riser 8; the riser has been removed and the LOW has not been monitored since January 1987. Liquid levels are being taken in riser 9 by ENRAF and recorded in TMACS.
9. Tank AX-101 - LOW readings are taken by gamma sensors.
10. Tank B-110 - The LOW has failed as a result of an integrity test. Discrepancy Report 99-864 was issued November 30, 1999, to repair the LOW. This tank also has a Manual Tape backup device which is scheduled to take readings on a quarterly frequency. The last M.T. reading was on January 20, 2000, and was within normal range. Work Package 2W-00-05 is in process of being approved.
11. Tank S-110 - Neutron LOW scan taken on January 27, 2000, was more than 3 standard deviations above baseline, indicating a possible intrusion. Discrepancy Report 00-875 was issued February 1, 2000. Work Package 2W-99-1310 has been issued; work is expected to be completed approximately mid-March 2000.

TABLE A-5. DOUBLE-SHELL TANKS MONITORING COMPLIANCE STATUS

28 TANKS (Sheet 1 of 2)

February 29, 2000


The following table indicates whether Double-Shell tank monitoring was in compliance with the requirements as specified in the applicable documents as of the last day of the applicable month.

## NOTE:

Dome Elevation Surveys are not required for DSTs.

Psychrometrics and in-tank photos/videos are taken "as needed" (2)

## LEGEND:

	= In compliance with all applicable documentation
N/C	= Noncompliance with applicable documentation
FIC/ENRAF	= Surface level measurement devices
M.T.	
OSD	= OSD-T-151-0007, OSD-T-151-00031
None	= no M.T., FIC or ENRAF installed
O/S	= Out of Service
W.F.	= Weight Factor
N/A	= Not Applicable (not monitored or no monitoring schedule)
Rad.	= Radiation

Tank Number	Watch List	Temperature Readings (3) (OSD)	Surface Level Readings (1) (OSD)			Radiation Readings		Annulus (OSD)
			M.T.	FIC	ENRAF	Leak Detection Pits (4) (OSD)		
						W.F.	Rad. (5)	
AN-101				None	None		N/A	
AN-102				None	None		N/A	
AN-103				None	None		N/A	
AN-104				None	None		N/A	
AN-105				None	None		N/A	
AN-106				None	None		N/A	
AN-107				None	None		N/A	
AP-101				None	None	OS (7)	N/A	
AP-102				None	None	OS (7)	N/A	
AP-103				None	None	OS (7)	N/A	
AP-104				None	None	OS (7)	N/A	
AP-105				None	None	OS (7)	N/A	
AP-106				None	None	OS (7)	N/A	
AP-107				None	None	OS (7)	N/A	
AP-108				None	None	OS (7)	N/A	
AW-101				None	None	OS (7)	N/A	
AW-102				None	None		N/A	
AW-103				None	None		N/A	
AW-104				None	None		N/A	
AW-105				None	None		N/A	
AW-106				None	None		N/A	
AY-101				None	None	OS	N/A	OS
AY-102				None	None		N/A	
AZ-101				None	None		N/A	OS
AZ-102				None	None		N/A	OS
SY-101				None	None	OS	N/A	
SY-102				OS (7)	None		N/A	
SY-103				OS (7)	None	OS	N/A	
Totals: 28 tanks	6 Watch List Tanks	N/C: 0	N/C: 0	N/C: 0	N/C: 0	N/C: 0	N/C: 0	N/C: 0

**TABLE A-5. DOUBLE-SHELL TANKS MONITORING COMPLIANCE STATUS - 28 TANKS**  
(Sheet 2 of 2)

## Footnotes:

1. Some double-shell tanks have both FIC and manual tape which is used when the FIC is out of service. Noncompliance (N/C) will be shown when no readings are obtained. ENRAF gauges are being installed to replace FICs. The ENRAF gauges are being connected to TMACS, but some are currently being read manually.
2. Psychrometric readings are taken on an "as needed" basis. No psychrometric readings are currently being taken in the double-shell tanks.
3. OSD specifies double-shell tank temperature limits, gradients, etc.
4. Applicable OSD and HNF-IP-0842, latest revisions, are used as guidelines for monitoring Leak Detection Pits. See also (6) and (7) below.
5. AW-102 has ENRAF, FIC and M.T. At some point the FIC will be removed.
6. USQ TF-97-0038, dated April 28, 1997, specifics discontinuing the use of leak detection pit radiation monitoring equipment in all double-shell tank farms where the leak detection pits are used as tertiary leak detection. This applies to all double-shell tank farms.
7. Leak Detection Pit weekly readings are being obtained by Instrument Technicians in these tanks:  
AP-103C (for tanks AP-101 - 104)  
AP-105C (for tanks AP-105 - 108)
8. SY-103 - Manual Tape has sporadic readings. ENRAF is primary device.  
SY-102 - Manual Tape has sporadic readings. ENRAF is primary device.
9. AP-103 - ENRAF O/S since February 18, 2000. Displaying error message, and data is suspect. Discrepancy Report 00-876 issued February 22, 2000. Work Package 99-244 issued to functional test the ENRAF.

**TABLE A-6. ENRAF SURFACE LEVEL GAUGE INSTALLATION AND  
DATA INPUT METHODS**  
February 29, 2000

<b>LEGEND</b>											
<b>SACS</b>			= Surveillance Analysis Computer System								
<b>TMACS</b>			= Tank Monitor and Control System								
<b>Auto</b>			= Automatically entered into TMACS and electronically transmitted to SACS								
<b>Manual</b>			= Manually entered directly into SACS by surveillance personnel, from Field Data sheets								
<b>EAST AREA</b>						<b>WEST AREA</b>					
Tank No.	Installed Date	Input Method	Tank No.	Installed Date	Input Method	Tank No.	Installed Date	Input Method	Tank No.	Installed Date	Input Method
A-101	08/95	Auto	B-201			B-101	02/95	Auto	TX-101	11/95	Auto
A-102			B-202			B-102	05/95	Auto	TX-102	05/95	Auto
A-103	07/95	Auto	B-203			B-103	05/94	Auto	TX-103	12/95	Auto
A-104	05/95	Manual	B-204			B-104	05/95	Auto	TX-104	03/95	Auto
A-105			BX-101	04/95	Auto	B-105	07/95	Auto	TX-105	04/95	Auto
A-106	01/95	Auto	BX-102	06/95	Auto	B-106	06/94	Auto	TX-106	04/95	Auto
AN-101	08/95	Auto	BX-103	04/95	Auto	B-107	06/94	Auto	TX-107	04/95	Auto
AN-102			BX-104	05/95	Auto	B-108	07/95	Auto	TX-108	04/95	Auto
AN-103	08/95	Auto	BX-105	03/95	Auto	B-109	06/95	Auto	TX-109	11/95	Auto
AN-104	08/95	Auto	BX-106	07/94	Auto	B-110	06/95	Auto	TX-110	05/95	Auto
AN-105	08/95	Auto	BX-107	06/95	Auto	B-111	06/94	Auto	TX-111	05/95	Auto
AN-106			BX-108	05/95	Auto	B-112	05/95	Auto	TX-112	05/95	Auto
AN-107			BX-109	08/95	Auto	BX-101	04/95	Auto	TX-113	05/95	Auto
AP-101	06/99	Auto	BX-110	08/95	Auto	BX-102	04/95	Auto	TX-114	05/95	Auto
AP-102	06/99	Auto	BX-111	05/95	Auto	BX-103	04/95	Auto	TX-115	05/95	Auto
AP-103	08/99	Auto	BX-112	03/95	Auto	BX-104	05/95	Auto	TX-116	05/95	Auto
AP-104	07/99	Auto	BY-101			BX-105	05/95	Auto	TX-117	06/95	Auto
AP-105	08/99	Auto	BY-102	09/99	Manual	BX-106	06/94	Auto	TX-118	03/95	Auto
AP-106	08/99	Auto	BY-103	12/95	Manual	BX-107	08/99	Auto	TY-101	07/95	Auto
AP-107	06/99	Auto	BY-104			BX-108	09/99	Auto	TY-102	08/95	Auto
AP-108	06/99	Auto	BY-105			BX-109	09/95	Auto	TY-103	08/95	Auto
AW-101	08/95	Auto	BY-106			BX-110	09/99	Auto	TY-104	08/95	Auto
AW-102	05/95	Auto	BY-107			BX-111	09/99	Auto	TY-105	12/95	Auto
AW-103	05/95	Auto	BY-108			BX-112	09/99	Auto	TY-106	12/95	Auto
AW-104	01/95	Auto	BY-109			BX-113	09/99	Auto	U-101		
AW-105	06/95	Auto	BY-110	02/97	Manual	BX-114	09/99	Auto	U-102	01/95	Manual
AW-106	06/95	Auto	BY-111	02/99	Manual	BX-115	09/99	Manual	U-103	07/94	Auto
AX-101	08/95	Auto	BY-112			BY-101	07/94	Auto	U-104		
AX-102	08/95	Auto	C-101			BY-102	06/94	Auto	U-105	07/94	Auto
AX-103	08/95	Auto	C-102			BY-103	07/94	Auto	U-106	08/94	Auto
AX-104	10/95	Auto	C-103	08/94	Auto	T-101	05/95	Manual	U-107	08/94	Auto
AY-101	03/95	Auto	C-104	04/99	Manual	T-102	06/94	Auto	U-108	05/95	Auto
AY-102	01/95	Auto	C-105	05/95	Manual	T-103	07/95	Manual	U-109	07/94	Auto
AZ-101	08/95	Manual	C-106	02/95	Auto	T-104	12/95	Manual	U-110	01/95	Manual
AZ-102			C-107	04/95	Auto	T-105	07/95	Manual	U-111	01/95	Manual
B-101			C-108			T-106	07/95	Manual	U-112		
B-102	02/95	Manual	C-109			T-107	06/94	Auto	U-201		
B-103			C-110			T-108	10/95	Manual	U-202		
B-104			C-111			T-109	08/94	Manual	U-203	09/95	Manual
B-105			C-112	03/95	Manual	T-110	05/95	Auto	U-204	06/95	Manual
B-106			C-201			T-111	07/95	Manual			
B-107			C-202			T-112	08/95	Manual			
B-108			C-203			T-201					
B-109			C-204			T-202					
B-110						T-203					
B-111						T-204					
B-112	03/95	Manual									
Total East Area: 53						Total West Area: 77					

130 ENRAFs installed: 104 automatically entered into TMACS, 26 manually entered into SACS

TABLE A-7. TANK MONITOR AND CONTROL SYSTEM (TMACS)

February 29, 2000

Note: Indicated below are the number of tanks having at least one operating sensor monitored by TMACS.

Some tanks have more than one sensor: multiple sensors of the same type in a tank are not shown in the table (for example: 10 tanks in BY-Farm have at least one operating TC sensor and 3 tanks in BY-Farm have at least one operating RTD sensor).

## Acceptance Testing Completed: Sensors Automatically Monitored by TMACS

EAST AREA Tank Farm	Temperatures		ENRAF Level Gauge	Pressure (b)	Hydrogen (c)	Gas Sample Flow
	Thermocouple Tree (TC)	Resistance Thermal Device (RTD)				
A-Farm (6 Tanks)	1		3		1	1
AN-Farm (7 Tanks)	7		4	7	3	3
AP-Farm (8 Tanks)			8			
AW-Farm (6 Tanks)	6		6		1	1
AX-Farm (4 Tanks)	3		4		1	
AY-Farm (2 Tanks)			2			
AZ-Farm (2 Tanks)						
B-Farm (16 Tanks)	1					
BX-Farm (12 Tanks)	11		12 (e)			
BY-Farm (12 Tanks)	10	3				
C-Farm (16 Tanks)	15	1	3	1		
<b>TOTAL EAST AREA (91 Tanks)</b>	<b>54</b>	<b>4</b>	<b>42</b>	<b>8</b>	<b>6</b>	<b>5</b>
<b>WEST AREA</b>						
S-Farm (12 Tanks)	12		12	1	3	3
SX-Farm (15 Tanks)	14		14	1	7	7
SY-Farm (3 Tanks) (a)	3		3	1	2	2
T-Farm (16 Tanks) (d)	14	1	3		1	1
TX-Farm (18 Tanks) (d)	13		18			
TY-Farm (6 Tanks) (d)	6	3	6			
U-Farm (16 Tanks)	15		6	4	6	6
<b>TOTAL WEST AREA (86 Tanks)</b>	<b>77</b>	<b>4</b>	<b>62</b>	<b>7</b>	<b>19</b>	<b>19</b>
<b>TOTALS (177 Tanks)</b>	<b>131</b>	<b>8</b>	<b>104</b>	<b>15</b>	<b>25</b>	<b>24</b>

- (a) Tank SY-101 has 2 gas sample flow sensors plus 2 vent flow sensors, and 2 ENRAFs.  
 (b) Each tank has two sensors (high and low range).  
 (c) Each tank has two sensors (high and low range).  
 (d) TMACS has been out of service since August 1999 due to power outage which caused damage to acromags in T, TX and TY farms. Readings taken manually.

**APPENDIX B**  
**DOUBLE-SHELL TANK WASTE TYPE**  
**AND SPACE ALLOCATION**

Table B-1. Double-Shell Tank Waste Inventory for February 29, 2000 (Sheet 1 of 2)

TANKS	TOTAL	SALTCAKE	SOLIDUS	WASTE	VOLUME
INVENTORY			TYPE	LBMT	
AN-101=	180	33	0	DN	860
AN-102=	1066	89	0	CC	84
AN-103=	866	0	457	DS	184
AN-104=	1053	449	0	DSRF	87
AN-105=	1128	489	0	DSRF	14
AN-106=	38	17	0	CC	1102
AN-107=	1041	247	0	CC	89
AP-101=	1114	0	0	DSRF	28
AP-102=	1080	0	0	CP	80
AP-103=	283	0	0	CC	857
AP-104=	1112	0	0	CC	28
AP-105=	783	89	0	DSRF	377
AP-106=	82	0	0	DN	1048
AP-107=	39	0	0	DN	1101
AP-108=	361	0	0	DN	789
AW-101=	1128	306	0	DSRF	14
AW-102=	516	36	0	DN	124
AW-103=	1012	47	316	NCAW	828
AW-104=	1118	231	0	DN	22
AW-105=	427	0	255	NCAW	967
AW-106=	473	225	0	DSRF	713
AV-101=	148	0	84	DC	831
AV-102=	611	0	184	DN	389
AZ-101=	649	0	46	NCAW	131
AZ-102=	946	0	86	NCAW	34
SY-101=	808	686	0	CC	234
SY-102=	820	0	71	DWPT	320
SY-103=	744	368	0	CC	388
TOTAL=	20001	3508	1841		11379

NOTE: Solids Adjusted to Most Current Available Data  
NOTE: All Volumes in 100-Gallons (Kgals)

## Inventory Calculation by Waste Type:

COMPLEXED WASTE	
AN-102=	987 (CC)
AN-106=	21 (CC)
AN-107=	784 (CC)
AP-103=	283 (CC)
AP-104=	1112 (CC)
AV-101=	56 (CC)
SY-101=	321 (CC)
SY-102=	378 (CC)
TOTAL DCSRF=	3631
TOTAL SOLIDS=	1388
NCAW SOLIDS (PD)	
AW-103=	363
AW-105=	255
TOTAL=	618
PPP SOLIDS (PT)	
SY-102=	71
TOTAL=	71
CONCENTRATED PHOSPHATE (CP)	
102-AP=	1090
TOTAL=	1090

TOTAL DST SPACE AVAILABLE	
NON-AGING =	27360
AGING =	3820
TOTAL=	31180

DST INVENTORY CHANGE	
1289 TOTAL	18870
0180 TOTAL	20001
CHANGE=	5831

## WATCH LIST SPACE

AN-103=	184
AN-104=	87
AN-105=	14
SY-101=	14
SY-102=	234
TOTAL=	309

## RESTRICTED SPACE

AN-102=	84
AN-107=	99
AP-102=	50
AZ-101=	131
AZ-102=	34
TOTAL=	280

## WASTE RECEIVER SPACE

AP-108 (200E/DN)=	1048
AP-108 (200E/DN)=	759
SY-102 (200W/DN)=	320
TOTAL=	2127

## USABLE SPACE CHANGE

0180 TOTAL SPACE	4843
0200 TOTAL SPACE	4405
CHANGE=	438

## WASTE RECEIVER SPACE CHANGE

0180 TOTAL SPACE	1822
0200 TOTAL SPACE	2127
CHANGE=	305

## COMPLEXED WASTE

AN-102=	987 (CC)
AN-106=	21 (CC)
AN-107=	784 (CC)
AP-103=	283 (CC)
AP-104=	1112 (CC)
AV-101=	56 (CC)
SY-101=	321 (CC)
SY-102=	378 (CC)
TOTAL DCSRF=	3631
TOTAL SOLIDS=	1388

## NCAW SOLIDS (PD)

AW-103=	363
AW-105=	255
TOTAL=	618

## PPP SOLIDS (PT)

SY-102=	71
TOTAL=	71

## CONCENTRATED PHOSPHATE (CP)

102-AP=	1090
TOTAL=	1090

## DS/DSRF

AN-103=	489
AN-104=	604
AN-106=	837
AP-101=	1114
AP-105=	874
AW-101=	820
AW-106=	248
TOTAL DCSRF=	4286
TOTAL SOLIDS=	3918

## GRAND TOTALS

NCAW SOLIDS=	618
DST SOLIDS=	387
PPP SOLIDS=	71
AGING SOLIDS=	134
CC=	3876
DC=	56
CP=	1080
NCAW=	1681
DS/DSRF=	4586
DILUTE=	4003
TOTAL=	20001

INV200

Table B-1. Double-Shell Tank Waste Inventory for February 29, 2000 (Sheet 2 of 2)

TOTAL AVAILABLE SPACE AS OF FEBRUARY 29, 2000				11279 KGALS
WATCH LIST TANK SPACE:				
	TANK	WASTE TYPE	AVAILABLE SPACE	
<i>Unusable DST Headspace - Due to Special Restrictions Placed on the Tanks, as Stated in the "Wyden Bill"</i>	AN-103	DSS	184 KGALS	
	AN-104	DSSF	87 KGALS	
	AN-105	DSSF	14 KGALS	
	AW-101	DSSF	14 KGALS	
	SY-101	CC	234 KGALS	
	SY-103	CC	396 KGALS	
	TOTAL=			929 KGALS
AVAILABLE TANK SPACE=			11279 KGALS	
MINUS WATCH LIST SPACE=			-929 KGALS	
TOTAL AVAILABLE SPACE AFTER WATCH LIST SPACE DEDUCTIONS=			10350 KGALS	
RESTRICTED TANK SPACE:				
	TANK	WASTE TYPE	AVAILABLE SPACE	
<i>DST Headspace Available to Store Only Specific Waste Types</i>	AN-102	CC	84 KGALS	
	AN-107	CC	99 KGALS	
	AP-102	CP	50 KGALS	
	AZ-101	AW	131 KGALS	
	AZ-102	AW	34 KGALS	
	TOTAL=			398 KGALS
AVAILABLE SPACE AFTER WATCH LIST DEDUCTIONS			10350 KGALS	
MINUS RESTRICTED SPACE=			-398 KGALS	
TOTAL AVAILABLE SPACE AFTER RESTRICTED SPACE DEDUCTIONS=			9952 KGALS	
USABLE/WASTE RECEIVER TANK SPACE:				
	TANK	WASTE TYPE	AVAILABLE SPACE	
<i>DST Headspace Available to Store Facility Generated and Evaporator Product Waste</i>	AN-101	DN	980 KGALS	
	AN-106	CC	1102 KGALS	
	AP-101	DSSF	26 KGALS	
	AP-103	CC	857 KGALS	
	AP-104	CC	28 KGALS	
	AP-105	DSSF	377 KGALS	
	AP-106	DN	1048 KGALS	
	AP-107	DN	1101 KGALS	
	AP-108	DN	759 KGALS	
	AW-102	DN	124 KGALS	
FACILITY WASTE RECEIVER TANK	AW-103	NCRW	628 KGALS	
	AW-104	DN	22 KGALS	
	AW-105	NCRW	713 KGALS	
	AW-106	DSSF	667 KGALS	
EVAPORATOR RECEIVER TANK	AY-101	DC	831 KGALS	
	AY-102	DN	369 KGALS	
FACILITY WASTE RECEIVER TANK	BY-102	DN	320 KGALS	
	TOTAL AVAILABLE USABLE TANK SPACE=			9952 KGALS
EVAPORATOR OPERATIONAL TANK SPACE:			-1140 KGALS	
SPARE TANK SPACE: (DOE Order 6820.2A)			-2280 KGALS	
TOTAL TANK SPACE AVAILABLE AFTER ALL DEDUCTIONS=			6532 KGALS	

SEG0200

MILLIONS OF GALLONS

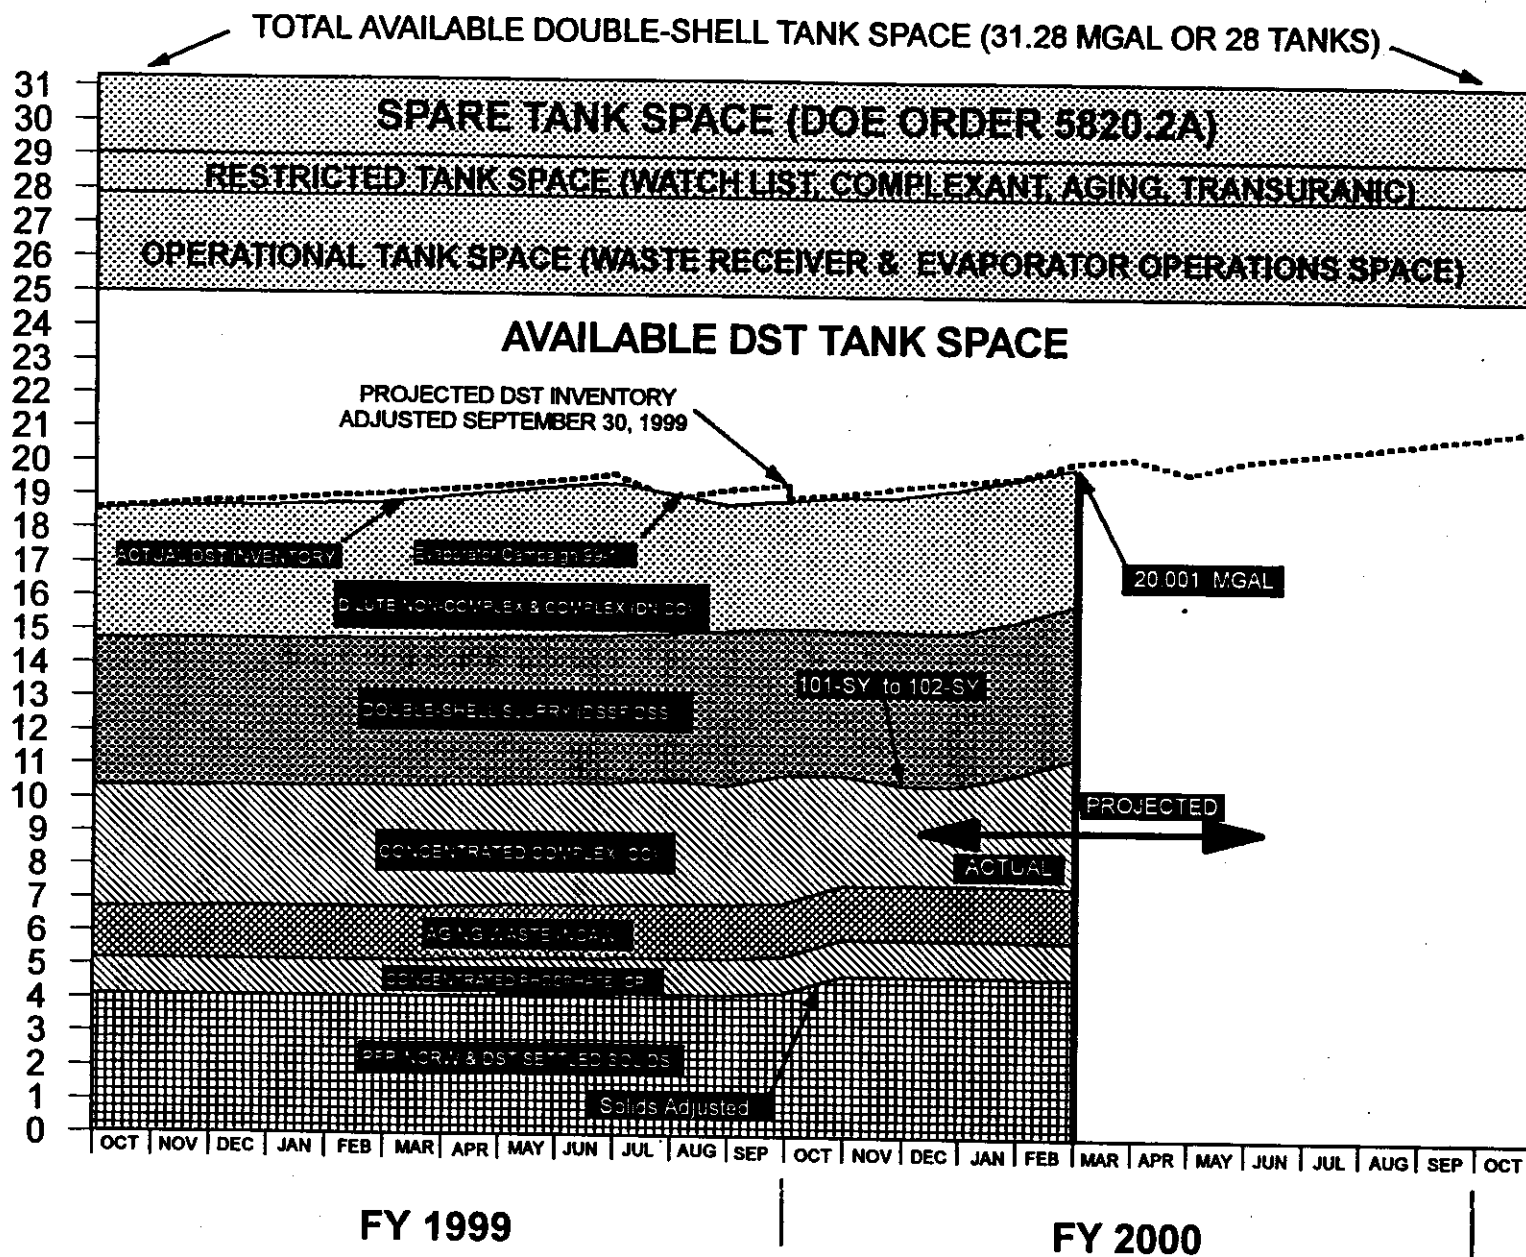


FIGURE B-1. TOTAL DOUBLE-SHELL TANK INVENTORY

TOTWASTE1

HNF-EP-0182-143

**APPENDIX C**

**TANK AND EQUIPMENT CODE  
AND STATUS DEFINITIONS**

## C. TANK AND EQUIPMENT CODE/STATUS DEFINITIONS

February 29, 2000

1. TANK STATUS CODESWASTE TYPE (also see definitions, section 3)

AGING	Aging Waste (Neutralized Current Acid Waste [NCAW])
CC	Complexant Concentrate Waste
CP	Concentrated Phosphate Waste
DC	Dilute Complexed Waste
DN	Dilute Non-Complexed Waste
DSS	Double-Shell Slurry
DSSF	Double-Shell Slurry Feed
NCPLX	Non-Complexed Waste
PD/PN	Plutonium-Uranium Extraction (PUREX) Neutralized Cladding Removal Waste (NCRW), transuranic waste (TRU)
PT	Plutonium Finishing Plant (PFP) TRU Solids

TANK USE (DOUBLE-SHELL TANKS ONLY)

CWHT	Concentrated Waste Holding Tank
DRCVR	Dilute Receiver Tank
EVFD	Evaporate Feed Tank
SRCVR	Slurry Receiver Tank

2. SOLID AND LIQUID VOLUME DETERMINATION METHODS

F	Food Instrument Company (FIC) Automatic Surface Level Gauge
E	ENRAF Surface Level Gauge (being installed to replace FICs)
M	Manual Tape Surface Level Gauge
P	Photo Evaluation
S	Sludge Level Measurement Device

3. DEFINITIONSWASTE TANKS - GENERALWaste Tank Safety Issue

A potentially unsafe condition in the handling of waste material in underground storage tanks that requires corrective action to reduce or eliminate the unsafe condition.

Watch List Tank

An underground storage tank containing waste that requires special safety precautions because it may have a serious potential for release of high level radioactive waste because of uncontrolled increases in temperature or pressure. Special restrictions have been placed on these tanks by "Safety Measures for Waste Tanks at Hanford Nuclear Reservation," Section 3137 of the *National Defense Authorization Act for Fiscal Year 1991*, November 5, 1990, Public Law 101-510, (also known as the Wyden Amendment).

Characterization

Characterization is understanding the Hanford tank waste chemical, physical, and radiological properties to the extent necessary to insure safe storage and interim operation, and ultimate disposition of the waste.

## WASTE TYPES

### Aging Waste (AGING)

High level, first cycle solvent extraction waste from the PUREX plant (NCAW)

### Concentrated Complexant (CC)

Concentrated product from the evaporation of dilute complexed waste.

### Concentrated Phosphate Waste (CP)

Waste originating from the decontamination of the N Reactor in the 100 N Area. Concentration of this waste produces concentrated phosphate waste.

### Dilute Complexed Waste (DC)

Characterized by a high content of organic carbon including organic complexants: ethylenediaminetetraacetic acid (EDTA), citric acid, and hydroxyethyl-ethylenediaminetriacetic acid (HEDTA), being the major complexants used. Main sources of DC waste in the DST system are saltwell liquid inventory (from SSTs).

### Dilute Non-Complexed Waste (DN)

Low activity liquid waste originating from T and S Plants, the 300 and 400 Areas, PUREX facility (decladding supernatant and miscellaneous wastes), 100 N Area (sulfate waste), B Plant, saltwells, and PFP (supernate).

### Double-Shell Slurry (DSS)

Waste that exceeds the sodium aluminate saturation boundary in the evaporator without exceeding receiver tank composition limits. For reporting purposes, DSS is considered a solid.

### Double-Shell Slurry Feed (DSSF)

Waste concentrated just before reaching the sodium aluminate saturation boundary in the evaporator without exceeding receiver tank composition limits. This form is not as concentrated as DSS.

### Non-complexed (NCPLX)

General waste term applied to all Hanford Site (NCPLX) liquors not identified as complexed.

### PUREX Decladding (PD)

PUREX Neutralized Cladding Removal Waste (NCRW) is the solids portion of the PUREX plant neutralized cladding removal waste stream; received in Tank Farms as a slurry. NCRW solids are classified as transuranic (TRU) waste.

### PFP TRU Solids (PT)

TRU solids fraction from PFP Plant operations.

### Drainable Interstitial Liquid (DIL)

Interstitial liquid that is not held in place by capillary forces, and will therefore migrate or move by gravity. (See also Section 4)

### Supernate

The liquid above the solids or in large liquid pools covered by floating solids in waste storage tanks. (See also Section 4 below)

### Ferrocyanide

A compound of iron and cyanide commonly expressed as  $\text{FeCN}$ . The actual formula for the ferrocyanide anion is  $[\text{Fe}(\text{CN})_6]^{4-}$ .

**INTERIM STABILIZATION (Single-Shell Tanks only)****Interim Stabilized (IS)**

A tank which contains less than 50 Kgallons of drainable interstitial liquid and less than 5 Kgallons of supernatant liquid. If the tank was jet pumped to achieve interim stabilization, then the jet pump flow or saltwell screen inflow must also have been at or below 0.05 gpm before interim stabilization criteria is met.

**Jet Pump**

The jet pump system includes 1) a jet assembly with foot valve mounted to the base of two pipes that extend from the top of the well to near the bottom of the well casing inside the saltwell screen, 2) a centrifugal pump to supply power fluid to the down-hole jet assembly, 3) flexible or rigid transfer jumpers, 4) a flush line, and 5) a flowmeter. The jumpers contain piping, valves, and pressure and limit switches.

The centrifugal pump and jet assembly are needed to pump the interstitial liquid from the saltwell screen into the pump pit, nominally a 40-foot elevation rise. The power fluid passes through a nozzle in the jet assembly and acts to convert fluid pressure head to velocity head, thereby reducing the pressure in the jet assembly chamber. The reduction in pressure allows the interstitial liquid to enter the jet assembly chamber and mix with the power fluid. Velocity head is converted to pressure head above the nozzle, lifting power fluid, and interstitial liquid to the pump pit. Pumping rates vary from 0.05 gallons to about 4 gpm.

**Saltwell Screen**

The saltwell system is a 10-inch diameter saltwell casing consisting of a stainless steel saltwell screen welded to a Schedule 40 carbon steel pipe. The casing and screen are to be inserted into the 12-inch tank riser located in the pump pit. The stainless steel screen portion of the system will extend through the tank waste to near the bottom of the tank. The saltwell screen portion of the casing is an approximately 10-foot length of 300 Series, 10-inch diameter, stainless steel pipe with screen openings (slots) of 0.05 inches.

**Emergency Pumping Trailer**

A 45-foot tractor-type trailer is equipped to provide storage space and service facilities for emergency pumping equipment: this consists of two dedicated jet pump jumpers and two jet pumps, piping and dip tubes for each, two submersible pumps and attached piping, and a skid-mounted Weight Factor Instrument Enclosure (WFIE) with an air compressor and electronic recording instruments. The skid also contains a power control station for the pumps, pump pit leak detection, and instrumentation. A rack for over 100 feet of overground double-contained piping is also in the trailer.

**INTRUSION PREVENTION (ISOLATION) Single-Shell Tanks only****Partially Interim Isolated (PI)**

The administrative designation reflecting the completion of the physical effort required for Interim Isolation except for isolation of risers and piping that is required for jet pumping or for other methods of stabilization.

**Interim Isolated (II)**

The administrative designation reflecting the completion of the physical effort required to minimize the addition of liquids into an inactive storage tank, process vault, sump, catch tank, or diversion box. In June 1993, Interim Isolation was replaced by Intrusion Prevention.

**Intrusion Prevention (IP)**

Intrusion Prevention is the administrative designation reflecting the completion of the physical effort required to minimize the addition of liquids into an inactive storage tank, process vault, sump, catch tank,

or diversion box. Under no circumstances are electrical or instrumentation devices disconnected or disabled during the intrusion prevention process (with the exception of the electrical pump).

#### Controlled, Clean, and Stable (CCS)

Controlled, Clean, and Stable reflects the completion of several objectives: "Controlled" - provide remote monitoring for required instrumentation and implement controls required in the TWRS Authorization Basis; "Clean" - remove surface soil contamination and downpost the Tank Farms to RBA/URMA/RA radiological control status, remove abandoned equipment, and place reusable equipment in compliant storage; and "Stable" - remove pumpable liquids from the SSTs and IMUSTs and isolate the tanks.

### TANK INTEGRITY

#### Sound

The integrity classification of a waste storage tank for which surveillance data indicate no loss of liquid attributed to a breach of integrity.

#### Assumed Leaker

The integrity classification of a waste storage tank for which surveillance data indicate a loss of liquid attributed to a breach of integrity.

#### Assumed Re-Leaker

A condition that exists after a tank has been declared as an "assumed leaker" and then the surveillance data indicates a new loss of liquid attributed to a breach of integrity.

### TANK INVESTIGATION

#### Intrusion

A term used to describe the infiltration of liquid into a waste tank.

### SURVEILLANCE INSTRUMENTATION

#### Drywells

Drywells are vertical boreholes with 6-inch (internal diameter) carbon steel casings positioned radially around SSTs. These wells range between 50 and 250 feet in depth, and are monitored between the range of 50 to 150 feet. The wells are sealed when not in use. They are called drywells because they do not penetrate to the water table and are therefore usually "dry." There are 759 drywells.

Monitoring is done by gamma radiation or neutron-moisture sensors to obtain scan profiles of radiation or moisture in the soil as a function of well depth, which could be indicative of tank leakage.

Two single-shell tanks (C-105 and C-106) are currently monitored monthly by gamma radiation sensors. The remaining drywells are monitored on request by gamma radiation sensors. Monitoring by neutron-moisture sensors is done only on request.

#### Laterals

Laterals are horizontal drywells positioned under single-shell waste storage tanks to detect radionuclides in the soil which could be indicative of tank leakage. These drywells can be monitored by radiation detection probes. Laterals are 4-inch inside diameter steel pipes located 8 to 10 feet below the tank's concrete base. There are three laterals per tank. Laterals are located only in A and SX farms. There are currently no functioning laterals and no plan to prepare them for use.

**Surface Levels**

The surface level measurements in all waste storage tanks are monitored by manual or automatic conductivity probes, and recorded and transmitted or entered into the Surveillance Analysis Computer System (SACS).

**Automatic FIC**

An automatic waste surface level measurement device is manufactured by the Food Instrument Company (FIC). The instrument consists of a conductivity electrode (plummet) connected to a calibrated steel tape, a steel tape reel housing and a controller that automatically raises and lowers the plummet to obtain a waste surface level reading. The controller can provide a digital display of the data and until February 1999, the majority of the FICs transmitted readings to the CASS. Since CASS retirement, all FIC gauges are read manually. FICs are being replaced by ENRAF detectors (see below).

**ENRAF 854 ATG Level Detector**

FICs and some manual tapes are in the process of being replaced by the ENRAF ATG 854 level detector. The ENRAF gauge, fabricated by ENRAF Incorporated, determines waste level by detecting variations in the weight of a displacer suspended in the tank waste. The displacer is connected to a wire wound onto a precision measuring drum. A level causes a change in the weight of the displacer which will be detected by the force transducer. Electronics within the gauge causes the servo motor to adjust the position of the displacer and compute the tank level based on the new position of the displacer drum. The gauge displays the level in decimal inches. The first few ENRAFs that received remote reading capability transmit liquid level data via analog output to the Tank Monitor and Control System (TMACS). The remaining ENRAFs and future installations will transmit digital level data to TMACS via an ENRAF Computer Interface Unit (CIU). The CIU allows fully remote communication with the gauge, minimizing tank farm entry.

**Annulus**

The annulus is the space between the inner and outer shells on DSTs only. Drain channels in the insulating and/or supporting concrete carry any leakage to the annulus space where conductivity probes are installed. The annulus conductivity probes and radiation detectors are the primary means of leak detection for all DSTs.

**Liquid Observation Well (LOW)**

In-tank liquid observation wells are used for monitoring the interstitial liquid level (ILL) in single-shell waste storage tanks. The wells are usually constructed of fiberglass or TEFZEL-reinforced epoxy-polyester resin (TEFZEL, a trademark of E. I. du Pont de Nemours & Company). There are a few LOWs constructed of steel. LOWs are sized to extend to within 1 inch of the bottom of the waste tank, are sealed at their bottom ends and have a nominal outside diameter of 3.5 inches. Two probes are used to monitor changes in the ILL; gamma and neutron, which can indicate intrusions or leakage by increases or decreases in the ILL. There are 65 LOWs (64 are in operation) installed in SSTs that contain or are capable of containing greater than 50 Kgallons of drainable interstitial liquid, and in two DSTs only. The LOWs installed in two DSTs, (SY-102 and AW-103 tanks), are used for special, rather than routine, surveillance purposes only.

**Thermocouple (TC)**

A thermocouple is a thermoelectric device used to measure temperature. More than one thermocouple on a device (probe) is called a thermocouple tree. In DSTs there may be one or more thermocouple trees in risers in the primary tank. In addition, in DSTs only, there are thermocouple elements installed in the insulating concrete, the lower primary tank knuckle, the secondary tank concrete foundation, and in the outer structural concrete.

These monitor temperature gradients within the concrete walls, bottom of the tank, and the domes. In SSTs, one or more thermocouples may be installed directly in a tank, although some SSTs do not have any trees installed. A single thermocouple (probe) may be installed in a riser, or lowered down an existing

riser or LOW. There are also four thermocouple laterals beneath Tank 105-A in which temperature readings are taken in 34 thermocouples.

#### In-tank Photographs and Videos

In-tank photographs and videos may be taken to aid in resolving in-tank measurement anomalies and determine tank integrity. Photographs and videos help determine sludge and liquid levels by visual examination.

#### TERMS/ACRONYMS

<u>CCS</u>	Controlled, Clean and Stable (tank farms)
<u>FSAR</u>	Final Safety Analysis Report (replaces BIOS, effective October 18, 1999)
<u>II</u>	Interim Isolated
<u>IP</u>	Intrusion Prevention Completed
<u>IS</u>	Interim Stabilized
<u>MT/FIC/ENRAF</u>	Manual Tape, Food Instrument Corporation, ENRAF Corporation (surface level measurement devices)
<u>OSD</u>	Operating Specifications Document
<u>PI</u>	Partial Interim Isolated
<u>SAR</u>	Safety Analysis Reports
<u>SHMS</u>	Standard Hydrogen Monitoring System
<u>TMACS</u>	Tank Monitor and Control System
<u>TPA</u>	Hanford Federal Facility Consent and Compliance Order, "Washington State Department of Ecology, U. S. Environmental Protection Agency, and U. S. Department of Energy," Fourth Amendment, 1994 (Tri-Party Agreement)
<u>USQ</u>	Unreviewed Safety Question
<u>Wyden Amendment</u>	"Safety Measures for Waste Tanks at Hanford Nuclear Reservation," Section 3137 of the National Defense Authorization Act for Fiscal Year 1991, November 5, 1990, Public Law 101-510.

4. INVENTORY AND STATUS BY TANK - COLUMN VOLUME CALCULATIONS AND DEFINITIONS FOR TABLE E-6 (SINGLE-SHELL TANKS)

COLUMN HEADING	COLUMN VOLUME CALCULATIONS (Underlined)/DEFINITIONS
Total Waste	<u>Solids volume plus Supernatant liquid.</u> Solids include sludge and saltcake (see definitions below).

COLUMN HEADING	COLUMN VOLUME CALCULATIONS (Underlined)/DEFINITIONS
Supernate (1)	<u>May be either measured or estimated.</u> Supernate is either the estimated or measured liquid floating on the surface of the waste or under a floating solids crust. In-tank photographs or videos are useful in estimating the liquid volumes; liquid floating on solids and core sample data are useful in estimating large liquid pools under a floating crust.
Drainable Interstitial Liquid (DIL) (1)	<u>This is initially calculated.</u> Drainable interstitial liquid is calculated based on the saltcake and sludge volumes, using calculated porosity values from past pumping or actual data for each tank. Interstitial liquid is liquid that fills the interstitial spaces of the solids waste. The sum of the interstitial liquid contained in saltcake and sludge minus an adjustment for capillary height is the initial volume of drainable interstitial liquid.
Pumped This Month	<u>Net total gallons of liquid pumped from the tank during the month.</u> If supernate is present, pump production is first subtracted from the supernatant volume. The remainder is then subtracted from the drainable interstitial liquid volume.
Total Pumped (1)	<u>Cumulative net total gallons of liquid pumped from 1979 to date.</u>
Drainable Liquid Remaining (DLR) (1)	<u>Supernate plus Drainable Interstitial Liquid.</u> The total Drainable Liquid Remaining is the sum of drainable interstitial liquid and supernate.
Pumpable Liquid Remaining (PLR) (1)	<u>Drainable Liquid Remaining minus unpumpable volume.</u> Not all drainable interstitial liquid is pumpable.
Sludge	<u>Solids formed during sodium hydroxide additions to waste.</u> Sludge usually was in the form of suspended solids when the waste was originally received in the tank from the waste generator. In-tank photographs or videos may be used to estimate the volume.
Saltcake	<u>Results from crystallization and precipitation after concentration of liquid waste, usually in an evaporator.</u> If saltcake is layered over sludge, it is only possible to measure total solids volume. In-tank photographs or videos may be used to estimate the saltcake volume.
Solids Volume Update	<u>Indicates the latest update of any change in the solids volume.</u>
Solids Update Source - See Footnote	<u>Indicates the source or basis of the latest solids volume update.</u>
Last In-tank Photo	<u>Date of last in-tank photographs taken.</u>
Last In-tank Video	<u>Date of last in-tank video taken.</u>
See Footnotes for These Changes	<u>Indicates any change made the previous month.</u> A footnote explanation for the change follows the Inventory and Status by Tank Appendix (Table E-6).

- (1) As pumping continues, supernate, DIL, DLR, PLR, and total gallons pumped are adjusted accordingly based on actual pump volumes.

**APPENDIX D**

**TANK FARM CONFIGURATION, STATUS,  
AND FACILITIES CHARTS**

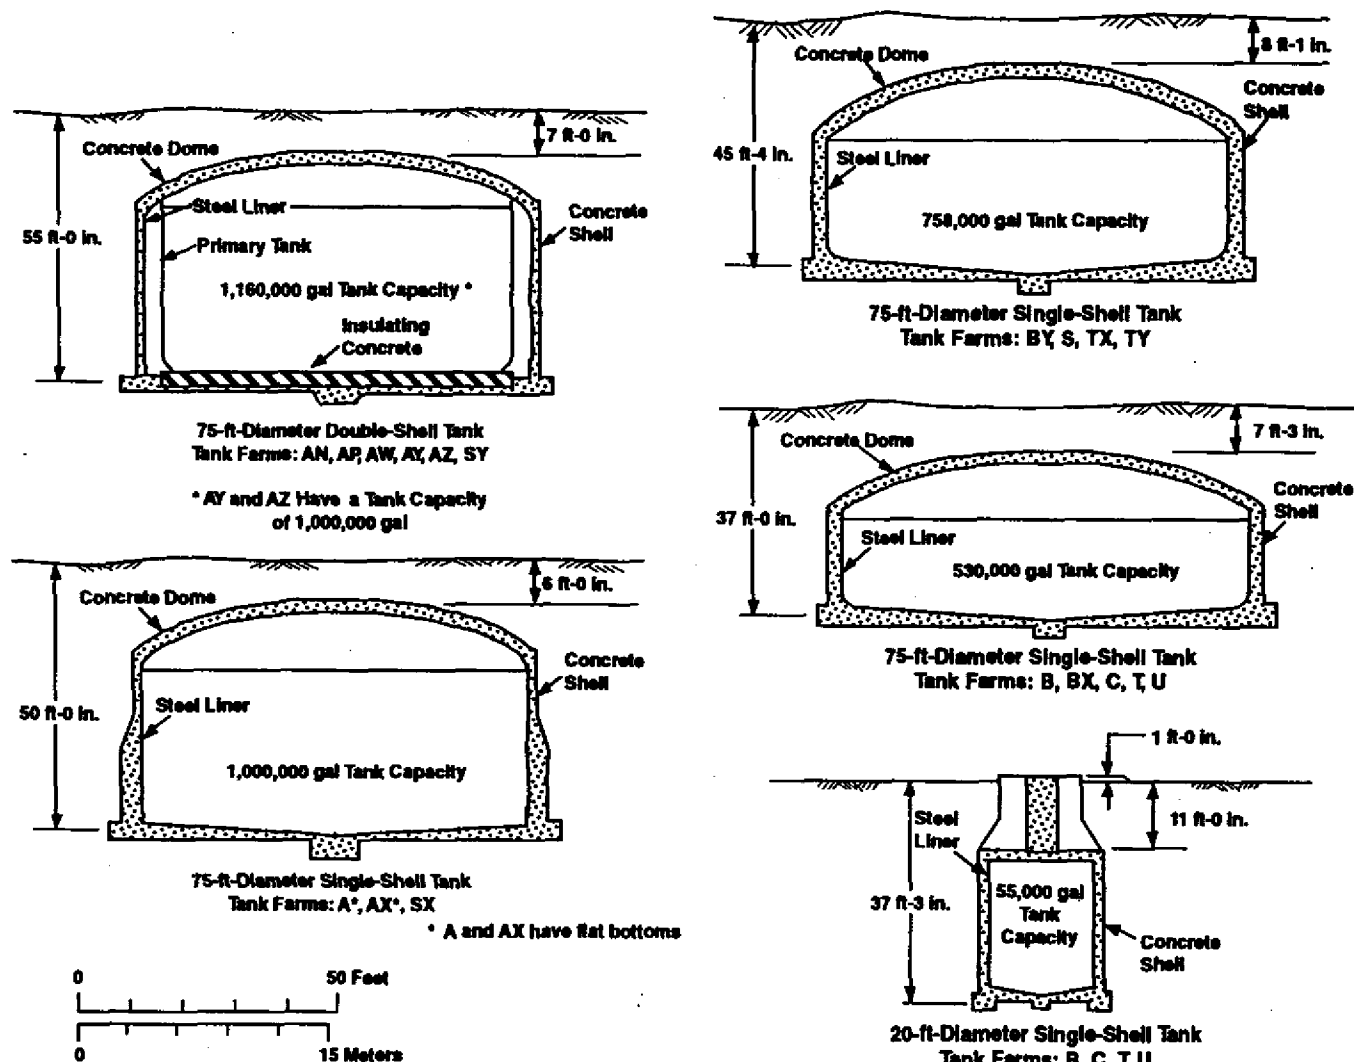


FIGURE D-1. HIGH-LEVEL WASTE TANK CONFIGURATION


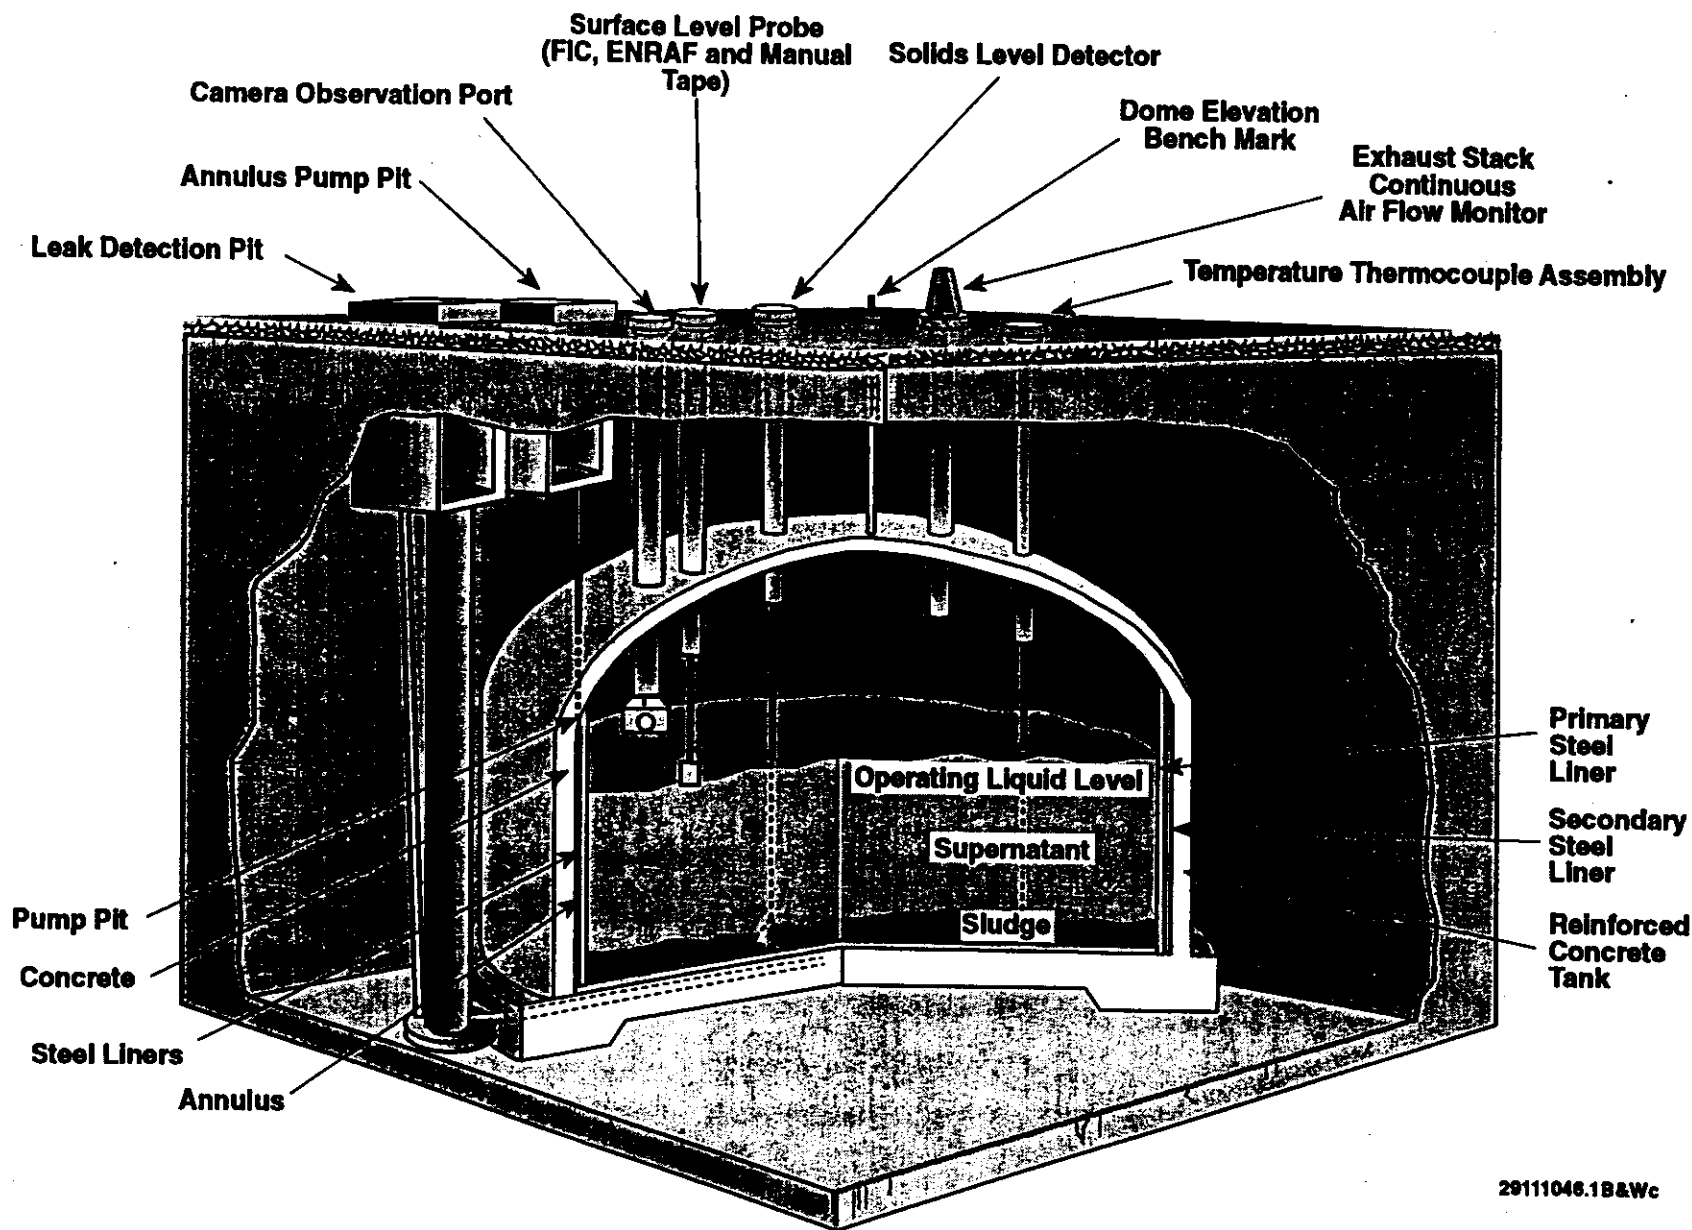


FIGURE D-2. DOUBLE-SHELL TANK INSTRUMENTATION CONFIGURATION

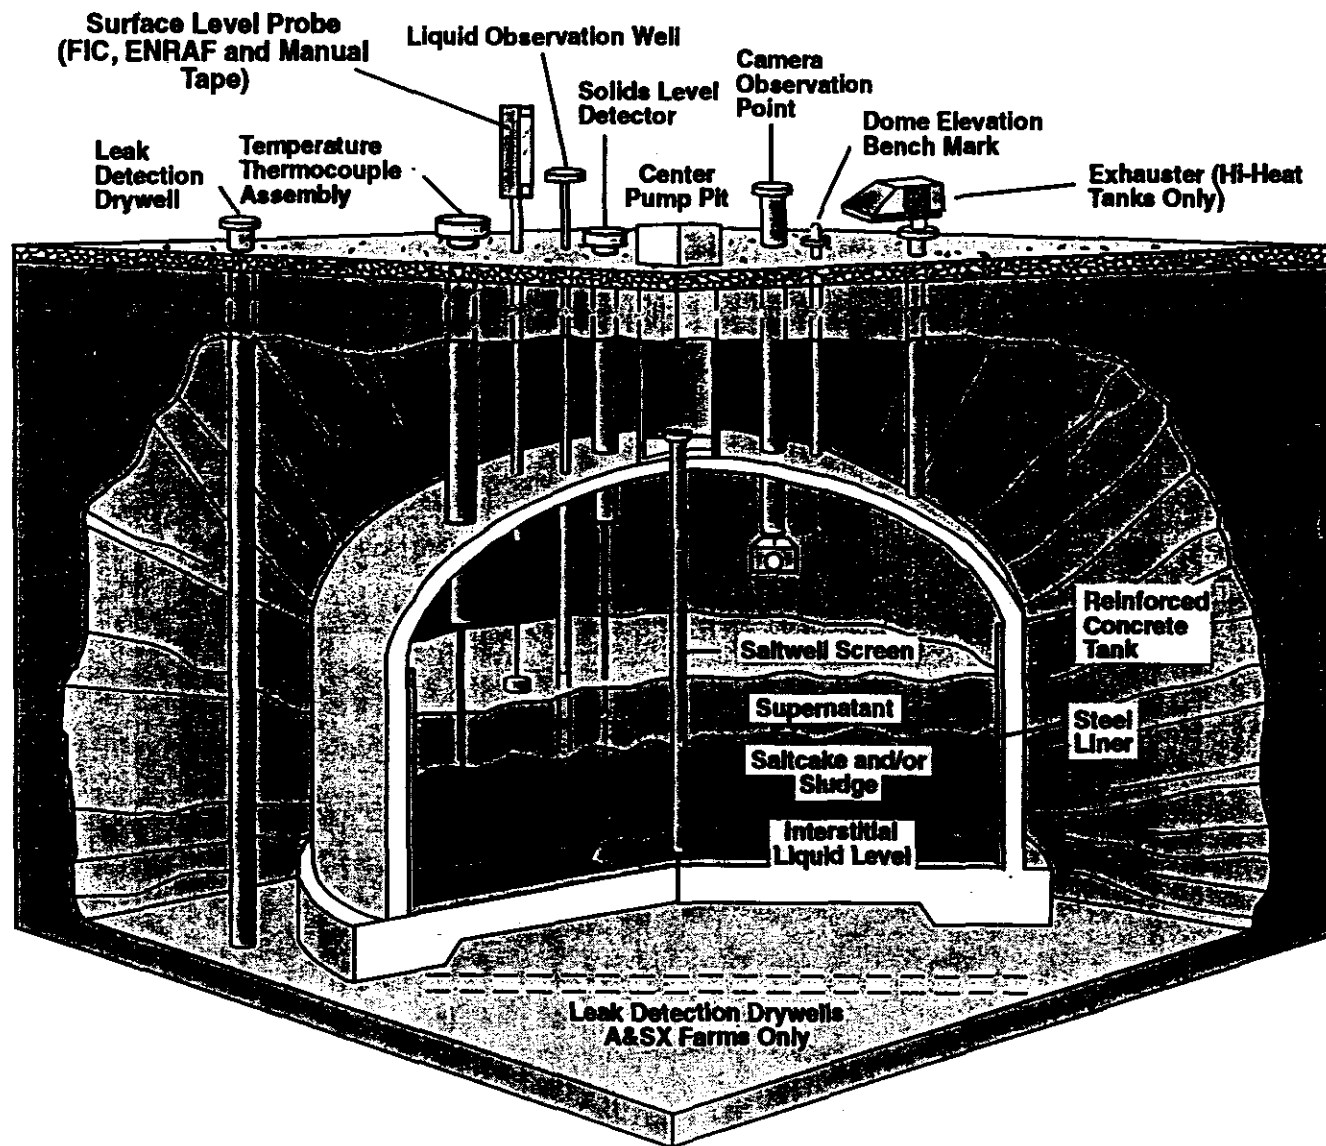

29111046.2B&amp;Wb

FIGURE D-3. SINGLE-SHELL TANK INSTRUMENTATION CONFIGURATION

**THE HANFORD TANK FARM FACILITIES CHARTS (colored foldouts)  
ARE ONLY BEING INCLUDED IN THIS REPORT ON A QUARTERLY BASIS  
(i.e., months ending March 31, June 30, September 30, December 31)**

**NOTE: COPIES OF THE FACILITIES CHARTS CAN BE OBTAINED  
FROM DENNIS BRUNSON, MULTI-MEDIA SERVICES**

**376-2345, G3-51**

**ALMOST ANY SIZE IS AVAILABLE, AND CAN BE LAMINATED**

**P-Card required**

**APPENDIX E**

**MONTHLY SUMMARY  
TANK USE SUMMARY  
PUMPING RECORD, LIQUID STATUS AND PUMPABLE  
LIQUID REMAINING IN TANK FARMS  
INVENTORY SUMMARY BY TANK FARM  
INVENTORY AND STATUS BY TANK**

**TABLE E-1. MONTHLY SUMMARY  
TANK STATUS**

February 29, 2000

	200 EAST AREA	200 WEST AREA	TOTAL
IN SERVICE	25	03	28 (1)
OUT OF SERVICE	66	83	149
SOUND	59	51	110
ASSUMED LEAKER	32	35	67
INTERIM STABILIZED	60	61	121
ISOLATED			
PARTIAL INTERIM	11	30	41
INTRUSION PREVENTION COMPLETE	55	53	108
CONTROLLED, CLEAN, AND STABLE	12	24	36

		WASTE VOLUMES (K gallons)			SST TANKS	DST TANKS	TOTAL
		200 EAST AREA	200 WEST AREA	TOTAL			
<b>SUPERNATANT</b>							
AGING	Aging waste	1661	0	1661	0	1661	1661
CC	Complexant concentrate waste	3177	699	3876	0	3876	3876
CP	Concentrated phosphate waste	1090	0	1090	0	1090	1090
DC	Dilute complexed waste	56	0	56	1	55	56
DN	Dilute non-complexed waste	2901	0	2901	0	2901	2901
DN/PD	Dilute non-complex/PUREX TRU solid	321	0	321	0	321	321
DN/PT	Dilute non-complex/PFP TRU solids	0	749	749	0	749	749
NCPLX	Non-complexed waste	192	247	439	439	0	439
DSSF	Double-shell slurry feed	5499	170	5669	1073	4596	5669
<b>TOTAL SUPERNATANT</b>		<b>14897</b>	<b>1865</b>	<b>16762</b>	<b>1513</b>	<b>11240</b>	<b>16762</b>
<b>SOLIDS</b>							
	Double-shell slurry	457	0	457	0	457	457
	Sludge	6543	5981	12524	11438	1086	12524
	Saltcake	7605	16366	23971	20762	3209	23971
<b>TOTAL SOLIDS</b>		<b>14605</b>	<b>22347</b>	<b>36952</b>	<b>32200</b>	<b>4752</b>	<b>36952</b>
<b>TOTAL WASTE</b>		<b>29502</b>	<b>24212</b>	<b>53714</b>	<b>33713</b>	<b>16000</b>	<b>53714</b>
<b>AVAILABLE SPACE IN TANKS</b>		<b>10329</b>	<b>790</b>	<b>11119</b>	<b>0</b>	<b>11119</b>	<b>11119</b>
<b>DRAINABLE INTERSTITIAL</b>		<b>2305</b>	<b>2754</b>	<b>5059</b>	<b>3736</b>	<b>1323</b>	<b>5059</b>
<b>DRAINABLE LIQUID REMAINING (2)</b>		<b>2476</b>	<b>2773</b>	<b>5249</b>	<b>5249</b>	<b>(2)</b>	<b>5249</b>

(1) Includes six double-shell tanks on Hydrogen Watch List not currently allowed to receive waste, AN-103, AN-104, AN-105, AW-101, SY-101, and SY-103.

(2) Drainable Liquid Remaining for single-shell tanks only; not applicable for double-shell tanks

TABLE E-2. TANK USE SUMMARY

February 29, 2000

TANK FARMS	TANKS AVAILABLE TO RECEIVE WASTE TRANSFERS	SOUND	ASSUMED LEAKER	PARTIAL INTERIM	ISOLATED TANKS		
					INTRUSION PREVENTION COMPLETED	CONTROLLED CLEAN, AND STABLE	INTERIM TABILIZED TANKS
EAST							
A	0	3	3	2	4	0	5
AN	7 (1)	7	0	0	0		0
AP	8	8	0	0	0		0
AW	6 (1)	6	0	0	0		0
AX	0	2	2	1	3		3
AY	2	2	0	0	0		0
AZ	2	2	0	0	0		0
B	0	6	10	0	16		16
BX	0	7	5	0	12	12	12
BY	0	7	5	5	7		10
C	0	9	7	3	13		14
Total	25	59	32	11	55	12	30
WEST							
S	0	11	1	10	2		4
SX	0	5	10	6	9		9
SY	3 (1)	3	0	0	0		0
T	0	9	7	5	11		16
TX	0	10	8	0	18	18	18
TY	0	1	5	0	6	6	6
U	0	12	4	9	7		8
Total	3	51	35	30	53	24	38
TOTAL	28	110	67	41	108	36	68

(1) Six Double-Shell Tanks on the Hydrogen Tank Watch List are not currently receiving waste transfers (AN-103, 104, 105, AW-101, SY-101 and 103).

**TABLE E-3. PUMPING RECORD, LIQUID STATUS AND PUMPABLE  
LIQUID REMAINING IN TANK FARMS**

February 29, 2000

<b>TANK FARMS</b>	<b>Waste Volumes (Kgallons)</b>						
	<b>PUMPED THIS MONTH</b>	<b>PUMPED FY TO DATE</b>	<b>CUMULATIVE TOTAL PUMPED 1979 TO DATE</b>	<b>SUPERNATANT LIQUID</b>	<b>DRAINABLE INTERSTITIAL REMAINING</b>	<b>DRAINABLE LIQUID REMAINING</b>	<b>PUMPABLE SST LIQUID REMAINING</b>
<b>EAST</b>							
A	0.0	0.0	150.5	517	145	662	635
AN	N/A	N/A	N/A	3649	513	N/A	N/A
AP	N/A	N/A	N/A	4785	25	N/A	N/A
AW	N/A	N/A	N/A	3256	361	N/A	N/A
AX	0.0	0.0	13.0	386	89	475	455
AY	N/A	N/A	N/A	450	23	N/A	N/A
AZ	N/A	N/A	N/A	1661	3	N/A	N/A
B	0.0	0.0	0.0	15	262	277	203
BX	N/A	0.0	200.2	24	127	N/A	N/A
BY	0.0	0.0	1567.8	0	558	558	498
C	0.0	0.0	103.0	154	199	353	298
<b>TOTAL EAST</b>	<b>0.0</b>	<b>0.0</b>	<b>2034.5</b>	<b>1689</b>	<b>1072</b>	<b>1488</b>	<b>1191</b>
<b>WEST</b>							
S	3.3	22.5	1030.2	141	599	740	701
SX	0.0	14.5	378.8	134	586	720	678
SY	N/A	N/A	N/A	1448	398	N/A	N/A
T	0.0	0.0	245.7	29	217	217	168
TX	N/A	0.0	1205.7	9	309	N/A	N/A
TY	N/A	0.0	29.9	0	53	N/A	N/A
U	32.8	153.9	165.9	104	592	696	664
<b>TOTAL WEST</b>	<b>36.1</b>	<b>190.9</b>	<b>3056.2</b>	<b>1865</b>	<b>1865</b>	<b>1673</b>	<b>1511</b>
<b>TOTAL</b>	<b>36.1</b>	<b>190.9</b>	<b>5090.7</b>	<b>16762</b>	<b>2937</b>	<b>3161</b>	<b>2702</b>

N/A = Not applicable for Double-Shell Tank Farms, and Single-Shell Tank Farms which have been declared Controlled, Clean and Stable (BX, TX, TY).

TABLE E-4. INVENTORY SUMMARY BY TANK FARM

February 29, 2000

SUPERNATANT LIQUID VOLUMES (Kgallons)													SOLIDS VOLUME			
TANK FARM	TOTAL WASTE	AVAIL SPACE	AGING	CC	CP	DC	DN	DN/PD	DN/PT	NCPLX	DSSE	TOTAL	DSS	SLUDGE	SALT CAKE	TOTAL
EAST																
A	1507	0	0	0	0	0	0	0	0	0	517	517	0	588	402	990
AN	5430	2550	0	1782	0	0	127	0	0	0	1740	3649	457	0	1324	1781
AP	4874	4246	0	1395	1090	0	512	0	0	0	1788	4785	0	0	89	89
AW	4672	2168	0	0	0	0	1867	321	0	0	1068	3256	0	571	845	1416
AX	834	0	0	0	0	0	0	0	0	0	386	386	0	26	422	448
AY	760	1200	0	0	0	55	395	0	0	0	0	450	0	310	0	310
AZ	1795	165	1661	0	0	0	0	0	0	0	0	1661	0	134	0	134
B	1909	0	0	0	0	0	0	0	0	15	0	15	0	1327	567	1894
BX	1490	0	0	0	0	0	0	0	0	24	0	24	0	1259	207	1466
BY	4387	0	0	0	0	0	0	0	0	0	0	0	0	754	3633	4387
C	1844	0	0	0	0	1	0	0	0	153	0	154	0	1690	0	1690
TOTAL EAST 25802 10328 1661 1782 1090 55 2907 321 0 182 5688 14857 457 1503 25715 14802																
WEST																
S	4980	0	0	0	0	0	0	0	0	138	3	141	0	1185	3634	4819
SX	4028	0	0	0	0	0	0	0	0	0	134	134	0	1064	2830	3894
SY	2470	790	0	699	0	0	0	0	749	0	0	1448	0	71	951	1022
T	1877	0	0	0	0	0	0	0	0	29	0	29	0	1703	145	1848
TX	6778	0	0	0	0	0	0	0	0	9	0	9	0	893	5876	6769
TY	639	0	0	0	0	0	0	0	0	0	0	0	0	529	110	639
U	3460	0	0	0	0	0	0	0	0	71	33	104	0	536	2820	3356
TOTAL WEST 24212 790 0 699 0 0 0 0 0 749 247 170 1865 0 1340 10304 22207																
TOTAL 50014 11118 1661 2481 1090 55 2907 321 749 182 5858 16722 457 2843 36019 27009																

E-5

HNF-EP-0182-143

TABLE E-5. INVENTORY AND STATUS BY TANK - DOUBLE-SHELL TANKS

February 29, 2000

TANK STATUS							LIQUID VOLUME		SOLIDS VOLUME			VOLUME DETERMINATION			PHOTOS/VIDEOS		SEE FOOTNOTE FOR THESE CHANGES
TANK	WAST MATL	TANK INTEGRITY	TANK USE	EQUIVA- LENT WASTE INCHES	TOTAL AVAIL. WASTE SPACE (Kgal)	SUPER- NATANT LIQUID (Kgal)	INTER- STITIAL LIQUID (Kgal)	DSS (Kgal)	SLUDGE (Kgal)	SALT CAKE (Kgal)	LIQUID VOLUME METHOD	SOLIDS VOLUME METHOD	SOLIDS VOLUME UPDATE	LAST IN-TANK PHOTO	LAST IN-TANK VIDEO		
<b>AN TANK FARM STATUS</b>																	
AN-101	DN	SOUND	DRCVR	58.2	160	980	127	0	0	0	33	FM	S	06/30/99	0/ 0/ 0		
AN-102	CC	SOUND	CWHT	384.0	1056	84	967	25	0	0	89	FM	S	06/30/99	0/ 0/ 0		
AN-103	DSS	SOUND	CWHT	347.6	956	184	499	0	457	0	0	FM	S	06/30/99	10/29/87		
AN-104	DSSF	SOUND	CWHT	382.9	1053	87	604	187	0	0	449	FM	S	06/30/99	06/19/88		
AN-105	DSSF	SOUND	CWHT	409.5	1126	14	637	205	0	0	489	FM	S	06/30/99	01/26/88		
AN-106	CC	SOUND	CWHT	13.8	38	1102	21	0	0	0	17	FM	S	06/30/99	0/ 0/ 0		
AN-107	CC	SOUND	CWHT	378.5	1041	99	794	96	0	0	247	FM	S	06/30/99	09/01/88		
7 DOUBLE-SHELL TANKS				TOTALS	5430	2550	3649	513	457	0	1324						
<b>AP TANK FARM STATUS</b>																	
AP-101	DSSF	SOUND	DRCVR	405.1	1114	26	1114	0	0	0	0	FM	S	05/01/89	0/ 0/ 0		
AP-102	CP	SOUND	GRFTD	396.4	1090	50	1090	0	0	0	0	FM	S	07/11/89	0/ 0/ 0		
AP-103	CC	SOUND	DRCVR	102.9	283	857	283	0	0	0	0	FM	S	05/31/96	0/ 0/ 0		
AP-104	CC	SOUND	GRFTD	404.4	1112	28	1112	0	0	0	0	FM	S	10/13/88	0/ 0/ 0		
AP-105	DSSF	SOUND	CWHT	277.5	783	377	674	25	0	0	89	FM	S	06/30/99	0/ 0/ 0	09/27/95	
AP-106	DN	SOUND	DRCVR	33.5	92	1048	92	0	0	0	0	FM	S	10/13/88	0/ 0/ 0		
AP-107	DN	SOUND	DRCVR	14.2	39	1101	39	0	0	0	0	FM	S	10/13/88	0/ 0/ 0		
AP-108	DN	SOUND	DRCVR	138.5	381	759	381	0	0	0	0	FM	S	10/13/88	0/ 0/ 0		
8 DOUBLE-SHELL TANKS				TOTALS	4874	4246	4785	25	0	0	89						
<b>AW TANK FARM STATUS</b>																	
AW-101	DSSF	SOUND	CWHT	409.5	1126	14	820	123	0	0	306	FM	S	06/30/99	03/17/88		
AW-102	DN	SOUND	EVFD	369.5	1016	124	980	1	0	0	38	FM	S	06/30/99	02/02/83		
AW-103	DN/PD	SOUND	DRCVR	186.2	512	628	149	38	0	316	47	FM	S	06/30/99	0/ 0/ 0		
AW-104	DN	SOUND	DRCVR	406.5	1118	22	887	89	0	0	231	FM	S	06/30/99	02/02/83		
AW-105	DN/PD	SOUND	DRCVR	155.3	427	713	172	24	0	255	0	FM	S	06/30/99	0/ 0/ 0		
AW-106	DSSF	SOUND	SRCVR	172.0	473	667	248	86	0	0	225	FM	S	06/30/99	02/02/83		
6 DOUBLE-SHELL TANKS				TOTALS	4672	2168	3256	381	0	571	845						

HNF-EP-0182-143

E-6

TABLE E-5. INVENTORY AND STATUS BY TANK - DOUBLE-SHELL TANKS

February 29, 2000

TANK STATUS							LIQUID VOLUME		SOLIDS VOLUME			VOLUME DETERMINATION			PHOTOS/VIDEOS		SEE FOOTNOTE FOR THESE CHANGES
TANK	WAST MATL	TANK INTEGRITY	TANK USE	EQUIVA- LENT WASTE INCHES	TOTAL WASTE (Kgal)	AVAIL. SPACE (Kgal)	SUPER- NATANT LIQUID (Kgal)	INTER- STITIAL LIQUID (Kgal)	DSS (Kgal)	SLUDGE (Kgal)	SALT CAKE (Kgal)	LIQUID VOLUME METHOD	SOLIDS VOLUME METHOD	SOLIDS VOLUME UPDATE	LAST IN-TANK PHOTO	LAST IN-TANK VIDEO	
<u>AY TANK FARM STATUS</u>																	
AY-101	DC	SOUND	DRCVR	54.2	149	831	55	4	0	94	0	FM	S	06/30/99	12/28/82		
AY-102	DN	SOUND	DRCVR	222.2	611	389	395	19	0	216	0	FM	S	11/30/99	04/28/81		
2 DOUBLE-SHELL TANKS				TOTALS	760	1200	450	23	0	310	0						
<u>AZ TANK FARM STATUS</u>																	
AZ-101	AGING	SOUND	CWHT	308.7	849	131	803	0	0	46	0	FM	S	06/30/98	08/18/83		
AZ-102	AGING	SOUND	DRCVR	344.0	946	34	858	3	0	88	0	FM	S	06/30/99	10/24/84		
2 DOUBLE-SHELL TANKS				TOTALS	1795	165	1661	3	0	134	0						
<u>SY TANK FARM STATUS</u>																	
SY-101	CC	SOUND	CWHT	329.5	906	74	321	248	0	0	585	FM	S	06/30/99	04/12/89	(a)	
SY-102	DN/PT	SOUND	DRCVR	298.2	820	320	749	0	0	71	0	FM	S	06/30/99	04/29/81		
SY-103	CC	SOUND	CWHT	270.5	744	386	378	150	0	0	366	FM	S	06/30/99	10/01/85		
3 DOUBLE-SHELL TANKS				TOTALS	2470	790	1448	398	0	71	951						
GRAND TOTAL					20001	11119	15249	1323	457	1086	3209						

Note: +/- 1 Kgal differences are the result of computer rounding

Available Space Calculations Used in this DocumentTank Farms

AN, AP, AW, SY	1,140 Kgal
AY, AZ (Aging Waste)	980 Kgal

NOTE: Tanks AN-102, AN-107, AY-101 and AP-104 are still outside the corrosion control specifications limits for hydroxide. Note that the supernate in AY-102 is within the corrosion specifications, however, the pre-sludging C-106 solids in AY-102 may still be outside the corrosion control compliance range for hydroxide. An alternate strategy of corrosion control (i.e., monitor tank waste using corrosion probes) is being proposed but has not been fully evaluated. Waste mitigation may be performed either by chemical adjustment or waste transfer/co-mingling of waste with high hydroxide.

(a) The first transfer of waste (89,500 gallons) from SY-101 to SY-102 was completed December 19, 1999. The second (240,000 gallons) of the three waste transfers was completed January 27, 2000. The third transfer phase began February 29, 2000. It is expected that approximately 265,000 gallons will be transferred.

TABLE E-6. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

February 29, 2000

THESE VOLUMES ARE THE RESULT OF ENGINEERING CALCULATIONS AND MAY NOT CORRESPOND EXACTLY TO THE VOLUMES AS SHOWN ON THE TANK DRAWINGS																		
TANK STATUS					LIQUID VOLUME						SOLIDS VOLUME		VOLUME DETERMINATION			PHOTOS/VIDEOS		SEE FOOTNOTES FOR THESE CHANGES
TANK	WASTE MAT'L	TANK INTEGRITY	STABIL/ ISOLATION STATUS	TOTAL WASTE (Kgal)	SUPER- NATE LIQUID (Kgal)	DRAIN- ABLE INTER- STIT. (Kgal)	PUMPED THIS MONTH (Kgal)	TOTAL PUMPED (Kgal)	DRAIN- ABLE LIQUID REMAIN (Kgal)	PUMP- ABLE LIQUID REMAIN (Kgal)	SLUDGE (Kgal)	SALT CAKE (Kgal)	LIQUIDS VOLUME METHOD	SOLIDS VOLUME METHOD	SOLIDS VOLUME UPDATE	LAST IN-TANK PHOTO	LAST IN-TANK VIDEO	
<b>A TANK FARM STATUS</b>																		
A-101	DSSF	SOUND	/PI	891	508	79	0.0	0.0	587	587	3	380	P	F	08/30/99	08/21/86		
A-102	DSSF	SOUND	IS/PI	41	4	8	0.0	39.5	12	4	15	22	P	FP	07/27/89	07/20/89		
A-103	DSSF	ASMD LKR	IS/IP	371	5	45	0.0	111.0	50	43	366	0	-	FP	06/03/88	12/28/88		
A-104	NCPLX	ASMD LKR	IS/IP	28	0	4	0.0	0.0	4	0	28	0	M	PS	01/27/78	08/25/86		
A-105	NCPLX	ASMD LKR	IS/IP	51	0	0	0.0	0.0	0	0	51	0	P	MP	06/30/99	08/20/86		
A-106	CP	SOUND	IS/IP	125	0	9	0.0	0.0	9	1	125	0	P	M	08/07/82	08/19/86		
8 SINGLE-SHELL TANKS				TOTALS	1507	517	145	0.0	150.5	662	635	588	402					
<b>AX TANK FARM STATUS</b>																		
AX-101	DSSF	SOUND	/PI	684	386	58	0.0	0.0	444	444	3	295	P	F	08/30/99	08/18/87		
AX-102	CC	ASMD LKR	IS/IP	30	0	7	0.0	13.0	7	0	7	23	F	S	06/30/99	06/05/89		
AX-103	CC	SOUND	IS/IP	112	0	23	0.0	0.0	23	11	8	104	F	S	08/30/99	08/13/87		
AX-104	NCPLX	ASMD LKR	IS/IP	8	0	1	0.0	0.0	1	0	8	0	P	M	06/30/99	08/18/87		
4 SINGLE-SHELL TANKS				TOTALS:	834	386	89	0.0	13.0	475	455	26	422					
<b>B TANK FARM STATUS</b>																		
B-101	NCPLX	ASMD LKR	IS/IP	113	0	24	0.0	0.0	24	17	0	113	P	F	08/30/99	05/19/83		
B-102	NCPLX	SOUND	IS/IP	32	4	7	0.0	0.0	11	4	0	28	P	F	06/30/99	08/22/86		
B-103	NCPLX	ASMD LKR	IS/IP	59	0	11	0.0	0.0	11	3	0	59	F	F	06/30/99	10/13/88		
B-104	NCPLX	SOUND	IS/IP	371	1	45	0.0	0.0	46	42	308	61	M	M	08/30/99	10/13/88		
B-105	NCPLX	ASMD LKR	IS/IP	158	0	20	0.0	0.0	20	16	28	130	P	MP	06/30/99	05/19/88		
B-106	NCPLX	SOUND	IS/IP	117	1	25	0.0	0.0	26	19	0	116	F	F	02/29/00	02/28/86		
B-107	NCPLX	ASMD LKR	IS/IP	165	1	22	0.0	0.0	23	19	93	71	M	M	06/30/99	02/28/86		
B-108	NCPLX	SOUND	IS/IP	94	0	15	0.0	0.0	15	11	53	41	F	F	06/30/99	05/10/86		
B-109	NCPLX	SOUND	IS/IP	127	0	21	0.0	0.0	21	17	63	64	M	M	06/30/99	04/02/86		
B-110	NCPLX	ASMD LKR	IS/IP	246	1	27	0.0	0.0	28	20	245	0	MP	MP	02/28/85	03/17/88		
B-111	NCPLX	ASMD LKR	IS/IP	237	1	23	0.0	0.0	24	29	236	0	F	F	06/28/85	06/26/85		
B-112	NCPLX	ASMD LKR	IS/IP	33	3	4	0.0	0.0	7	3	30	0	F	F	06/31/85	05/29/85		
B-201	NCPLX	ASMD LKR	IS/IP	29	1	4	0.0	0.0	5	1	28	0	M	M	04/28/82	11/12/86	08/23/85	
B-202	NCPLX	SOUND	IS/IP	27	0	4	0.0	0.0	4	0	27	0	P	M	05/31/85	05/28/85	06/15/85	
B-203	NCPLX	ASMD LKR	IS/IP	51	1	5	0.0	0.0	6	1	50	0	PM	PM	06/31/84	11/13/88		
B-204	NCPLX	ASMD LKR	IS/IP	50	1	5	0.0	0.0	6	1	49	0	P	M	05/31/84	10/22/87		
16 SINGLE-SHELL TANKS				TOTALS	1909	15	262	0.0	0.0	277	203	1211	683					

E-8

HNF-EP-0182-143

TABLE E-6. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

February 29, 2000

THESE VOLUMES ARE THE RESULT OF ENGINEERING CALCULATIONS AND MAY DIFFER FROM THE VOLUMES REPORTED BY THE TANK OWNERS																		
TANK STATUS					LIQUID VOLUME						SOLIDS VOLUME		VOLUME DETERMINATION			PHOTOS/VIDEOS		SEE FOOTNOTES FOR THESE CHANGES
TANK	WASTE MAT'L	TANK INTEGRITY	STABIL/ ISOLATION STATUS	TOTAL WASTE (Kgal)	SUPER- NATE (Kgal)	DRAIN- ABLE INTER- STIT. (Kgal)	PUMPED THIS MONTH (Kgal)	TOTAL PUMPED (Kgal)	DRAIN- ABLE LIQUID REMAIN (Kgal)	PUMP- ABLE LIQUID REMAIN (Kgal)	SLUDGE (Kgal)	SALT CAKE (Kgal)	LIQUIDS VOLUME METHOD	SOLIDS VOLUME METHOD	SOLIDS VOLUME UPDATE	LAST IN-TANK PHOTO	LAST IN-TANK VIDEO	
BX TANK FARM STATUS																		
BX-101	NCPLX	ASMD LKR	IS/IP/CCS	43	1	4	0.0	0.0	5	1	42	0	P	M	04/28/82	11/24/88	11/10/94	
BX-102	NCPLX	ASMD LKR	IS/IP/CCS	96	0	0	0.0	0.0	0	0	96	0	P	M	04/28/82	08/18/85		
BX-103	NCPLX	SOUND	IS/IP/CCS	71	9	4	0.0	0.0	13	9	62	0	P	F	11/29/83	10/31/86	10/27/84	
BX-104	NCPLX	SOUND	IS/IP/CCS	93	3	4	0.0	17.4	7	3	90	0	F	F	02/29/00	08/21/88		
BX-105	NCPLX	SOUND	IS/IP/CCS	51	5	4	0.0	15.0	9	5	46	0	F	S	06/30/99	10/23/86		
BX-106	NCPLX	SOUND	IS/IP/CCS	38	0	4	0.0	14.0	4	0	38	0	MP	PS	08/01/95	05/19/88	07/17/95	
BX-107	NCPLX	SOUND	IS/IP/CCS	345	1	36	0.0	23.1	37	33	344	0	MP	P	08/18/90	08/11/90		
BX-108	NCPLX	ASMD LKR	IS/IP/CCS	26	0	4	0.0	0.0	4	0	26	0	M	PS	07/31/79	05/05/84		
BX-109	NCPLX	SOUND	IS/IP/CCS	193	0	25	0.0	8.2	25	20	193	0	FP	P	09/17/80	08/11/80		
BX-110	NCPLX	ASMD LKR	IS/IP/CCS	207	3	28	0.0	1.5	31	26	133	71	MP	M	06/30/99	07/15/84	10/13/84	
BX-111	NCPLX	ASMD LKR	IS/IP/CCS	162	1	5	0.0	116.9	6	2	25	136	M	M	06/30/99	05/19/84	02/28/95	
BX-112	NCPLX	SOUND	IS/IP/CCS	165	1	9	0.0	4.1	10	7	164	0	FP	P	08/17/80	08/11/80		
12 SINGLE-SHELL TANKS				TOTALS:	1490	24	127	0.0	200.2	151	106	1259	207					
BY TANK FARM STATUS																		
BY-101	NCPLX	SOUND	IS/IP	387	0	28	0.0	35.8	28	24	108	278	P	M	05/30/84	08/19/88		
BY-102	NCPLX	SOUND	IS/PI	277	0	40	0.0	159.0	40	33	0	277	MP	M	05/01/95	08/11/87	04/11/95	
BY-103	NCPLX	ASMD LKR	IS/PI	400	0	58	0.0	95.9	58	53	9	391	MP	M	06/30/99	08/07/89	02/24/97	
BY-104	NCPLX	SOUND	IS/IP	326	0	40	0.0	329.5	40	36	150	176	P	M	06/30/99	04/27/83		
BY-105	NCPLX	ASMD LKR	/PI	503	0	111	0.0	0.0	111	111	48	455	P	MP	06/31/99	07/01/86		
BY-106	NCPLX	ASMD LKR	/PI	562	0	119	0.0	63.7	119	119	84	478	P	MP	12/31/98	11/04/82		
BY-107	NCPLX	ASMD LKR	IS/IP	266	0	39	0.0	56.4	39	35	40	226	P	MP	06/30/99	10/15/86		
BY-108	NCPLX	ASMD LKR	IS/IP	228	0	33	0.0	27.5	33	26	154	74	MP	M	04/28/82	10/15/86		
BY-109	NCPLX	SOUND	IS/PI	290	0	31	0.0	157.1	31	26	57	233	F	PS	07/08/87	06/18/87		
BY-110	NCPLX	SOUND	IS/IP	398	0	21	0.0	213.3	21	17	103	295	M	S	08/10/79	07/28/84		
BY-111	NCPLX	SOUND	IS/IP	459	0	14	0.0	313.2	14	6	0	459	P	M	06/30/99	10/31/86		
BY-112	NCPLX	SOUND	IS/IP	291	0	24	0.0	116.4	24	12	0	291	P	M	06/30/99	04/14/88		
12 SINGLE-SHELL TANKS				TOTALS:	4367	0	558	0.0	1567.8	558	498	754	3633					

TABLE E-6. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

February 29, 2000

THESE VOLUMES ARE THE RESULT OF ENGINEERING CALCULATIONS AND MAY NOT AGREE WITH MEASUREMENTS																		
TANK STATUS					LIQUID VOLUME						SOLIDS VOLUME		VOLUME DETERMINATION					
TANK	WASTE MAT'L	TANK INTEGRITY	STABIL/ ISOLATION STATUS	TOTAL WASTE (Kgal)	SUPER-NATE (Kgal)	DRAIN-ABLE INTER-STTT. (Kgal)	PUMPED THIS MONTH (Kgal)	TOTAL PUMPED (Kgal)	DRAIN-ABLE LIQUID REMAIN (Kgal)	PUMP-ABLE LIQUID REMAIN (Kgal)	SLUDGE (Kgal)	SALT CAKE (Kgal)	LIQUIDS VOLUME METHOD	SOLIDS VOLUME METHOD	SOLIDS VOLUME UPDATE	LAST IN-TANK PHOTO	LAST IN-TANK VIDEO	SEE FOOTNOTES FOR THESE CHANGES
C TANK FARM STATUS																		
C-101	NCPLX	ASMD LKR	IS/IP	88	0	4	0.0	0.0	4	0	88	0	M	M	11/29/83	11/17/87		
C-102	DC	SOUND	IS/IP	316	0	62	0.0	46.7	62	55	316	0	F	FP	08/30/95	06/18/76	08/24/95	
C-103	NCPLX	SOUND	/PI	198	79	4	0.0	0.0	83	83	119	0	F	S	12/31/88	07/28/87		
C-104	CC	SOUND	IS/IP	295	0	34	0.0	0.0	34	30	295	0	FP	P	09/22/88	07/25/80		
C-105	NCPLX	SOUND	IS/PI	134	2	10	0.0	0.0	12	8	132	0	F	S	02/29/00	08/05/84	08/30/85	
C-106	NCPLX	SOUND	/PI	74	68	0	0.0	0.0	68	62	6	0	F	PS	10/31/89	08/05/84	08/08/84	
C-107	DC	SOUND	IS/IP	257	0	30	0.0	40.8	30	25	257	0	F	S	06/30/89	00/00/00		
C-108	NCPLX	SOUND	IS/IP	66	0	4	0.0	0.0	4	0	66	0	M	S	02/24/84	12/05/74	11/17/84	
C-109	NCPLX	SOUND	IS/IP	66	4	4	0.0	0.0	8	4	62	0	M	PS	11/29/83	01/30/76		
C-110	DC	ASMD LKR	IS/IP	178	1	37	0.0	15.5	38	30	177	0	F	FMP	06/14/95	08/12/86	05/23/95	
C-111	NCPLX	ASMD LKR	IS/IP	57	0	4	0.0	0.0	4	0	57	0	M	S	04/28/82	02/25/70	02/02/85	
C-112	NCPLX	SOUND	IS/IP	104	0	6	0.0	0.0	6	1	104	0	M	PS	08/18/80	08/18/80		
C-201	NCPLX	ASMD LKR	IS/IP	2	0	0	0.0	0.0	0	0	2	0	P	MP	03/31/82	12/02/86		
C-202	EMPTY	ASMD LKR	IS/IP	1	0	0	0.0	0.0	0	0	1	0	P	M	01/18/79	12/09/86		
C-203	NCPLX	ASMD LKR	IS/IP	5	0	0	0.0	0.0	0	0	5	0	P	MP	04/28/82	12/09/86		
C-204	NCPLX	ASMD LKR	IS/IP	3	0	0	0.0	0.0	0	0	3	0	P	MP	04/28/82	12/09/86		
16 SINGLE-SHELL TANKS TOTALS:				1844	154	199	0.0	103.0	353	298	1690	0						
S TANK FARM STATUS																		
S-101	NCPLX	SOUND	/PI	427	12	68	0.0	0.0	80	80	211	204	F	PS	12/31/88	03/18/88		
S-102	DSSF	SOUND	/PI	503	0	93	3.3	48.1	93	89	105	398	P	FP	02/29/00	03/18/88		(a)
S-103	DSSF	SOUND	/PI	234	3	54	0.0	23.8	57	50	9	222	M	S	06/30/99	06/01/89	01/28/00	(b)
S-104	NCPLX	ASMD LKR	IS/IP	294	1	34	0.0	0.0	35	31	293	0	M	M	12/20/84	12/12/84		
S-105	NCPLX	SOUND	IS/IP	456	0	42	0.0	114.3	42	33	2	454	MP	S	08/26/88	04/12/89		
S-106	NCPLX	SOUND	/PI	328	0	10	0.0	203.6	10	2	0	328	P	FP	12/31/99	03/17/89	01/28/00	(c)
S-107	NCPLX	SOUND	/PI	376	14	47	0.0	0.0	61	61	293	69	F	PS	06/30/99	03/12/87		
S-108	NCPLX	SOUND	IS/PI	450	0	4	0.0	189.8	4	0	5	445	P	MP	06/30/89	03/12/87	12/03/96	
S-109	NCPLX	SOUND	/PI	507	0	83	0.0	111.0	83	83	13	494	F	PS	08/30/75	12/31/86		
S-110	NCPLX	SOUND	IS/PI	390	0	30	0.0	203.1	30	27	131	259	F	PS	05/14/82	03/12/87	12/11/86	
S-111	NCPLX	SOUND	/PI	472	111	64	0.0	3.3	175	175	117	244	P	FP	09/30/99	08/10/89		
S-112	NCPLX	SOUND	/PI	523	0	70	0.0	125.1	70	70	6	517	P	FP	12/31/88	03/24/87		
12 SINGLE-SHELL TANKS TOTALS:				4960	141	599	3.3	1030.2	740	701	1185	3634						

E-10

HNF-EP-0182-143

TABLE E-6. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

February 29, 2000

THESE VOLUMES ARE THE RESULT OF ENGINEERING CALCULATIONS AND MAY NOT AGREE WITH SURFACE TANK LEVEL MEASUREMENTS																		
TANK STATUS					LIQUID VOLUME						SOLIDS VOLUME		VOLUME DETERMINATION					
TANK	WASTE MAT'L	TANK INTEGRITY	STABIL/ ISOLATION STATUS	TOTAL WASTE (Kgal)	SUPER-NATE (Kgal)	DRAIN-ABLE INTER-STTT. (Kgal)	PUMPED THIS MONTH (Kgal)	TOTAL PUMPED (Kgal)	DRAIN-ABLE LIQUID REMAIN (Kgal)	PUMP-ABLE LIQUID REMAIN (Kgal)	SLUDGE (Kgal)	SALT CAKE (Kgal)	LIQUIDS VOLUME METHOD	SOLIDS VOLUME METHOD	SOLIDS VOLUME UPDATE	LAST IN-TANK PHOTO	LAST IN-TANK VIDEO	SEE FOOTNOTES FOR THESE CHANGES
SX TANK FARM STATUS																		
SX-101	DC	SOUND	/PI	448	0	99	0.0	0.0	99	99	0	448	P	FP	06/30/98	03/10/88		
SX-102	DSSF	SOUND	/PI	514	134	82	0.0	0.0	216	216	0	380	P	M	09/30/98	01/07/88		
SX-103	NCPLX	SOUND	/PI	634	0	132	0.0	0.0	132	132	115	519	F	S	06/30/98	12/17/87		
SX-104	DSSF	ASMD LKR	/PI	467	0	55	0.0	231.3	55	44	136	331	F	S	07/31/98	08/08/88	02/04/98	(a)
SX-105	DSSF	SOUND	/PI	637	0	141	0.0	0.0	141	141	85	572	P	F	06/30/98	06/15/88		
SX-106	NCPLX	SOUND	/PI	371	0	36	0.0	147.5	36	27	0	371	F	PS	11/30/98	06/01/88		(b)
SX-107	NCPLX	ASMD LKR	IS/PI	104	0	6	0.0	0.0	6	0	104	0	P	M	04/28/82	03/06/87		
SX-108	NCPLX	ASMD LKR	IS/PI	87	0	0	0.0	0.0	0	0	87	0	P	M	12/31/93	03/06/87		
SX-109	NCPLX	ASMD LKR	IS/PI	260	0	0	0.0	0.0	0	0	75	175	P	M	06/30/98	05/21/86		
SX-110	NCPLX	ASMD LKR	IS/PI	62	0	0	0.0	0.0	0	0	62	0	M	PS	10/06/76	02/20/87		
SX-111	NCPLX	ASMD LKR	IS/PI	122	0	8	0.0	0.0	8	3	122	0	M	PS	06/30/98	06/08/94		
SX-112	NCPLX	ASMD LKR	IS/PI	108	0	6	0.0	0.0	6	1	108	0	P	M	06/30/98	03/10/87		
SX-113	NCPLX	ASMD LKR	IS/PI	31	0	0	0.0	0.0	0	0	31	0	P	M	06/30/98	03/18/88		
SX-114	NCPLX	ASMD LKR	IS/PI	181	0	21	0.0	0.0	21	15	147	34	P	M	04/28/82	02/26/87		
SX-115	NCPLX	ASMD LKR	IS/PI	12	0	0	0.0	0.0	0	0	12	0	P	M	04/28/82	03/31/88		
15 SINGLE-SHELL TANKS TOTALS:				4028	134	586	0.0	378.8	720	678	1064	2830						
T TANK FARM STATUS																		
T-101	NCPLX	ASMD LKR	IS/PI	102	1	20	0.0	25.3	21	16	37	64	F	S	06/30/98	04/07/93		
T-102	NCPLX	SOUND	IS/PI	32	13	3	0.0	0.0	16	11	19	0	P	FP	06/31/84	06/28/88		
T-103	NCPLX	ASMD LKR	IS/PI	27	4	3	0.0	0.0	7	3	23	0	F	FP	11/29/83	07/03/84		
T-104	NCPLX	SOUND	IS/PI	317	0	31	0.0	149.5	31	27	317	0	P	MP	11/30/98	06/29/88	10/07/99	
T-105	NCPLX	SOUND	IS/PI	98	0	5	0.0	0.0	5	0	98	0	P	F	05/29/87	05/14/87		
T-106	NCPLX	ASMD LKR	IS/PI	21	2	0	0.0	0.0	2	2	19	0	P	FP	04/28/82	06/29/88		
T-107	NCPLX	ASMD LKR	IS/PI	173	0	34	0.0	11.0	34	20	173	0	P	FP	05/31/96	07/12/84	05/09/96	
T-108	NCPLX	ASMD LKR	IS/PI	44	0	5	0.0	0.0	5	0	21	23	P	M	06/30/98	07/17/84		

HNF-EP-0182-143

TABLE E-6. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

February 29, 2000

THESE VOLUMES ARE THE RESULT OF ENGINEERING CALCULATIONS AND DO NOT AGREE WITH SURVEY MEASUREMENTS																		
TANK STATUS					LIQUID VOLUME						SOLIDS VOLUME		VOLUME DETERMINATION					SEE FOOTNOTES FOR THESE CHANGES
TANK	WASTE MAT'L	TANK INTEGRITY	STABIL/ ISOLATION STATUS	TOTAL WASTE (Kgal)	SUPER- NATE (Kgal)	DRAIN- ABLE INTER- STIT. (Kgal)	PUMPED THIS MONTH (Kgal)	TOTAL PUMPED (Kgal)	DRAIN- ABLE LIQUID REMAIN (Kgal)	PUMP- ABLE LIQUID REMAIN (Kgal)	SLUDGE (Kgal)	SALT CAKE (Kgal)	LIQUIDS VOLUME METHOD	SOLIDS VOLUME METHOD	SOLIDS VOLUME UPDATE	LAST IN-TANK PHOTO	LAST IN-TANK VIDEO	
T-109	NCPLX	ASMD LKR	IS/IP	58	0	10	0.0	0.0	10	3	0	58	M	M	06/30/99	02/25/93		
T-110	NCPLX	SOUND	IS/PI	369	1	47	0.0	50.3	48	43	368	0	P	FP	01/31/00	07/12/84	10/07/99	(d)
T-111	NCPLX	ASMD LKR	IS/PI	446	0	38	0.0	9.6	38	35	446	0	P	FP	04/18/94	04/13/94	02/13/95	
T-112	NCPLX	SOUND	IS/IP	67	7	4	0.0	0.0	11	7	60	0	P	FP	04/28/82	08/01/84		
T-201	NCPLX	SOUND	IS/IP	29	1	4	0.0	0.0	5	1	28	0	M	PS	05/31/78	04/15/86		
T-202	NCPLX	SOUND	IS/IP	21	0	3	0.0	0.0	3	0	21	0	FP	P	07/12/81	07/06/89		
T-203	NCPLX	SOUND	IS/IP	35	0	5	0.0	0.0	5	0	35	0	M	PS	01/31/78	08/03/89		
T-204	NCPLX	SOUND	IS/IP	38	0	5	0.0	0.0	5	0	38	0	FP	P	07/22/81	08/03/89		
16 SINGLE-SHELL TANKS TOTALS:				1877	29	217	0.0	245.7	246	168	1703	145						
TX TANK FARM STATUS																		
TX-101	NCPLX	SOUND	IS/IP/CCS	87	3	8	0.0	0.0	11	7	74	10	F	P	06/30/99	10/24/85		
TX-102	NCPLX	SOUND	IS/IP/CCS	217	0	27	0.0	94.4	27	18	0	217	M	S	08/31/84	10/31/85		
TX-103	NCPLX	SOUND	IS/IP/CCS	157	0	18	0.0	68.3	18	11	0	157	F	S	06/30/99	10/31/85		
TX-104	NCPLX	SOUND	IS/IP/CCS	65	5	9	0.0	3.6	14	9	23	37	F	FP	06/30/99	10/16/84		
TX-105	NCPLX	ASMD LKR	IS/IP/CCS	609	0	25	0.0	121.5	25	14	0	609	M	PS	08/22/77	10/24/89		
TX-106	NCPLX	SOUND	IS/IP/CCS	341	0	37	0.0	134.6	37	30	0	341	M	S	06/30/99	10/31/85		
TX-107	NCPLX	ASMD LKR	IS/IP/CCS	36	1	6	0.0	0.0	7	1	8	27	FP	FP	06/30/99	10/31/85		
TX-108	NCPLX	SOUND	IS/IP/CCS	134	0	8	0.0	13.7	8	1	6	128	P	FP	06/30/99	08/12/89		
TX-109	NCPLX	SOUND	IS/IP/CCS	384	0	6	0.0	72.3	6	2	384	0	F	PS	06/30/99	10/24/89		
TX-110	NCPLX	ASMD LKR	IS/IP/CCS	462	0	14	0.0	115.1	14	10	37	425	M	PS	06/30/99	10/24/89		
TX-111	NCPLX	SOUND	IS/IP/CCS	370	0	10	0.0	98.4	10	6	43	327	M	PS	06/30/99	08/12/89		
TX-112	NCPLX	SOUND	IS/IP/CCS	649	0	26	0.0	94.0	26	21	0	649	P	PS	05/30/83	11/19/87		
TX-113	NCPLX	ASMD LKR	IS/IP/CCS	607	0	18	0.0	19.2	18	14	183	424	M	PS	06/30/99	04/11/83	08/23/94	
TX-114	NCPLX	ASMD LKR	IS/IP/CCS	536	0	17	0.0	104.3	17	11	4	531	M	PS	06/30/99	04/11/83	02/17/95	
TX-115	NCPLX	ASMD LKR	IS/IP/CCS	568	0	25	0.0	99.1	25	15	0	568	M	S	06/30/99	06/15/88		
TX-116	NCPLX	ASMD LKR	IS/IP/CCS	631	0	21	0.0	23.8	21	17	68	563	M	PS	06/30/99	10/17/89		
TX-117	NCPLX	ASMD LKR	IS/IP/CCS	626	0	10	0.0	54.3	10	5	29	597	M	PS	06/30/99	04/11/83		
TX-118	NCPLX	SOUND	IS/IP/CCS	300	0	24	0.0	89.1	24	20	34	266	F	S	06/30/99	12/19/79		
18 SINGLE-SHELL TANKS TOTALS:				6778	9	309	0.0	1205.7	318	210	893	5876						

E-12

HNF-EP-0182-143

TABLE E-6. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

February 29, 2000

THESE VOLUMES ARE THE RESULT OF ENGINEERING CALCULATIONS AND MAY NOT AGREE WITH SURFACE TANK GAUGING METHODS																		
TANK STATUS					LIQUID VOLUME						SOLIDS VOLUME		VOLUME DETERMINATION			PHOTOS/VIDEOS		SEE FOOTNOTES FOR THESE CHANGES
TANK	WASTE MAT'L	TANK INTEGRITY	STABIL/ ISOLATION STATUS	TOTAL WASTE (Kgal)	SUPER- NATE LIQUID (Kgal)	DRAIN- ABLE INTER- STIT. (Kgal)	PUMPED THIS MONTH (Kgal)	TOTAL PUMPED (Kgal)	DRAIN- ABLE LIQUID REMAIN (Kgal)	PUMP- ABLE LIQUID REMAIN (Kgal)	SLUDGE (Kgal)	SALT CAKE (Kgal)	LIQUIDS VOLUME METHOD	SOLIDS VOLUME METHOD	SOLIDS VOLUME UPDATE	LAST IN-TANK PHOTO	LAST IN-TANK VIDEO	
TY TANK FARM STATUS																		
TY-101	NCPLX	ASMD LKR	IS/IP/CCS	118	0	2	0.0	8.2	2	0	72	46	P	F	06/30/99	08/22/89		
TY-102	NCPLX	SOUND	IS/IP/CCS	64	0	12	0.0	6.6	12	5	0	64	P	FP	06/28/82	07/07/87		
TY-103	NCPLX	ASMD LKR	IS/IP/CCS	162	0	20	0.0	11.5	20	16	162	0	P	FP	07/09/82	08/22/89		
TY-104	NCPLX	ASMD LKR	IS/IP/CCS	43	0	4	0.0	0.0	4	0	43	0	P	FP	06/27/90	11/03/87		
TY-105	NCPLX	ASMD LKR	IS/IP/CCS	231	0	12	0.0	3.6	12	10	231	0	P	M	04/28/82	09/07/89		
TY-106	NCPLX	ASMD LKR	IS/IP/CCS	21	0	3	0.0	0.0	3	0	21	0	P	M	06/30/99	08/22/89		
6 SINGLE-SHELL TANKS TOTALS:				639	0	53	0.0	29.9	53	31	529	110						
U TANK FARM STATUS																		
U-101	NCPLX	ASMD LKR	IS/IP	25	3	3	0.0	0.0	6	2	22	0	P	MP	04/28/82	06/19/79		
U-102	NCPLX	SOUND	/PI	359	2	79	10.3	15.9	81	71	43	314	P	MP	12/31/98	06/06/89	(b)	
U-103	NCPLX	SOUND	/PI	440	0	33	10.1	86.0	33	29	12	428	P	FP	10/31/99	09/13/88	(b)	
U-104	NCPLX	ASMD LKR	IS/IP	122	0	0	0.0	0.0	0	0	79	43	P	MP	06/30/99	08/10/89		
U-105	NCPLX	SOUND	/PI	367	0	60	12.4	64.0	60	56	32	335	FM	PS	01/31/00	07/07/88	(c)	
U-106	NCPLX	SOUND	/PI	226	15	41	0.0	0.0	56	56	0	211	F	PS	12/31/98	07/07/88		
U-107	DSSF	SOUND	/PI	408	33	82	0.0	0.0	115	115	15	390	F	S	12/31/98	10/27/88		
U-108	NCPLX	SOUND	/PI	468	24	100	0.0	0.0	124	124	29	415	F	S	12/31/98	09/12/84		
U-109	NCPLX	SOUND	/PI	485	19	99	0.0	0.0	118	118	35	411	F	F	06/31/99	07/07/88		
U-110	NCPLX	ASMD LKR	IS/PI	186	0	18	0.0	0.0	18	14	186	0	M	M	12/30/84	12/11/84		
U-111	DSSF	SOUND	/PI	329	0	71	0.0	0.0	71	71	26	303	PS	FPS	12/31/98	06/23/88		
U-112	NCPLX	ASMD LKR	IS/IP	49	4	4	0.0	0.0	8	4	45	0	P	MP	02/10/84	08/03/89		
U-201	NCPLX	SOUND	IS/IP	5	1	1	0.0	0.0	2	1	4	0	M	S	08/15/79	08/08/89		
U-202	NCPLX	SOUND	IS/IP	5	1	1	0.0	0.0	2	1	4	0	M	S	08/15/79	08/08/89		
U-203	NCPLX	SOUND	IS/IP	3	1	0	0.0	0.0	1	1	2	0	M	S	08/15/79	06/13/89		
U-204	NCPLX	SOUND	IS/IP	3	1	0	0.0	0.0	1	1	2	0	M	S	08/15/79	08/13/89		
16 SINGLE-SHELL TANKS TOTALS:				3460	104	592	32.8	165.9	696	664	536	2820						
GRAND TOTAL				33713	1513	3736	36.1	5090.7	5249	4647	11438	20782						

HNF-EP-0182-143

## TABLE E-6. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

February 29, 2000

THESE VOLUMES ARE THE RESULT OF ENGINEERING CALCULATIONS AND MAY NOT AGREE WITH DRUG LEVEL MEASUREMENTS.  
FOOTNOTES:

Total Waste is calculated as the sum of Sludge and Saltcake plus Supernate.

The category "Interim Isolated" (II) was changed to "Intrusion Prevention" (IP) in June 1993. See section C. "Tank and Equipment Code and Status Definitions."

Stabilization information from WHC-SD-RE-TI-178 SST STABILIZATION RECORD, latest revision, or SST Stabilization or Cognizant Engineer

**NOTE: Changes were made in the volumes of the DIL, PLR, DLR and Supernate, per RPP-5556, Rev 0, "Updated Drainable Interstitial Liquid Volume Estimates for 119 Single-Shell Tanks Declared Stabilized," February 7, 2000. (Changes are made in the February issue of this Report).**

(a) SX-104 Following information from Cognizant Engineer

Pumping was interrupted on July 27, 1999, by a leaking saltwell pump. This tank is being evaluated for interim stabilization based on equipment failure.

(b) SX-106 Following information from Cognizant Engineer

Pumping was discontinued on January 5, 2000, to allow the waste levels to stabilize, so waste porosities and final waste volumes can then be calculated to determine whether this tank meets Interim Stabilization criteria.

(c) U-106 Following information from Cognizant Engineer.

Saltwell pumping began December 10, 1999. The waste is pumped directly to SY-102.

Total Waste: 367.0 Kgal

Supernate: 0.0 Kgal

Drainable Interstitial Liquid: 60.0 Kgal

Pumped this month: 12.4 Kgal

Total Pumped: 64.0 Kgal

Drainable Liquid Remaining: 60.0 Kgal

Pumpable Liquid Remaining: 56.0 Kgal

Sludge: 32 Kgal

Saltcake: 335 Kgal

In February 2000, a total of 13,341 gal of fluid was removed, and a total of 940 gal of water was added for pump priming/equipment flushes, for a net removal of 12,401 gal of waste. Also, 7,402 gal of water were used as dilution and 1,513 gal of water were used for transfer line flushes.

The supernate volume is assumed to have been fully pumped last month. This month's data indicates that the actual volume of supernate appears to have been approximately 22,000 gallons higher than originally estimated by HNF-2978. There may be additional supernate to be pumped in March.

Note: Corrections were made to DIL, DLR, and PLR in February 2000 Report - the HNF-2978 Rev 0. values were applied as the starting values rather than Rev. 1 values.

## TABLE E-6. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

February 29, 2000

THESE VOLUMES ARE THE RESULT OF ENGINEERING CALCULATIONS AND MAY NOT AGREE WITH SURFACE LEVEL MEASUREMENTS.

### FOOTNOTES:

(d) T-110 Following information from Cognizant Engineer

This tank was declared interim stabilized on January 5, 2000, based on major equipment failure. Last pumping occurred on August 12, 1999.

(e) S-102 Following information from Cognizant Engineer

Pumping commenced March 18, 1999. The waste is pumped directly to SY-102. Pumping stopped on November 17, 1999, when problems with the pump developed. Pumping resumed on February 19, 2000, after the pump was replaced.

Total Waste: 502.9 Kgal  
Supernate: 0.0 Kgal  
Drainable Interstitial: 93.20 Kgal  
Pumped this month: 3.3 Kgal  
Total Pumped: 46.1 Kgal  
Drainable Liquid Remaining: 93.2 Kgal  
Pumpable Liquid Remaining: 88.8 Kgal  
Sludge: 105.0 Kgal  
Saltcake: 397.9 Kgal

In February 2000, a total of 4,960 gal of fluid was removed with 7,565 gal of water added by flushes/priming for a net removal of 46,194 gal of tank waste. In addition, 9,057 gal of dilution water and 1,518 gal of water were added for transfer line flushes.

Note: Corrections were made to DIL, DLR, and PLR in February 2000 Report - the HNF-2978 Rev. values were applied as the starting values.

(f) S-106 Following information from Cognizant Engineer

Pumping was discontinued on January 3, 2000, to allow the waste levels to stabilize, so waste porosities and final waste volumes can then be calculated to determine whether this tank meets Interim Stabilization criteria.

(g) S-103 Following information from Cognizant Engineer

Pumping was discontinued on January 5, 2000, to allow the waste levels to stabilize, so waste porosities and final waste volumes can then be calculated to determine whether this tank meets Interim Stabilization criteria.

TABLE E-6. INVENTORY AND STATUS BY TANK - SINGLE-SHELL TANKS

February 29, 2000

THESE VOLUMES ARE THE RESULT OF AN ENGINEERING CALCULATION AND ARE NOT A GUARANTEE OF ACCURACY.

## FOOTNOTES:

(h) U-102 Following information from Cognizant Engineer

Pumping began in this tank on January 20, 2000.

Total Waste: 359.1 Kgal  
 Supernate: 2.1 Kgal  
 Drainable Interstitial Liquid: 59.0 Kgal  
 Pumped this Month: 10.34 Kgal  
 Total Pumped: 15.9 Kgal  
 Drainable Liquid Remaining: 81.1 Kgal  
 Pumpable Liquid Remaining: 77.1 Kgal  
 Sludge: 43.0 Kgal  
 Saltcake: 314.0 Kgal

During February 2000, a total of 11,213 gal of fluid was removed and a total of 577 gal of water was added by pump priming/equipment flushes, for a net removal of 10,336 gal of tank waste. In addition 11,216 gal of water were used as dilution and 1,320 gal of water were used for transfer line flushes.

Note: Corrections were made to DIL, DLR, and PLR in February 2000 Report - the HNF-29078 Rev 0. values were applied as the starting values rather than Rev. 1 values.

(i) U-103 Following information from Cognizant Engineer.

Seawall pumping commenced September 26, 1999. The waste is pumped directly to SY-102.

Total Waste: 440.0 Kgal  
 Supernate: 0.0 Kgal  
 Drainable Interstitial Liquid: 33.0 Kgal  
 Pumped this month: 10.1 Kgal  
 Total Pumped: 86.0 Kgal  
 Drainable Liquid Remaining: 33.0 Kgal  
 Pumpable Liquid Remaining: 29.0 Kgal  
 Sludge: 12.0 Kgal  
 Saltcake: 428.0 Kgal

In February 2000, a total of 11,195 gal of fluid was removed and 1,057 gal of water added for priming/flushes, for a net removal of 10,078 gal of waste. In addition, 15,801 gal of water were used as dilution and 3,746 gal of water were used for transfer line flushes.

Note: Corrections were made to DIL, DLR, and PLR in February 2000 Report - the HNF-29078 Rev 0. values were applied as the starting values rather than Rev. 1 values.

(j) C-106 Changes in volumes per HNF-5267, Rev.2. "Waste Retrieval Sludging System Campaign Number 3 Solids Volume Transferred Calculation," November 17, 1999.

**APPENDIX F**  
**PERFORMANCE SUMMARY**

**TABLE F-1. SUMMARY OF WASTE TRANSACTIONS IN THE DOUBLE-SHELL TANKS**

February 29, 2000

- The DST system received waste transfers/additions from SST Stabilization & Tank 241-SY-101 remediation in February.
- There was a net change of +331,000 gallons in the DST system for February 2000.
- The total DST inventory as of February 29, 2000 was 20.001 million gallons.
- There was no Saltwell Liquid (SWL) pumped to the East Area DSTs in February.
- There was ~82 Kgal of Saltwell Liquid (SWL) pumped to the West Area DSTs (102-SY) in February.
- The SWL numbers are preliminary and are subject to change once cognizant Engineers do a validation, the volumes reported contain actual waste volume plus any water added for dilution and transfer line flushes.
- Remediation of Tank 101-SY continued in February. ~162 Kgal of Tank 101-SY waste was transferred to Tank 102-SY in February. ~58 Kgal of water was used for dilution of Tank 101-SY waste and was received into Tank 102-SY. Tank 101-SY was backfilled with ~181 Kgal of water. This backfill is in support of the 2nd waste transfer between Tanks 101-SY and 102-SY in January 2000. Associated backfill of Tank 101-SY for the 3rd and final transfer, will be conducted in March 2000. The March inventory report will contain those volumes.
- There was ~511 Kgal. of waste transferred from West Area (102-SY) to East Area (104-AP) in February (x-site transfer).
- Tank 241-AP-104 waste type was changed from "DN" to "CC", in accordance with receiving Tank 241-SY-101 waste.

FEBRUARY 2000 DST WASTE RECEIPTS					
FACILITY GENERATIONS		OTHER GAINS ASSOCIATED WITH		OTHER LOSSES ASSOCIATED WITH	
SWL (West)	+82 Kgal (2SY)	SLURRY	+0 Kgal	SLURRY	-0 Kgal
X-Site flush	+29 Kgal (4AP)	CONDENSATE	+0 Kgal	CONDENSATE	-1 Kgal
101-SY remediation	+239 Kgal (1SY, 2SY)	INSTRUMENTATION	+5 Kgal	INSTRUMENTATION	-25 Kgal (*)
TOTAL	+350 Kgal	UNKNOWN	+0 Kgal	UNKNOWN	-8 Kgal
		TOTAL	+5 Kgal	TOTAL	-34 Kgal


(\*) negative "INSTRUMENTATION" includes ~23 Kgal of waste level change, in Tank 241-SY-101, due to ENRAF instruments being adjusted

	ACTUAL DST WASTE RECEIPTS	PROJECTED DST WASTE RECEIPTS	MISC. DST CHANGES (+/-)	WVR	NET DST CHANGE	TOTAL DST VOLUME
OCT99	124	127	-19	0	105	19086
NOV99	39	209	-5	0	34	19132
DEC99	248	173	-17	0	231	19363
JAN00	411	149	-104	0	307	19670
FEB00	390	462	-29	0	331	20001
MAR00		130		0		
APR00		441		-800		
MAY00		395		0		
JUN00		174		0		
JUL00		180		0		
AUG00		201		0		
SEP00		188		0		

NOTE: The "PROJECTED DST WASTE RECEIPTS" and "WVR" numbers were updated in October 1999, as supplied by cognizant engineers.

THOUSAND GALLONS

# COMPARISON OF WASTE VOLUME GENERATIONS FOR HANFORD FACILITIES (ALL VOLUMES IN KGALS)

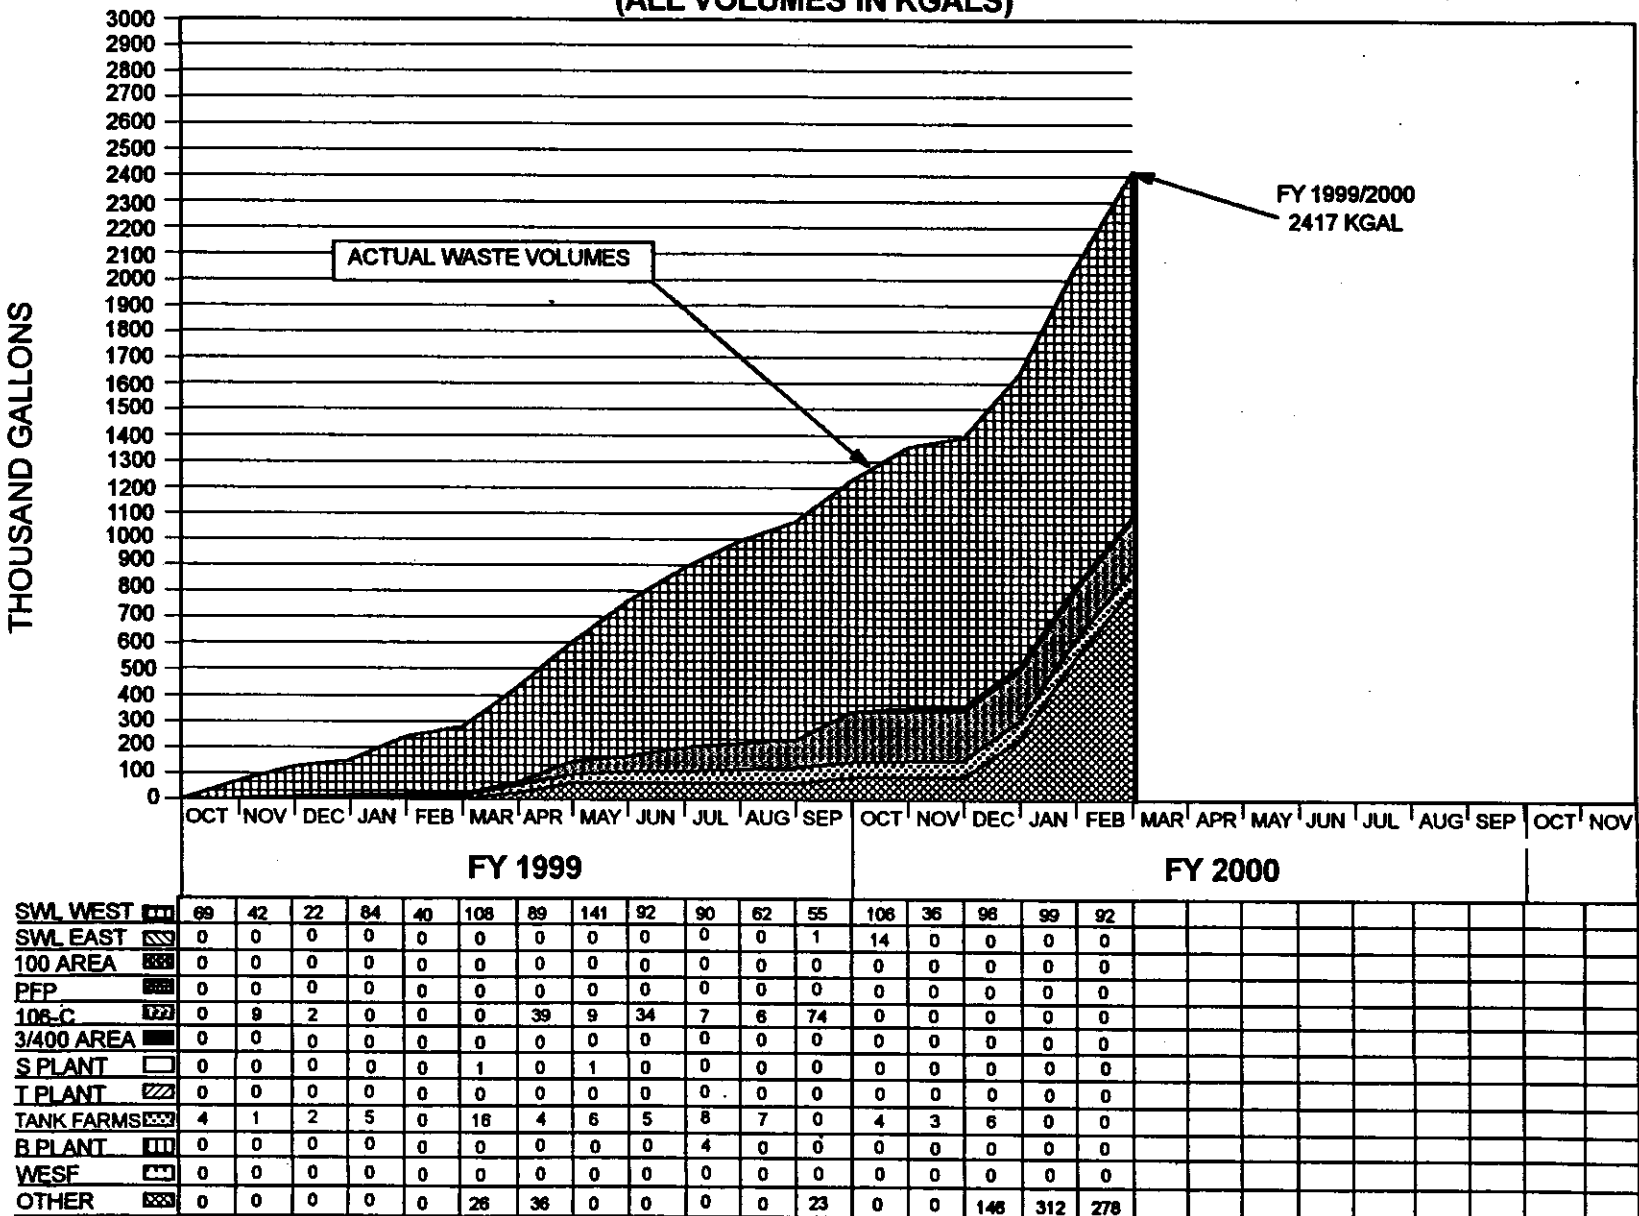

NOTE: The Other Category is for Waste Generations from, Evaporator Training, Pressure Tests, Cross-Site Transfers and Tank 101-SY remediation work

FACILPAC

**FIGURE F-1. COMPARISON OF WASTE VOLUME GENERATIONS FOR HANFORD FACILITIES**  
(All volumes in Kgals)

**APPENDIX G**

**MISCELLANEOUS UNDERGROUND STORAGE TANKS  
AND SPECIAL SURVEILLANCE FACILITIES**

**TABLE G-1. EAST AND WEST AREA MISCELLANEOUS UNDERGROUND STORAGE TANKS  
AND SPECIAL SURVEILLANCE FACILITIES**

**ACTIVE - still running transfers through the associated diversion boxes or pipeline encasements  
February 29, 2000**

<u>FACILITY</u>	<u>LOCATION</u>	<u>PURPOSE (receives waste from:)</u>	<u>(Gallons)</u>	<u>MONITORED BY</u>	<u>REMARKS</u>
<b>EAST AREA</b>					
241-A-302-A	A Farm	A-151 DB	937	SACS/ENRAF/Manually	Foamed over Catch Tank pump pit & div. box to prevent intrusion
241-ER-311	B Plant	ER-151, ER-152 DB	8033	SACS/ENRAF/Manually	
241-AX-152	AX Farm	AX-152 DB	0	SACS/MT	Pumped 11/98
241-AZ-151	AZ Farm	AZ-702 condensate	6657	SACS/FIC/Manually	Volume changes daily - pumped to AZ-102 as needed
241-AZ-154	AZ Farm		25	SACS/MT	
244-BX-TK/SMP	BX Complex	DCRT - Receives from several farms	15775	SACS/MT	Using Manual Tape for tank/sump, pumped 10/16/99 to 66.0 in. 02/00, MT O/S, using WF rdg. as backup
244-A-TK/SMP	A Complex	DCRT - Receives from several farms	3009	MCS/SACS/WTF	WTF- pumped 3/99 to AP-108
A-350	A Farm	Collects drainage	330	MCS/SACS/WTF	WTF (uncorrected) pumped as needed
AR-204	AY Farm	Tanker trucks from various facilities	550	DIP TUBE	Alarms on SACS-pumped to AP-108, 7/99
A-417	A Farm		12344	SACS/WTF	WTF (uncorrected) pumped 4/98
CR-003-TK/SUMP	C Farm	DCRT	3413	MT/ZIP CORD	Zip cord in sump O/S 3/11/96, water intrusion, 1/98
<b>WEST AREA</b>					
241-TX-302-C	TX Farm	TX-154 DB	162	SACS/ENRAF/Manually	
241-U-301-B	U Farm	U-151, U-152, U-153, U-252 DB	8063	SACS/ENRAF/Manually	Returned to service 12/30/93
241-UX-302-A	U Plant	UX-154 DB	2441	SACS/ENRAF/Manually	
241-S-304	S Farm	S-151 DB	130	SACS/ENRAF/Manually	Replaced S-302-A, 10/91; ENRAF installed 7/98
244-S-TK/SMP	S Farm	From original tanks to SY-102	9500	SACS/Manually	Sump not alarming.
244-TX-TK/SMP	TX Farm	From original tanks to SY-102	16466	SACS/Manually	WTF (uncorrected)
Vent Station Catch Tank		Cross Country Transfer Line	351	SACS/Manually	MT

**Total Active Facilities 18**

<b>LEGEND:</b>	DB - Diversion Box
	DCRT - Drainage Control Tank
	TK - Tank
	AX - Farm
	FIC - Farm Interceptor
	MT - Manual
	ZIP CORD - Zip Cord
	WTF - Water Treatment Facility
	ENRAF - Emergency Response and Remediation Facility
	SACS - Safety and Control System
	MCS - Monitoring and Control System
	MT - Manual
	ON - On
	ENRAF - Emergency Response and Remediation Facility

HNF-EP-0182-143


**TABLE G-2. EAST AREA INACTIVE MISC. UNDERGROUND STORAGE TANKS AND SPECIAL SURV. FACILITIES**

INACTIVE - no longer receiving waste transfers

February 29, 2000

<u>FACILITY</u>	<u>LOCATION</u>	<u>RECEIVED WASTE FROM:</u>	<u>(Gallons)</u>	<u>MONITORED BY</u>	<u>REMARKS</u>
216-BY-201	BY Farm	TBP Waste Line	Unknown	NM	(216-BY)
241-A-302-B	A Farm	A-152 DB	5720	SACS/MT	Isolated 1985, Project B-138 Interim Stabilized 1990, Rain intrusion
241-AX-151	N of PUREX	PUREX	Unknown	NM	Isolated 1985
241-B-301-B	B Farm	B-151, B-152, B-153, B-252 DB	22250	NM	Isolated 1985 (1)
241-B-302-B	B Farm	B-154 DB	4930	NM	Isolated 1985 (1)
241-BX-302-A	BX Farm	BR-152, BX-153, BXR-152, BYR-152 DB	840	NM	Isolated 1985 (1)
241-BX-302-B	BX Farm	BX-154 DB	1040	NM	Isolated 1985 (1)
241-BX-302-C	BX Farm	BX-155 DB	870	NM	Isolated 1985 (1)
241-C-301-C	C Farm	C-151, C-152, C-153, C-252 DB	10470	NM	Isolated 1985 (1)
241-CX-70	Hot Semi-	Transfer lines	Unknown	NM	Isolated, Decommission Project,
241-CX-72	Works	Transfer lines	650	NM	See Dwg H-2-95-501, 2/5/87
241-ER-311A	SW B Plant	ER-151 DB	Unknown	NM	Isolated
244-AR VAULT	A Complex	Between farms & B-Plant	Unknown	NM	Not actively being used. Systems activated for final clean-out.
244-BXR-TK/SMP-001	BX Farm	Transfer lines	7200	NM	Interim Stabilization 1985 (1)
244-BXR-TK/SMP-002	BX Farm	Transfer lines	2180	NM	Interim Stabilization 1985 (1)
244-BXR-TK/SMP-003	BX Farm	Transfer lines	1810	NM	Interim Stabilization 1985 (1)
244-BXR-TK/SMP-011	BX Farm	Transfer lines	7100	NM	Interim Stabilization 1985 (1)
361-B-TANK	B Plant	Drainage from B-Plant	Unknown	NM	Interim Stabilization 1985 (1)

**Total East Area inactive facilities 18**

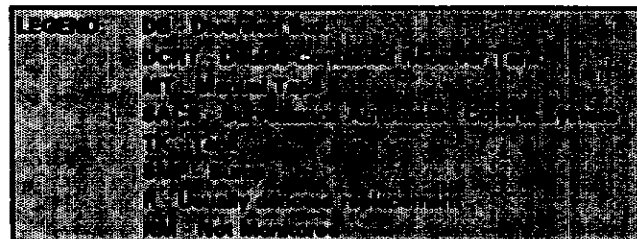

HNF-EP-0182-143

(1) SOURCE: WASTE STORAGE TANK STATUS & LEAK DETECTION CRITERIA document


**TABLE G-3. WEST AREA INACTIVE MISC. UNDERGROUND STORAGE TANKS AND SPECIAL SURV. FACILITIES**

**INACTIVE - no longer receiving waste transfers**

**February 29, 2000**

<u>FACILITY</u>	<u>LOCATION</u>	<u>RECEIVED WASTE FROM:</u>	<u>(Gallons)</u>	<u>MONITORED BY</u>	<u>REMARKS</u>
216-TY-201	E. of TY Farm	Supernate from T-112	Unknown	NM	Isolated
231-W-151-001	N. of Z Plant	231-Z Floor drains	Unknown	NM	Inactive, last data 1974
231-W-151-002	N. of Z Plant	231-Z Floor drains	Unknown	NM	Inactive, last data 1974
240-S-302	S Farm	240-S-151 DB	8554	SACS/ENRAF	Assumed Leaker EPDA 85-04
241-S-302-A	S Farm	241-S-151 DB	0		Assumed Leaker TF-EFS-90-042
Partially filled with grout 2/91, determined still assumed leaker after leak test. Manual FIC readings are unobtainable due to dry grouted surface.					
CASS monitoring system retired 2/23/99; Intrusion readings discontinued. S-304 replaced S-302-A					
241-S-302-B	S Farm	S Encasements	Unknown	NM	Isolated 1985 (1)
241-SX-302	SX Farm	SX-151 DB, 151 TB	Unknown	NM	Isolated 1987
241-SX-304	SX Farm	SX-152 Transfer Box, SX-151 DB	Unknown	NM	Isolated 1985 (1)
241-T-301	T Farm	DB T-151, -151, -153, -252	Unknown	NM	Isolated 1985 (241-T-301B)
241-TX-302	TX Farm	TX-153 DB	Unknown	NM	Isolated 1985 (1)
241-TX-302-X-B	TX Farm	TX Encasements	Unknown	NM	Isolated 1985 (1)
241-TX-302-B	TX Farm	TX-155 DB	1800	SACS/MT	New MT installed 7/16/93
241-TX-302-B(R)	E. of TX Farm	TX-155 DB	Unknown	NM	Isolated
241-TY-302-A	TY Farm	TX-153 DB	Unknown	NM	Isolated 1985 (1)
241-TY-302-B	TY Farm	TY Encasements	Unknown	NM	Isolated 1985 (1)
241-Z-8	E. of Z Plant	Recuplex waste	Unknown	NM	Isolated, 1974, 1975
242-T-135	T Evaporator	T Evaporator	Unknown	NM	Isolated
242-TA-R1	T Evaporator	Z Plant waste	Unknown	NM	Isolated
243-S-TK-1	N. of S Farm	Pers. Decon. Facility	Unknown	NM	Isolated
244-U-TK/SMP	U Farm	DCRT - Receives from several farms	Unknown	NM	Not yet in use
244-TXR VAULT	TX Farm	Transfer lines	Unknown	NM	Interim Stabilized, MT removed 1984 (1)
244-TXR-TK/SMP-001	TX Farm	Transfer lines	Unknown	NM	Interim Stabilized, MT removed 1984 (1)
244-TXR-TK/SMP-002	TX Farm	Transfer lines	Unknown	NM	Interim Stabilized, MT removed 1984 (1)
244-TXR-TK/SMP-003	TX Farm	Transfer lines	Unknown	NM	Interim Stabilized, MT removed 1984 (1)
270-W	SE of U Plant	Condensate from U-221	Unknown	NM	Isolated 1970
361-T-TANK	T Plant	Drainage from T-Plant	Unknown	NM	Isolated 1985 (1)
361-U-TANK	U Plant	Drainage from U-Plant	Unknown	NM	Interim Stabilized, MT removed 1984 (1)

**Total West Area inactive facilities: 27**

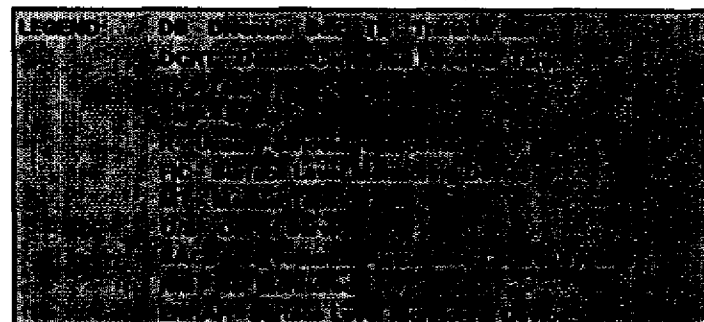

HNF-EP-0182-143

(1) SOURCE: WASTE STORAGE TANK STATUS & LEAK DETECTION CRITERIA document

**APPENDIX H**  
**LEAK VOLUME ESTIMATES**

TABLE H-1. SINGLE-SHELL TANK LEAK VOLUME ESTIMATES (Sheet 1 of 5)

February 29, 2000

Tank Number	Date Declared Confirmed or Assumed Leaker (3)	Volume Gallons (2)	Associated KiloCuries 137 cs (10)	Interim Stabilized Date (11)	Leak Estimate	
					Updated	Reference
241-A-103	1987	5500 (8)		06/88	1987	(j)
241-A-104	1975	500 to 2500	0.8 to 1.8 (q)	09/78	1983	(a)(q)
241-A-105 (1)	1983	10000 to 277000	85 to 760 (b)	07/79	1991	(b)(c)
241-AX-102	1988	3000 (8)		09/88	1989	(h)
241-AX-104	1977	— (8)		08/81	1989	(g)
241-B-101	1974	— (8)		03/81	1989	(g)
241-B-103	1978	— (8)		02/85	1989	(g)
241-B-105	1978	— (8)		12/84	1989	(g)
241-B-107	1980	8000 (8)		03/85	1986	(d)(f)
241-B-110	1981	10000 (8)		03/85	1986	(d)
241-B-111	1978	— (8)		06/85	1989	(g)
241-B-112	1978	2000		05/85	1989	(g)
241-B-201	1980	1200 (8)		08/81	1984	(e)(f)
241-B-203	1983	300 (8)		06/84	1986	(d)
241-B-204	1984	400 (8)		06/84	1989	(g)
241-BX-101	1972	— (8)		09/78	1989	(g)
241-BX-102	1971	70000	50 (i)	11/78	1986	(d)
241-BX-108	1974	2500	0.5 (i)	07/79	1986	(d)
241-BX-110	1976	— (8)		08/85	1989	(g)
241-BX-111	1984 (13)	— (8)		03/95	1993	(g)
241-BY-103	1973	<5000		11/97	1983	(a)
241-BY-105	1984	— (8)		N/A	1989	(g)
241-BY-106	1984	— (8)		N/A	1989	(g)
241-BY-107	1984	15100 (8)		07/79	1989	(g)
241-BY-108	1972	<5000		02/85	1983	(a)
241-C-101	1980	20000 (8)(10)		11/83	1986	(d)
241-C-110	1984	2000		05/95	1989	(g)
241-C-111	1988	5500 (8)		03/84	1989	(g)
241-C-201 (4)	1988	550		03/82	1987	(i)
241-C-202 (4)	1988	450		08/81	1987	(i)
241-C-203	1984	400 (8)		03/82	1986	(d)
241-C-204 (4)	1988	350		09/82	1987	(i)
241-S-104	1988	24000 (8)		12/84	1989	(g)
241-SX-104	1988	6000 (8)		N/A	1988	(k)
241-SX-107	1984	<5000		10/79	1983	(a)
241-SX-108 (5)(14)	1982	2400 to 35000	17 to 140 (m)(q)(t)	08/79	1991	(m)(q)(t)
241-SX-109 (5)(14)	1985	<10000	<40 (n)(t)	05/81	1992	(n)(t)
241-SX-110	1976	5500 (8)		08/79	1989	(g)
241-SX-111 (14)	1974	500 to 2000	0.6 to 2.4 (l)(q)(t)	07/79	1986	(d)(q)(t)
241-SX-112 (14)	1969	30000	40 (l)(t)	07/79	1986	(d)(t)
241-SX-113	1962	15000	8 (l)	11/78	1986	(d)
241-SX-114	1972	— (8)		07/79	1989	(g)
241-SX-115	1965	50000	21 (o)	09/78	1992	(o)
241-T-101	1992	7500 (8)		04/83	1992	(p)
241-T-103	1974	<1000 (8)		11/83	1989	(g)
241-T-106	1973	115000 (8)	40 (l)	08/81	1986	(d)
241-T-107	1984	— (8)		05/86	1989	(g)
241-T-108	1974	<1000 (8)		11/78	1980	(f)
241-T-109	1974	<1000 (8)		12/84	1989	(g)
241-T-111	1979, 1994 (12)	<1000 (8)		02/85	1994	(f)(r)
241-TX-105	1977	— (8)		04/83	1989	(g)
241-TX-107 (5)	1984	2500		10/79	1986	(d)
241-TX-110	1977	— (8)		04/83	1989	(g)
241-TX-113	1974	— (8)		04/83	1989	(g)
241-TX-114	1974	— (8)		04/83	1989	(g)
241-TX-115	1977	— (8)		08/83	1989	(g)
241-TX-116	1977	— (8)		04/83	1989	(g)
241-TX-117	1977	— (8)		03/83	1989	(g)
241-TY-101	1973	<1000 (8)		04/83	1980	(f)
241-TY-103	1973	3000	0.7 (l)	02/83	1986	(d)
241-TY-104	1981	1400 (8)		11/83	1986	(d)
241-TY-105	1960	35000	4 (l)	02/83	1986	(d)
241-TY-106	1959	20000	2 (l)	11/78	1986	(d)
241-U-101	1959	30000	20 (l)	09/79	1986	(d)
241-U-104	1961	55000	0.09 (l)	10/78	1986	(d)
241-U-110	1975	5000 to 8100 (8)	0.05 (q)	12/84	1986	(d)(q)
241-U-112	1980	8500 (8)		09/79	1986	(d)
7 Tanks		<750,000 - 1,050,000 (7)				

N/A = not applicable (not yet interim stabilized)

**TABLE H-1. SINGLE-SHELL LEAK VOLUME ESTIMATES**  
(Sheet 2 of 5)

**Footnotes:**

- (1) Current estimates [see reference(b)] are that 610 Kgallons of cooling water was added to Tank 241-A-105 from November 1970 to December 1978 to aid in evaporative cooling. In accordance with Dangerous Waste Regulations [Washington Administrative Code 173-303-070 (2)(a)(ii), as amended, Washington State Department of Ecology, 1990, Olympia, Washington], any of this cooling water that has been added and subsequently leaked from the tank must be classified as a waste and should be included in the total leak volume. In August 1991, the leak volume estimate for this tank was updated in accordance with the WAC regulations. Previous estimates excluded the cooling water leaks from the total leak volume estimates because the waste content (concentration) in the cooling water which leaked should be much less than the original liquid waste in the tank (the sludge is relatively insoluble). The total leak volume estimate in this report (10 Kgallons to 277 Kgallons) is based on the following (see References):
1. Reference (b) contains an estimate of 5 Kgallons to 15 Kgallons for the initial leak prior to August 1968.
  2. Reference (b) contains an estimate of 5 Kgallons to 30 Kgallons for the leak while the tank was being sluiced from August 1968 to November 1970.
  3. Reference (b) contains an estimate of 610 Kgallons of cooling water added to the tank from November 1970 to December 1978 but it was estimated that the leakage was small during this period. This reference contains the statement "Sufficient heat was generated in the tank to evaporate most, and perhaps nearly all, of this water." This results in a low estimate of zero gallons leakage from November 1970 to December 1978.
  4. Reference (c) contains an estimate the 378 to 410 Kgallons evaporated out of the tank from November 1970 to December 1978. Subtracting the minimum evaporation estimate from the cooling water added estimate provides a range from 0 to 232 Kgallons of cooling water leakage from November 1970 to December 1978.
- |                                | <u>Low Estimate</u> | <u>High Estimate</u> |
|--------------------------------|---------------------|----------------------|
| Prior to August 1968           | 5,000               | 15,000               |
| August 1968 to November 1970   | 5,000               | 30,000               |
| November 1970 to December 1978 | <u>0</u>            | <u>232,000</u>       |
| Totals                         | 10,000              | 277,000              |
- (2) These leak volume estimates do not include (with some exceptions), such things as: (a) cooling/raw water leaks, (b) intrusions (rain infiltration) and subsequent leaks, (c) leaks inside the tank farm but not through the tank liner (surface leaks, pipeline leaks, leaks at the joint for the overflow or fill lines, etc.), and (d) leaks from catch tanks, diversion boxes, encasements, etc.
- (3) In many cases, a leak was suspected long before it was identified or confirmed. For example, reference (d) shows that Tank 241-U-104 was suspected of leaking in 1956. The leak was "confirmed" in 1961. This report lists the "assumed leaker" date of 1961. Using present standards, Tank 241-U-104 would have been declared an assumed leaker in 1956. In 1984, the criteria designations of "suspected leaker," "questionable integrity," "confirmed leaker," "declared leaker," "borderline" and "dormant," were merged into one category now reported as "assumed leaker." See reference (f) for explanation of when, how long, and how fast some of the tanks leaked. It is highly likely that there have been undetected leaks from single-shell tanks because of the nature of their design and instrumentation.

**TABLE H-1. SINGLE-SHELL TANK LEAK VOLUME ESTIMATES**  
(Sheet 3 of 5)

- (4) The leak volume estimate date for these tanks is before the "declared leaker" date because the tank was in a "suspected leaker" or "questionable integrity" status; however, a leak volume had been estimated prior to the tank being reclassified.
- (5) The increasing radiation levels in drywells and laterals associated with these three tanks could be indicating continuing leak or movement of existing radionuclides in the soil. There is no conclusive way to confirm these observations.
- (6) Methods were used to estimate the leak volumes from these 19 tanks based on the assumption that their cumulative leakage is approximately the same as for 18 of the 24 tanks identified in footnote (9). For more details see reference (g). The total leak volume estimate for these tanks is 150 Kgallons (rounded to the nearest Kgallons), for an average of approximately 8 Kgallons for each of 19 tanks.
- (7) The total has been rounded to the nearest 50 Kgallons. Upper bound values were used in many cases in developing these estimates. It is likely that some of these tanks have not actually leaked.
- (8) Leak volume estimate is based solely on observed liquid level decreases in these tanks. This is considered to be the most accurate method for estimating leak volumes.
- (9) The curie content shown is as listed in the reference document and is not decayed to a consistent date; therefore, a cumulative total is inappropriate.
- (10) Tank 241-C-101 experienced a liquid level decrease in the late 1960s and was taken out of service and pumped to a "minimum heel" in December 1969. In 1970, the tank was classified as a "questionable integrity" tank. Liquid level data show decreases in level throughout the 1970s and the tank was saltwell pumped during the 1970s, ending in April 1979. The tank was reclassified as a "confirmed leaker" in January 1980. See references (q) and (s); refer to reference (s) for information on the potential for there to have been leaks from other C-farm tanks (specifically, C-102, C-103, and C-109).
- (11) These dates indicate when the tanks were declared to be interim stabilized. In some cases, the official interim stabilization documents were issued at a later date. Also, in some cases, the field work associated with interim stabilization was completed at an earlier date.
- (12) Tank T-111 was declared an assumed re-leaker on February 28, 1994, due to a decreasing trend in surface level measurement. This tank was pumped, and interim stabilization completed on February 22, 1995.
- (13) Tank BX-111 was declared an assumed re-leaker in April 1993. Preparations for pumping were delayed, following an administrative hold placed on all tank farm operations in August 1993. Pumping resumed and the tank was declared interim stabilized on March 15, 1995.
- (14) The leak volume and curie release estimates on SX-108, SX-109, SX-111, and SX-112 have been re-evaluated using a Historical Leak Model [see reference (u)]. In general, the model estimates are much higher than the values listed in the table, both for volume and curies released. The values listed in the table do not reflect this revised estimate because, "In particular, it is worth emphasizing that this report was never meant to be a definitive update for the leak baseline at the Hanford Site. It was rather meant to be an attempt to view the issue of leak inventories with a new and different methodology." (This quote is from the first page of the referenced report).

TABLE H-1. SINGLE-SHELL TANK LEAK VOLUME ESTIMATES  
(Sheet 4 of 5)

## References:

- (a) Murthy, K.S., et al, June 1983, *Assessment of Single-Shell Tank Residual Liquid Issues at Hanford Site*, Washington, PNL-4688, Pacific Northwest Laboratory, Richland, Washington.
- (b) WHC, 1991a, *Tank 241-A-105 Leak Assessment*, WHC-MR-0264, Westinghouse Hanford Company, Richland, Washington.
- (c) WHC, 1991b, *Tank 241-A-105 Evaporation Estimate 1970 Through 1978*, WHC-EP-0410, Westinghouse Hanford Company, Richland, Washington.
- (d) Smith, D. A., January 1986, *Single-Shell Tank Isolation Safety Analysis Report*, SD-WM-SAR-006, Rev. 1, Westinghouse Hanford Company, Richland, Washington.
- (e) McCann, D. C., and T. S. Vail, September 1984, *Waste Status Summary*, RHO-RE-SR-14, Rockwell Hanford Operations, Richland, Washington.
- (f) Catlin, R. J., March 1980, *Assessment of the Surveillance Program of the High-Level Waste Storage Tanks at Hanford*, Hanford Engineering Development Laboratory, Richland, Washington.
- (g) Baumhardt, R. J., May 15, 1989, Letter to R. E. Gerton, U.S. Department of Energy-Richland Operations Office, *Single-Shell Tank Leak Volumes*, 8901832B R1, Westinghouse Hanford Company, Richland, Washington.
- (h) WHC, 1990a, Occurrence Report, *Surface Level Measurement Decrease in Single-Shell Tank 241-AX-102*, WHC-UO-89-023-TF-05, Westinghouse Hanford Company, Richland, Washington.
- (i) Groth, D. R., July 1, 1987, Internal Memorandum to R. J. Baumhardt, *Liquid Level Losses in Tanks 241-C-201, -202 and -204*, 65950-87-517, Westinghouse Hanford Company, Richland, Washington.
- (j) Groth, D. R. and G. C. Owens, May 15, 1987, Internal Memorandum to J. H. Roecker, *Tank 103-A Integrity Evaluation*, Westinghouse Hanford Company, Richland, Washington.
- (k) Campbell, G. D., July 8, 1988, Internal Memorandum to R. K. Welty, *Engineering Investigation: Interstitial Liquid Level Decrease in Tank 241-SX-104*, 13331-88-416, Westinghouse Hanford Company, Richland, Washington.
- (l) ERDA, 1975, *Final Environmental Statement Waste Management Operations, Hanford Reservation, Richland, Washington*, ERDA-1538, 2 vols., U.S. Energy Research and Development Administration, Washington, D.C.
- (m) WHC, 1992a, *Tank 241-SX-108 Leak Assessment*, WHC-MR-0300, Westinghouse Hanford Company, Richland, Washington.
- (n) WHC, 1992b, *Tank 241-SX-109 Leak Assessment*, WHC-MR-0301, Westinghouse Hanford Company, Richland, Washington.
- (o) WHC, 1992c, *Tank 241-SX-115 Leak Assessment*, WHC-MR-0302, Westinghouse Hanford Company, Richland, Washington.

**TABLE H-1. SINGLE-SHELL TANK LEAK VOLUME ESTIMATES**  
(Sheet 5 of 5)

- (p) WHC, 1992d, Occurrence Report, *Apparent Decrease in Liquid Level in Single Shell Underground Storage Tank 241-T-101, Leak Suspected; Investigation Continuing*, RL-WHC-TANKFARM-1992-0073, Westinghouse Hanford Company, Richland, Washington.
- (q) WHC, 1990b, *A History of the 200 Area Tank Farms*, WHC-MR-0132, Westinghouse Hanford Company, Richland, Washington.
- (r) WHC, 1993a, *Assessment of Unsaturated Zone Radionuclide Contamination Around Single-Shell Tanks 241-C-105 and 241-C-106*, WHC-SD-EN-TI-185, REV OA, Westinghouse Hanford Company, Richland, Washington.
- (s) WHC, 1994, Occurrence Report, *Apparent Liquid Level Decrease in Single Shell Underground Storage Tank 241-T-111; Declared an Assumed Re-Leaker*, RL-WHC-TANKFARM-1994-0009, Westinghouse Hanford Company, Richland, Washington.
- (t) HNF, 1998, Agnew, S. F. and R. A. Corbin, August 1998, *Analysis of SX Farm Leak Histories - Historical Leak Model*, (HLM), HNF-3233, Rev. 0, Los Alamos National Laboratory, Los Alamos, New Mexico

**APPENDIX I**

**INTERIM STABILIZATION STATUS  
CONTROLLED, CLEAN, AND STABLE STATUS**

TABLE I-1. SINGLE-SHELL TANKS INTERIM STABILIZATION STATUS (Sheet 1 of 3)

February 29, 2000

Tank Number	Tank Integrity	Interim Stabil. Date (1)	Stabil. Method	Tank Number	Tank Integrity	Interim Stabil. Date (1)	Stabil. Method	Tank Number	Tank Integrity	Interim Stabil. Date (1)	Stabil. Method
A-101	SOUND	N/A		C-101	ASMD LKR	11/83	AR	T-108	ASMD LKR	11/78	AR
A-102	SOUND	08/88	SN	C-102	SOUND	08/86	JET	T-109	ASMD LKR	12/84	AR
A-103	ASMD LKR	08/88	AR	C-103	SOUND	N/A		T-110	SOUND	01/00 (5)	JET
A-104	ASMD LKR	08/78	AR	C-104	SOUND	08/88	SN	T-111	ASMD LKR	02/85	JET
A-105	ASMD LKR	07/79	AR	C-105	SOUND	10/86	AR	T-112	SOUND	03/81	AR(2)(3)
A-106	SOUND	08/82	AR	C-106	SOUND	N/A		T-201	SOUND	04/81	AR (3)
AX-101	SOUND	N/A		C-107	SOUND	08/86	JET	T-202	SOUND	08/81	AR
AX-102	ASMD LKR	08/88	SN	C-108	SOUND	03/84	AR	T-203	SOUND	04/81	AR
AX-103	SOUND	08/87	AR	C-109	SOUND	11/83	AR	T-204	SOUND	08/81	AR
AX-104	ASMD LKR	08/81	AR	C-110	ASMD LKR	05/86	JET	TX-101	SOUND	02/84	AR
B-101	ASMD LKR	03/81	SN	C-111	ASMD LKR	03/84	SN	TX-102	SOUND	04/83	JET
B-102	SOUND	08/85	SN	C-112	SOUND	08/80	AR	TX-103	SOUND	08/83	JET
B-103	ASMD LKR	02/85	SN	C-201	ASMD LKR	03/82	AR	TX-104	SOUND	08/79	SN
B-104	SOUND	08/85	SN(2)	C-202	ASMD LKR	08/81	AR	TX-105	ASMD LKR	04/83	JET
B-105	ASMD LKR	12/84	AR	C-203	ASMD LKR	03/82	AR	TX-106	SOUND	08/83	JET
B-106	SOUND	03/85	SN	C-204	ASMD LKR	08/82	AR	TX-107	ASMD LKR	10/79	AR
B-107	ASMD LKR	03/85	SN	S-101	SOUND	N/A		TX-108	SOUND	03/83	JET
B-108	SOUND	05/85	SN	S-102	SOUND	N/A		TX-109	SOUND	04/83	JET
B-109	SOUND	04/85	SN	S-103	SOUND	N/A		TX-110	ASMD LKR	04/83	JET
B-110	ASMD LKR	12/84	AR(2)	S-104	ASMD LKR	12/84	AR	TX-111	SOUND	04/83	JET
B-111	ASMD LKR	08/85	SN(2)	S-105	SOUND	08/88	JET	TX-112	SOUND	04/83	JET
B-112	ASMD LKR	05/85	SN	S-106	SOUND	N/A		TX-113	ASMD LKR	04/83	JET
B-201	ASMD LKR	08/81	AR (3)	S-107	SOUND	N/A		TX-114	ASMD LKR	04/83	JET
B-202	SOUND	05/85	AR(2)	S-108	SOUND	12/86	JET	TX-115	ASMD LKR	08/83	JET
B-203	ASMD LKR	08/84	AR	S-109	SOUND	N/A		TX-116	ASMD LKR	04/83	JET
B-204	ASMD LKR	08/84	AR	S-110	SOUND	01/87	JET	TX-117	ASMD LKR	03/83	JET
BX-101	ASMD LKR	08/78	AR	S-111	SOUND	N/A		TX-118	SOUND	04/83	JET
BX-102	ASMD LKR	11/78	AR	S-112	SOUND	N/A		TY-101	ASMD LKR	04/83	JET
BX-103	SOUND	11/83	AR(2)	SX-101	SOUND	N/A		TY-102	SOUND	08/79	AR
BX-104	SOUND	08/88	SN	SX-102	SOUND	N/A		TY-103	ASMD LKR	02/83	JET
BX-105	SOUND	03/81	SN	SX-103	SOUND	N/A		TY-104	ASMD LKR	11/83	AR
BX-106	SOUND	07/85	SN	SX-104	ASMD LKR	N/A		TY-105	ASMD LKR	02/83	JET
BX-107	SOUND	08/80	JET	SX-105	SOUND	N/A		TY-106	ASMD LKR	11/78	AR
BX-108	ASMD LKR	07/79	SN	SX-106	SOUND	N/A		U-101	ASMD LKR	08/79	AR
BX-109	SOUND	08/80	JET	SX-107	ASMD LKR	10/79	AR	U-102	SOUND	N/A	
BX-110	ASMD LKR	08/85	SN	SX-108	ASMD LKR	08/78	AR	U-103	SOUND	N/A	
BX-111	ASMD LKR	03/85	JET	SX-109	ASMD LKR	05/81	AR	U-104	ASMD LKR	10/78	AR
BX-112	SOUND	08/80	JET	SX-110	ASMD LKR	08/79	AR	U-105	SOUND	N/A	
BY-101	SOUND	05/84	JET	SX-111	ASMD LKR	07/79	SN	U-106	SOUND	N/A	
BY-102	SOUND	04/85	JET	SX-112	ASMD LKR	07/78	AR	U-107	SOUND	N/A	
BY-103	ASMD LKR	11/87	JET	SX-113	ASMD LKR	11/78	AR	U-108	SOUND	N/A	
BY-104	SOUND	01/86	JET	SX-114	ASMD LKR	07/78	AR	U-109	SOUND	N/A	
BY-105	ASMD LKR	N/A		SX-115	ASMD LKR	08/78	AR	U-110	ASMD LKR	12/84	AR
BY-106	ASMD LKR	N/A		T-101	ASMD LKR	04/83	SN	U-111	SOUND	N/A	
BY-107	ASMD LKR	07/79	JET	T-102	SOUND	03/81	AR(2)(3)	U-112	ASMD LKR	08/79	AR
BY-108	ASMD LKR	02/85	JET	T-103	ASMD LKR	11/83	AR	U-201	SOUND	08/78	AR
BY-109	SOUND	07/87	JET	T-104	SOUND	11/88 (4)	JET	U-202	SOUND	08/78	SN
BY-110	SOUND	01/85	JET	T-105	SOUND	08/87	AR	U-203	SOUND	08/78	AR
BY-111	SOUND	01/85	JET	T-106	ASMD LKR	08/81	AR	U-204	SOUND	08/79	SN
BY-112	SOUND	08/84	JET	T-107	ASMD LKR	05/86	JET				

## LEGEND:

AR = Administratively interim stabilized  
 JET = Saltwell jet pumped to remove drainable interstitial liquid  
 SN = Supernate pumped (Non-Jet pumped)  
 N/A = Not yet interim stabilized  
 ASMD LKR = Assumed Leaker

Interim Stabilized Tanks	121
Not Yet Interim Stabilized	28
<b>Total Single-Shell Tanks</b>	<b>149</b>

**TABLE I-1. SINGLE-SHELL TANKS INTERIM STABILIZATION STATUS**  
(sheet 2 of 2)

**Footnotes:**

- (1) These dates indicate when the tanks were actually interim stabilized. In some cases, the official interim stabilization documents were issued at a later date.
- (2) Although tanks, BX-103, T-102 and T-112 met the interim stabilization administrative procedure at the time they were stabilized, they no longer meet the recently updated administrative procedure. The tanks were re-evaluated in 1996 and memo 9654456, J. H. Wicks to Dr. J. K. McClusky, DOE-RL, dated September 1996, was issued which recommended that no further pumping be performed on these tanks, based on an economic evaluation.

**Document RPP-5556, Rev. 0, "Updated Drainable Interstitial Liquid Volume Estimates for 119 Single-Shell Tanks Declared Stabilized," J. G. Field, February 7, 2000, states that five tanks no longer meet the stabilization criteria (BX-103, T-102, and T-112 exceed the supernate criteria, and BY-103 and C-102 exceed the DIL criteria).**

An intrusion investigation was completed on tank B-202 in 1996 because of a detected increase in surface level. As a result of this investigation, it was determined that this tank no longer meets the recently updated administrative procedure for 200 series tanks.

- (3) Original Interim Stabilization data are missing on four tanks: B-201, T-102, T-112, and T-201.
- (4) Tank 241-T-104 was Interim Stabilized on November 19, 1999. In-tank video taken October 7, 1999, shows the surface is clearly sludge-type waste with no saltcake present. No visible water on surface. Waste surface appears level across tank with numerous cracks. There is a minimal collapsed area around the saltwell screen, with no visible bottom.
- (5) Tank 241-T-110 was Interim Stabilized on January 5, 2000, due to major equipment failure. An in-tank video taken October 7, 1999 (pumping was discontinued on August 12, 1999), showed the surface of this tank as smooth, brown-tinted sludge with visible cracks.

**TABLE I-2. SINGLE-SHELL TANK INTERIM STABILIZATION MILESTONES**

February 29, 2000

(sheet 1 of 2)

New single-shell tank interim stabilization milestones were negotiated in 1999 and are identified in the "Consent Decree." The Consent Decree was approved on August 16, 1999.

**CONSENT DECREE**  
Attachments A-1 and A-2

Following is the schedule for pumping liquid waste from the remaining twenty-nine (29) single-shell tanks. This schedule is enforceable pursuant to the terms of the Decree except for the "Project Pumping Completion Dates" which are estimates only and not enforceable. (Note: Schedule does not include C-106)

<b>Tank Designation</b>	<b>Pumping Initiated</b>	<b>Projected Pumping Completion Date</b>	<b>Interim Stabilization Date</b>
1. T-104	Already initiated	May 30, 1999	November 19, 1999
2. T-110	Already initiated	May 30, 1999	January 5, 2000
3. SX-104	Already initiated	December 30, 2000	
4. SX-106	Already initiated	December 30, 2000	
5. S-102	Already initiated	March 30, 2001	
6. S-106	Already initiated	March 30, 2001	
7. S-103	Already initiated	March 30, 2001	
8. U-103*	September 26, 1999	April 15, 2002	
9. U-105*	December 10, 1999	April 15, 2002	
10. U-102*	January 20, 2000	April 15, 2002	
11. U-109*	June 15, 2000	April 15, 2002	
12. A-101	October 30, 2000	September 30, 2003	
13. AX-101	October 30, 2000	September 30, 2003	
14. SX-105	March 15, 2001	February 28, 2003	
15. SX-103	March 15, 2001	February 28, 2003	
16. SX-101	March 15, 2001	February 28, 2003	
17. U-106*	March 15, 2001	February 28, 2003	
18. BY-106	July 15, 2001	June 30, 2003	
19. BY-105	July 15, 2001	June 30, 2003	
20. U-108	December 30, 2001	August 30, 2003	
21. U-107	December 30, 2001	August 30, 2003	
22. S-111	December 30, 2001	August 30, 2003	
23. SX-102	December 30, 2001	August 30, 2003	
24. U-111	November 30, 2002	September 30, 2003	
25. S-109	November 30, 2002	September 30, 2003	
26. S-112	November 30, 2002	September 30, 2003	
27. S-101	November 30, 2002	September 30, 2003	
28. S-107	November 30, 2002	September 30, 2003	
29. C-103	No later than December 30, 2000, DOE will determine whether the organic layer and pumpable liquids will be pumped from Tank C-103 together or separately, and will establish a deadline for initiating pumping of this tank. The parties will incorporate the initiation deadline into this schedule as provided in Section VI of the Decree. CHG issued contract to subcontractor for scope and cost estimate. Draft report out for review; comments are being collected and incorporated.		

\* Tanks containing organic complexants.

**TABLE I-2. SINGLE-SHELL TANK INTERIM STABILIZATION MILESTONES**  
(sheet 2 of 2)

Completion of Interim Stabilization. DOE will complete interim stabilization of all 29 single-shell tanks listed above by September 30, 2004.

Percentage of Pumpable Liquid Remaining to be Removed.

93% of Total Liquid	9/30/1999
38% of Organic Complexed Pumpable Liquids	9/30/2000
5% of Organic Complexed Pumpable Liquids	9/30/2001
18% of Total Liquid	9/30/2002
2% of Total Liquid	9/30/2003

The "percentage of pumpable liquid remaining to be removed" is calculated by dividing the volume of pumpable liquid remaining to be removed from tanks not yet interim stabilized by the sum of the total amount of liquid that has been pumped and the pumpable liquid that remains to be pumped from all tanks.

**TABLE I-3. SINGLE-SHELL TANKS STABILIZATION STATUS SUMMARY**

**February 29, 2000**

[illegible]

**DISTRIBUTION**

**Number of copies**

**OFFSITE - USA**

2

**Congress of the United States**

U. S. Senate  
717 Hart Senate Building  
Washington D.C. 20510

Senator Ron Wyden

U. S. House of Representatives  
1323 Longworth House Office Building  
Washington D. C. 20515

Representative Richard "Doc" Hastings, 4th District

5

**U. S. Department of Energy-Headquarters**

1000 Independence Avenue, SW  
Washington, D. C. 20585

H. Calley	EM-38	Cloverleaf Bldg.
Kurt Juroff	EM-38	Cloverleaf Bldg.
William M. Levitan	EM-1	FORS/5A-014
Ralph Lightener	EM-38	Cloverleaf Bldg.

**U. S. Department of Energy-Headquarters**

19901 Germantown Rd  
Germantown, MD 20874

Kenneth Lang

EM-38 Cloverleaf Building

1

**U. S. Nuclear Regulatory Commission**

Division of Fuel Cycle, Safeguards & Security  
Mail Stop T8-A33  
Washington, DC 20555

Robert Pierson, Chief FSPB/FCSS (ADDRESSEE ONLY)

2

**Washington State Department of Ecology**

Nuclear & Mixed Waste Management Program  
P.O. Box 47600  
Olympia, WA 98504-7600

Library

**Washington State Department of Ecology**

Nuclear Waste Program  
300 Desmond Drive  
Lacey, WA 98504

R. Stanley

**Radiation Protection**  
**7171 Cleanwater Lane**  
**Box 47827**  
**Olympia, WA 98504-7827**

**i**

**625 Marion St. NE, Suite 1  
Salem, OR 97301**

**1**

**P. O. Box 2008**  
**Oak Ridge, TN 37831-6180**

MS-6180

**1**

**P. O. Box 1663  
Los Alamos, NM 87545**

**1**

1515 Eubank, NE  
P. O. Box 5800  
Albuquerque, NM 87185

**1**

**Donald T. Oakley**  
**9612 Hall Road**  
**Potomac, MD 20854**

**1**

**Power Systems Technology Group**  
350 Second Avenue  
Waltham, MA 02451-1196

1

**2101 Constitution Ave, N.W.  
Washington D. C. 20418**

1

**West Coast Office**  
1402 Third Avenue, Suite 1215  
Seattle, WA 98101

**Distr-2**

**1**                    **MACTEC**  
8310 Centerbrook Place  
Alexandria, VA 22308

**TRI-CITIES:**

**R. K. Welty**  
**409 S. 41st Ave**  
**West Richland, WA 99353**

**MACTEC - Meier Associates, LLC**  
J. D. Bingham R2-11  
M. A. Kufahl R2-11

2	<b><u>MACTEC - ERS</u></b>	
	J. F. Bertsch	B1-42
	R. G. McCain	B1-42
1	<b><u>MACTEC</u></b>	
	W. J. Stokes	R2-89
1	<b><u>General Accounting Office</u></b>	
	C. R. Abraham	A1-80
1	<b><u>Washington State Department of Ecology</u></b>	
	Library	B5-18
1	<b><u>U. S. Environmental Protection Agency</u></b>	
	D. R. Sherwood	B5-01
18	<b><u>U. S. Department of Energy-Office of River Protection</u></b>	
	H. L. Boston	A7-50
	D. C. Bryson	H6-60
	J. M. Clark	H6-60
	J. J. Davis	H6-60
	R. G. Harwood	H6-60
	R. D. Hildebrand	A5-13
	D. H. Irby	H6-60
	Liou, Wen-Shou	H6-60
	C. Pacheco	H6-60
	T. E. Olds	A7-75
	S. H. Pfaff	H6-60
	M. L. Ramsay	H6-60
	M. J. Royack	H6-60
	J. S. Shuen	H6-60
	A. B. Sidpara	H6-60
	R. A. Stolberg	A4-81
	D. J. Williams	T6-03
	D. D. Wodrich	H6-60
	Reading Room	H2-53
9	<b><u>Pacific National Northwest Laboratories</u></b>	
	S. A. Bryan	P7-25
	J. A. Dirks	K8-17
	R. E. Gephart	K9-76
	S.A. Hartley	K5-12
	D.G. Horton	K6-81
	J. L. Huckaby	K7-15
	B. E. Opitz	K6-75
	R. D. Scheele	P7-25
	L. A. Smyser	H6-61
123	<b><u>CH2M Hill (CHG), and Affiliated Companies</u></b>	
	D. I. Allen	R2-50
	J. J. Badden	S5-07
	D. G. Baide	S5-05
	L. Bedford	R2-84
	T. M. Blaak	S5-13
	V. C. Boyles	R2-11

P. J. Brackenbury	R3-73
C. B. Bryan	R2-58
J. W. Cammann	R2-12
K. G. Carothers	R2-11
R. J. Cash	R1-44
W. L. Cowley	R1-44
C. Defigh-Price	R2-12
D. K. DeFord	S7-24
W. T. Dehn	H6-63
M. P. Delozier	H7-08
M. L. Dexter (12)	R1-51
W. T. Dixon	R3-01
R. A. Dodd	R3-72
A. C. Etheridge	H7-07
S. D. Estey	R2-11
J. E. Ferguson	H7-06
R. A. Flores	S8-09
L. A. Fort	R2-12
K. D. Fowler	R2-11
G. T. Frater	S5-05
J. R. Freeman-Pollard	R2-89
K. A. Gasper	H6-19
B. C. Gooding	T4-01
M. D. Guthrie	S6-74
R. D. Gustavson	R3-83
D. B. Hagmann	R2-89
B. M. Hanlon (10)	T4-08
G. N. Hanson	T4-07
W.M. Harty Jr.	S5-13
D.C. Hedengren	R2-11
B. A. Higley	R3-73
K. M. Hodgson	R2-11
T. M. Hohl	R3-73
J. L. Homan	R3-72
H. R. Hopkins	R2-58
S. E. Hulsey	S7-86
M. N. Islam	R1-43
O. M. Jaka	S7-24
P. Jennings	R2-84
B.A. Johnson	S5-03
G. D. Johnson	R1-44
J. Kalia	R1-43
M. R. Kembel	S7-03
R. A. Kirkbride	R3-73
P. F. Kison	T4-07
N. W. Kirch	R2-11
J. S. Konyu	R4-04
J. G. Kristofzski	H6-62
M. J. Kupfer	R3-75
M. A. Lane	G3-12
C.E. Leach	R1-44
J. W. Lentsch	R3-25
R. R. Loeffler	S5-03
G. T. MacLean	B1-70
T. H. May	R2-11
D. J. McCain	R2-11
J. M. Morris	R2-84
M. A. Payne	R2-58

K. A. Prindiville	B4-67
C. Oldham	H6-60
R. E. Pohio	R2-84
R. E. Raymond (2)	S7-70
D. S. Rewinkel	S7-83
C. J. Rice	R2-53
W. E. Ross	R2-50
D. J. Saucressig	S7-20
J. S. Schofield	S7-12
R. E. Schreiber	B2-05
E. B. Schwenk, Jr.	H3-28
N. J. Scott-Proctor	S5-01
M. L. Sheriff	S5-07
D. H. Shuford	R1-56
S. G. Smith	L6-37
J. N. Strode	R2-11
T.D. Taylor	H6-64
R. R. Thompson	R2-12
D. T. Vladimiroff	S7-20
J. A. Voogd	H6-64
A. E. Young (10)	R1-10
F. A. Zak	S7-34
Central Files	B1-07
200 West Shift Office	T4-00
200 East Shift Office	S5-04
Environmental	
Data Mgmt Center (2)	H6-08
Unified Dose Assessment	
Center (UDAC)	A0-20
Document Processing Center	A3-94